



RTS/OTS680 Power/Ultra Series

Total Station Instruction Manual

RTS681/RTS682/RTS685(L)

OTS681-R300/R500


OTS682-R300/R500

OTS685-R300/R500

OTS681-R800/R1000

OTS682-R800/R1000

OTS685-R800/R1000

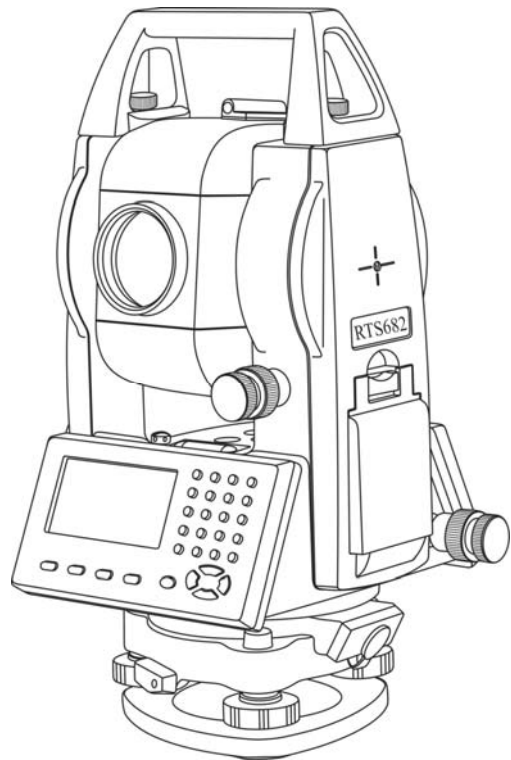

Ver: 2.0e(2012-07)

Suzhou FOIF Co., Ltd.

Dear Customer:

Congratulations! We, FOIF are proud to present you with these series instrument. Your total station is a rugged and reliable instrument whose performance and design are not surpassed.

To fully appreciate and protect your investment, we suggest that you take the necessary time to read and fully understand this manual. We have a dedicated service organization. If the need arises, please don't hesitate to contact us.

Thank you for your trust and confidence.

Contents

1. Precautions for Safety	1
1.1 Note	1
1.2 Definition of Indication	2
1.3 Safety Standards for Laser (OTS series)	3
2. Preparation before Measurement	5
2.1 About Battery	5
2.1.1 Battery Power Symbol	5
2.1.2 Replace the Battery	6
2.1.3 Recharge the Battery	6
2.2 Setting Up the Instrument	7
2.3 Centering and Levelling-Up	7
3. Basic Functions	9
3.1 Nomenclature	9
3.2 Basic Key Operation	11
3.3 Display	12
3.4 Mode Diagram	13
3.5 Power On/Off	14
3.5 Registration & Demo Mode	15
3.6 How to Input Number and Alphabet	16
3.7 How to Configure	17
3.8 How to Set Parameters	18
3.8.1 Measure Condition Setting	18
3.8.2 Instrument Basic Setting	19
3.8.3 Communication Port Setting	20
3.8.4 Unit Setting	21
3.8.5 Date & Time Setting	22
3.8.7 Key Function Setting	22
3.8.6 EDM Setting	24
4. Angle Measurement	25
4.1 Measure a Horizontal Angle of Two Points	25
4.2 Set the Horizontal Angle to a Required Value	26
5. Distance Measurement	27
6. Coordinate Measurement	29
6.1 Input the Occupied Point Data	29
6.2 Azimuth Setting	31
6.3 3D Coordinate Measurement	32
7. Stake out Measurement	34

7. 1 Distance Stake out	34
7.2 Coordinates Stake out Measurement.....	36
7.3 REM Stake out Measurement.....	37
8. Area	39
8.1 Area Calculation by Measured Data.....	39
8.2 Area Calculation by Reading Existed Coordinates	40
9. Offset Measurement	42
9.1 Single-distance Offset Measurement.....	42
9.2 Angle Offset Measurement.....	43
9.3 Dual-Distance Offset Measurement	45
10. MLM	47
10.1 Measuring Distance between Two or More Points	47
10.2 Change the Starting Point.....	48
11. REM	49
12. Resection	50
12.1 Coordinate Resection	51
12.2 Elevation Resection.....	52
12.3 Resection Calculation Process	54
12.4 Precautions When Performing Resection.....	55
13. Point Projection.....	56
13.1 Define Baseline	56
13.2 Point Projection	58
14. Stake out Line.....	59
14. 1 Define Baseline	59
14. 2 Stake Out Line-Point.....	60
14.3 Stake out Line/Line	61
15. Traverse Surveying.....	63
15.1 Save Coordinate	63
15.2 Read Coordinate.....	64
16. Inverse	65
17. Polar Coordinates Calculation.....	66
18. Repetition Angle Measurement.....	67
19. Arc Staking Out Measurement	69
19.1 Two Point Arc Staking Out.....	70
19.2 Three Point Arc Staking Out	71
20. Road Staking Out Measurement.....	73
20.1 Input the Start Station.....	74
20.2 Input Road Horizontal Elements	74

20.2.1 Input Line Element.....	74
20.2.2 Input Circle Element	75
20.2.3 Input Spiral Element.....	76
20.2.4 Road Horizontal Element Editing	76
20.3 Input Road Vertical Elements.....	78
20.3.1 Input Vertical Road Element.	78
20.3.2 Edit Vertical Road Element	79
20.4 Road Calculation	81
20.4.2 Additional Station Setting	82
20.4.3 Road Calculation	83
20.5 Road Staking Out Data View	84
20.6 Road Stake Out.....	85
20.7 Road File Management	86
20.7.1 Select a Road File.....	86
20.7.2 Rename a Road File	87
20.7.3 Delete a Road File	88
20.7.4 Delete all Road Files	89
21. Record	90
21.1 Record Occupied Data	90
21.2 Collect Angle Data	91
21.3 Distance&Coordinate Data	92
21.4 Record Note.....	93
21.5 View Data	94
21.6 Select job	95
22. JOB Management.....	96
22.1 Storage Media Select.....	96
22.2 Select a JOB	97
22.3 Rename a JOB	98
22.4 Delete a JOB.....	99
22.5 Output JOB Data	100
22.6 File Copy	101
22.7 Connect PC via USB port.....	102
23. Known Data Management.....	103
23.1 Input Known Point Coordinate by Keys	103
23.2 Input Known Point Coordinate via RS-232C.....	104
23.3 Delete known point coordinate	105
23.4 View known points data	106
23.5 Clear all known points' data.....	107

24. Code Management.....	108
24.1 Edit Code list.....	108
24.2 Clear all Codes	109
25. Warning and Error Messages	110
26. Check and Adjustment	111
26.1 The Instrument Constant	111
26.2 Tubular Level	112
26.3 Circular Level.....	112
26.4 The Optical Sight	113
26.5 Optical Plummet.....	113
26.6 Laser Plummet (optional).....	114
26.7 Vertical Cross-hair on Telescope.....	114
26.8 Horizontal Collimation Error C.....	115
26.9 Tilt Sensor	116
26.10 Vertical Index Error	117
26.11 EDM Optical Axis and the Telescope Sighting Axis Error	119
27. Technical Data.....	121
28. Accessories.....	131
Appendix I: Atmospheric correction formula and chart (Just for reference) .	132
Appendix II : Correction for refraction and earth curvature	134
Appendix III: Connect the TS680 series with PDA	135

1. Precautions for Safety

1.1 Note

◆ Don't collimate the sun directly

Avoid to insolate the instrument, and don't collimate the sun directly for protecting eyes and instrument.

◆ Avoiding the librations on the instrument

When transporting, keep the instrument in the case and try your best to lighten librations.

◆ Carry the instrument

When carrying, the instrument handle must be hold tight.

◆ Check the battery power

Before using it, you should check the power whether it is enough.

◆ Battery Maintainence

If the instrument is not in using for a long time, the battery should be taken out from the instrument and store in seperate place. Meantime, the battery should be charged every month.

◆ Take out the battery

It is not suggested to take out the battery when the instrument is on, otherwise, the stored data may be lost, so it is better to replace the battery after power off the instrument.

◆ Set up the instrument on the tripod

When using it please insure the connection between tripod and instrument is firm. It is better to work with wooden tripod for the measurement accuracy.

◆ Assemble the tribrach on the instrument

The setting of tribrach would influence the accuracy. The tribrach should be check frequently, the screw which connects the tribrach and alidade must be locked tightly. And the central fixing screw should be tight.

◆ High temperature condition

Don't put the instrument in high temperature condition for a long time, it is bad for the instrument performance.

◆ Temperature changing sharply

The sharp temperature changing on the instrument or prism will shorten the distance measurement range, for example, after taking the instrument out from a warm car to a cold condition, wait for some time, it can be used when it adapts the surrounding condition.

◆ The noise from the instrument

When the instrument working, it is normal if you hear the noise from instrument motor, it will not affect the instrument work.



◆ Stored data responsibility

FOIF should not be held liable for the lost data because of wrong operation.

1.2 Definition of Indication

For the safe of your product and prevention of injury to operators and other persons as well as prevention of property damage, items which should be observed are indicated by an exclamation point within a triangle used with WARNING and CAUTION statements in this manual.

The definitions of the indication are listed below. Be sure you understand them before reading the manual's main text.

	WARNING:	Ignoring this indication and making an operation error could possibly result in death or serious injury to the operator.
	CAUTION:	Ignoring this indication and making an operation error could possibly result in personal injury or property damage.



WARNING

- Do not perform disassembly or rebuilding. Fire, electric shock or burns could result.
Only FOIF authorized distributors can disassemble or rebuilt.
- Do not collimate the sun directly. The eye injury or blind could result.
- Do not cover the charger. Fire could be result.
- Do not use defection power cable, socket or plug. Fire, electronic shock could result.
- Do not use wet battery or charger. Fire, electronic shock could result.
- Do not close the instrument to burning gas or liquid, and do not use the instrument in coal mine. Blast could be result.
- Do not put the battery in the fire or high temperature condition. Explosion, damage could result.
- Do not use the battery which is not specified by FOIF. Fire, electric shock or burn could result.
- Do not use the power cable which is not specified by FOIF. Fire could result.

- Do not short circuit of the battery. Fire could result.
- When this product encounters disturbance of severe Electrostatic Discharge, perhaps it will have some degradation of performance like switching on/off automatically and so on.



- Do not touch the instrument with wet hand. Electric shock could result.
- Do not stand or seat on the carrying case, and do not turn over the carrying case arbitrarily, the instrument could be damaged.
- Be careful of the tripod tiptoe when setup or move it.
- Do not drop the instrument or the carrying case, and do not use defective belt, agraffe or hinge. Instrument damage could result.
- Do not touch liquid leaking from the instrument or battery. Harmful chemicals could cause burn or blisters.
- Please assemble the tribrach carefully, if the tribrach is not stable, series damage could result.
- Do not drop the instrument or tripod, series damage could result. Before use it, check the central screw is tight.

1.3 Safety Standards for Laser (OTS series)


OTS680 series adopt the class of Laser Product according to IEC Standard Publication 60825-1 Amd. 2:2001. According this standard, EDM device is classified as Class 3R Laser Product when reflectless measurement is selected, when the prism and reflective sheet is selected as target, the output is equivalent to the safer class 1. Follow the safety instructions on the labels to ensure safe use.

CAUTION: CLASS 3R LASER RADIATION WHEN OPEN

AVOID DIRECT EYE EXPOSURE.

CAUTION: CLASS 2 LASER RADIATION WHEN OPEN

DO NOT STARE INTO THE BEAM

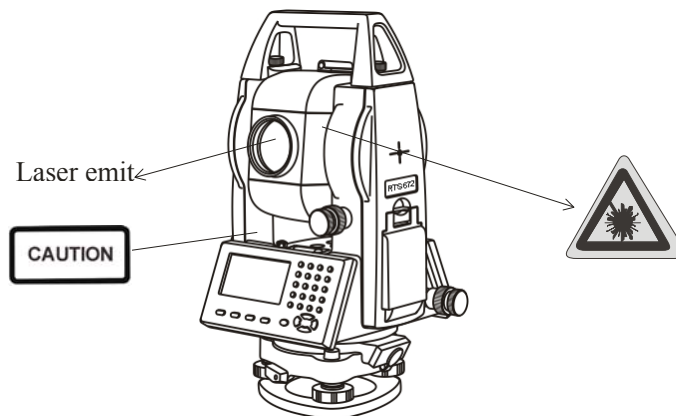

Note for Safety



WARNING

- Never point the laser beam at other's eyes, it could cause serious injury.
- Never look directly into the laser beam source, it could cause permanent eye damage.
- Never stare at the laser beam, it could cause permanent eye damage.
- Never look at the laser beam through a telescope or other optical devices, it could cause permanent eye damage.

1.4 About User

1) This product is for professional use only!

The user is required to be a qualified surveyor or have a good knowledge of surveying, in order to understand the user manual and safety instructions, before operating, inspecting or adjusting.

2) Wear required protectors (safety shoes, helmet, etc.) when operating.

1.5 Exceptions from Responsibility

1) The user of this products is expected to follow all operating instructions and make periodic checks of the product's performance.

2) The manufacturer, assumes no responsibility for results of a faulty or intentional usage or misuse including any direct, indirect, consequential damage, and loss of profits.

3) The manufacturer, assumes no responsibility for consequential damage, and loss of profits by any disaster, (an earthquake, storms, floods etc.).

4) The manufacturer, assumes no responsibility for any damage, and loss of profits due to a change of data, loss of data, an interruption of business etc., caused by using the product or an unusable product.


5) The manufacturer, assumes no responsibility for any damage, and loss of profits caused by usage except for explained in the user manual.

6) The manufacturer, assumes no responsibility for damage caused by wrong transport, or action due to connecting with other products.

2. Preparation before Measurement

2.1 About Battery

2.1.1 Battery Power Symbol

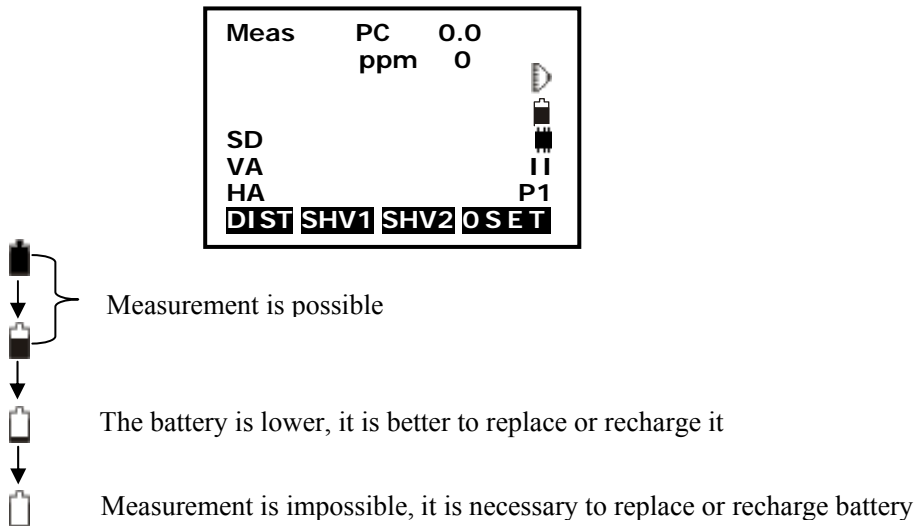

NOTE:

- ◆ The working time of battery will be effected by many factors, such as ambient temperature, recharging time, recharging and discharging times. On the data safe side, we suggest the users recharge the battery full or prepare several full batteries before operation.
- ◆ The battery symbol only indicates power capability for current measurement mode. The power consumption in distance measurement mode is more than in angle mode, if the instrument enters into distance measurement mode from angle mode, the power maybe auto-off because of lower battery.
- ◆ The symbol only indicates the supply power but not the instantaneous power change. And if the measurement mode changes, the symbol will not show the power's decrease or increase immediately.
- ◆ It is suggested to check every battery power before field work.

2.1.2 Replace the Battery




1) Remove the battery

- ① Press the button downward as shown left
- ② Remove the battery by pulling it toward you

2) Mount the battery

- ① Insert the battery to the instrument
- ② Press the top of the battery until you hear a Click.

2.1.3 Recharge the Battery

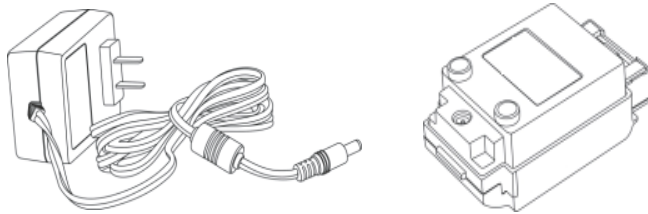

As above figures show, connect the charger and the battery, then plug the charger into the outlet of 110V-220V AC power supply, recharging will begin.

NOTE:

◆ For a new (or long time no use) battery, in order to fully extend its capacity, it is absolutely necessary to carry out 3 to 5 complete charging/discharging cycles, and the charging time must be 10 hours at least each time.

◆ The indicator light on the charger will illuminate three separate colors for varies mode conditions:

Solid Red Light—indicates that the charger is working;

Solid Green Light— indicates that the charge has finished;

Flashing Red Light—indicates no battery on charging, poor connection or some problems exist.

◆ It is recommended to continue charging for 1 or 2 hours after the light turn green.

◆ Once the red light flashes constantly after the charger is plugged into the outlet of 110V-220V AC power supply, please remove the battery and reconnected it after 3 or 5 min.

2.2 Setting Up the Instrument

Mount the battery in the instrument before performing this operation because the instrument will tilt slightly if the battery is mounted after leveling.

I. Set up the tripod first: extend the extension legs to suitable lengths and tighten the screws on the midsections. Make sure the legs are spaced at equal intervals and the head is approximately level. Set the tripod so that the head is positioned over the surveying point. Make sure the tripod shoes are firmly fixed in the ground.

II. Mount the instrument on the tripod head. Supporting it with one hand, tighten the centering screw on the bottom of the unit to make sure it is secured to the tripod.


2.3 Centering and Levelling-Up


1. Position tripod legs so that the plummet is aimed to the ground mark point. Turn the focusing ring of the optical plummet to focus.

2. Turn three footscrews of the tribrach till the center of reticle exactly coincides with the surveying point in any position.

3. Move the tripod legs to centre the circular level. The instrument is now roughly leveled-up.

4. Center the bubble in the circular level

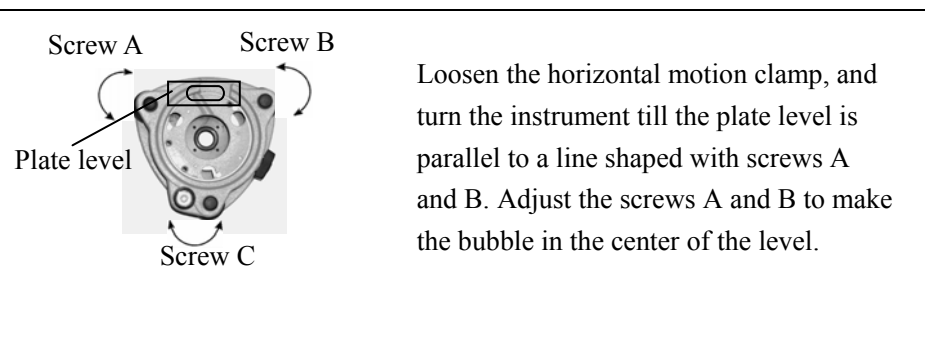

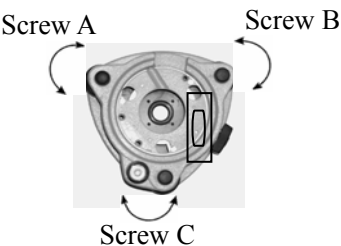

Turn the instrument approximately 90° .
Adjust screw C, till the bubble in the center of the level.

Repeat above steps until the bubble remains in the center of the plate level while the instrument is rotated to any position.

5. Center the surveying point again


Loosen the centering screw slightly. Looking through the optical plummet eyepiece, slide the instrument over the tripod head until the surveying point is exactly centered in the reticle. Re-tighten the centering screw securely.

6. Check again to make sure the bubble in the plate level is centered.


If not, repeat procedure 4.

2.4 Accurate Levelling-Up with Electronic Level on screen

It is convenient for 670/680 series to level-up with electronic level, especially when it is difficult to observe the circular level and plate level.

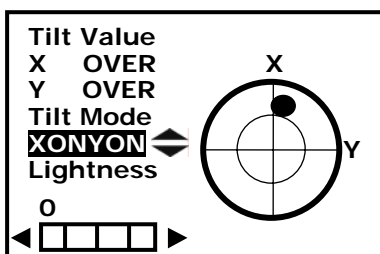

1. Power on the instrument and enter into measurement mode, press F1: [TILT] at P3 or press key {BS} directly, and the electric level displays on screen.

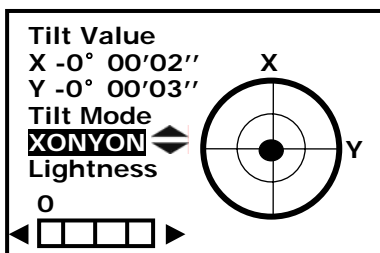


2. Level it by turning three foot screws, see above operation “3. Center the bubble in the plate level”. Be sure the ● is always in the center.


Note: 1. On this menu you can turn on/off the X/Y compensator by pressing ▲ or ▼ key.

2. If the instrument is equipped with laser plummet, after opening this menu, the laser plummet adjusting bar will display. With pressing ◀ or ▶ key the laser lightness can be adjusted.


3. Basic Functions

3.1 Nomenclature

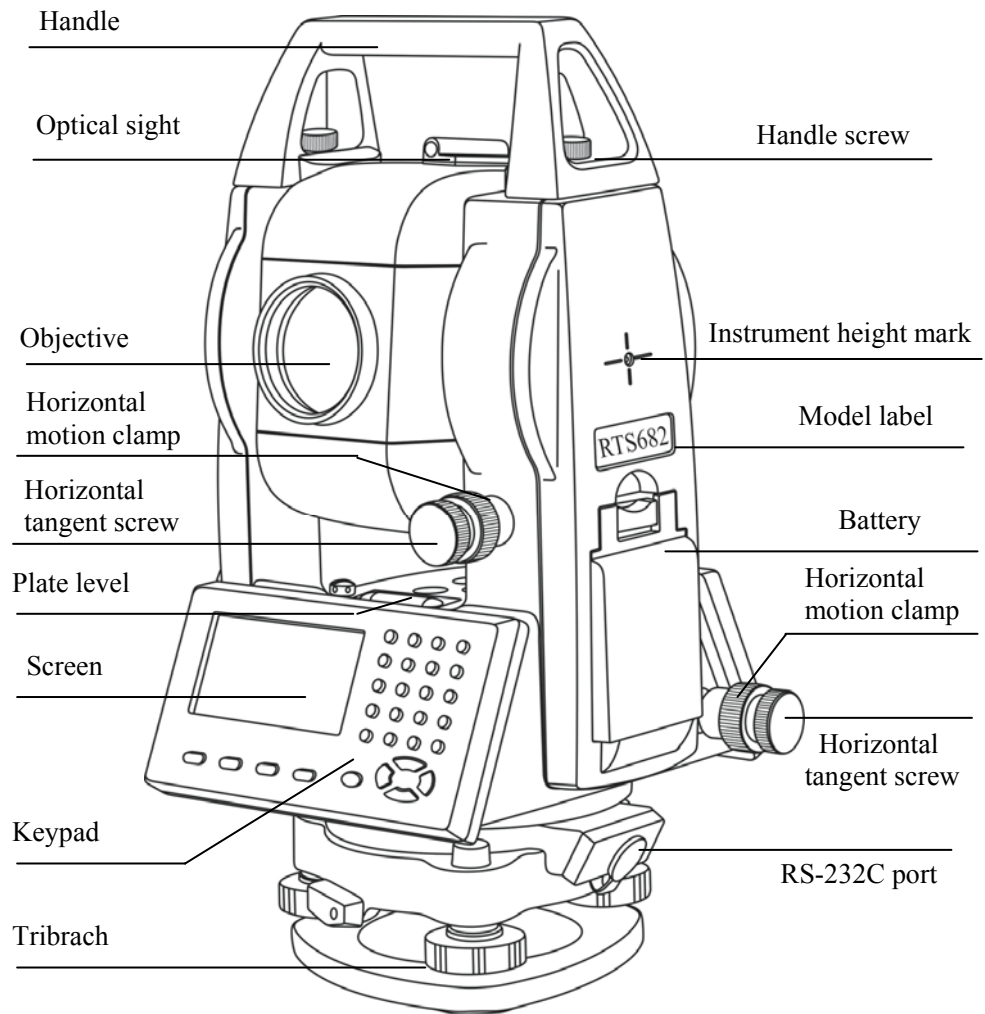

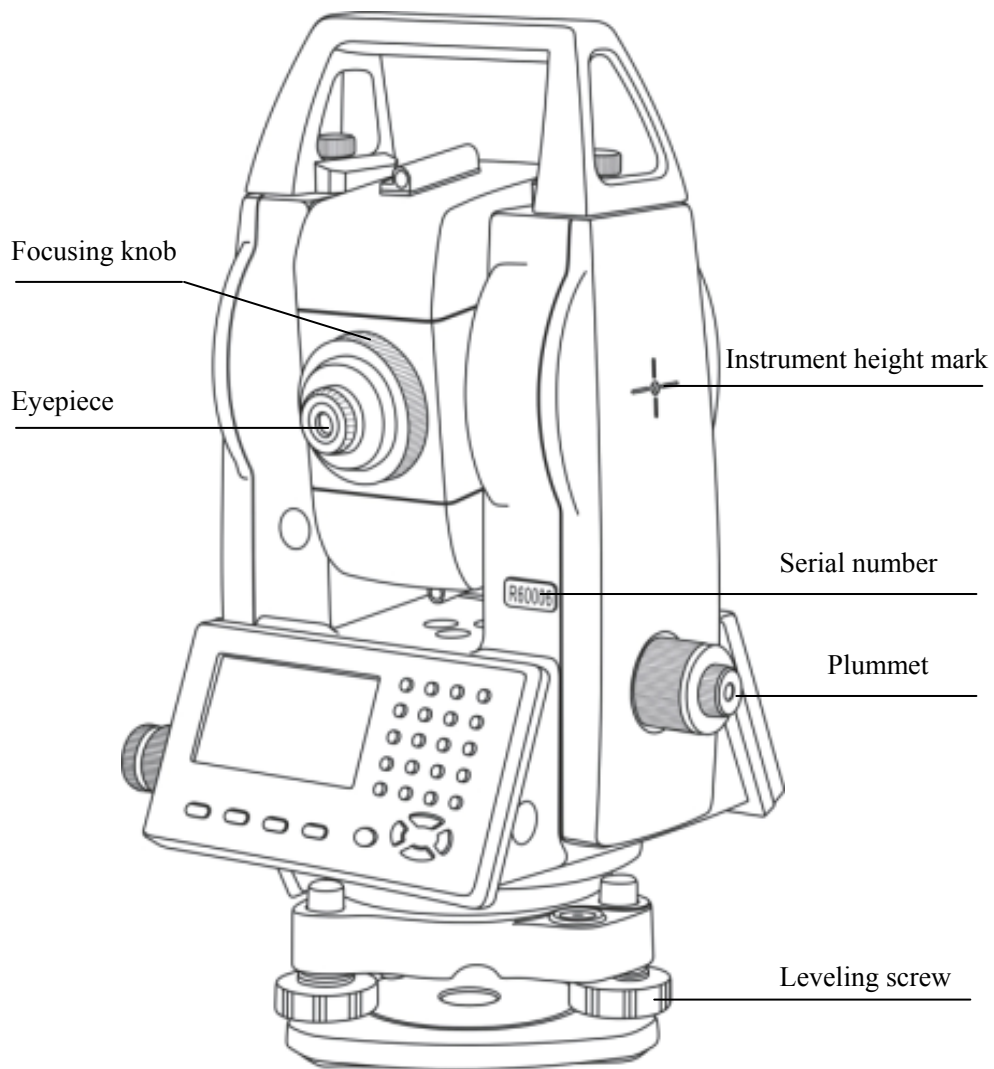

3.2 Basic Key Operation

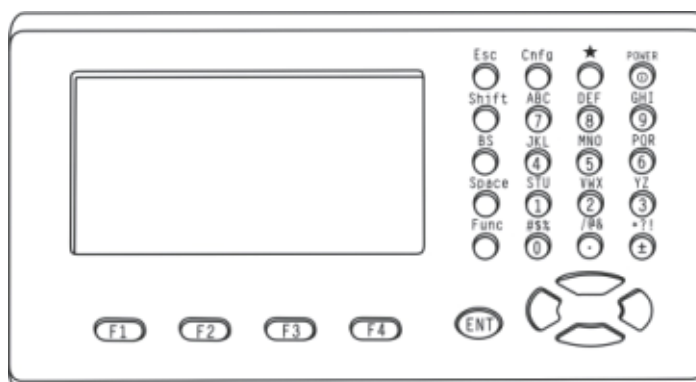


Keys	Description
F1~F4	Select the functions matching the softkeys
0~9	1.Input number when numeric input 2.Input characters when alphabetic input
•	Input a decimal point
±	Input plus/minus sign
Power	Power on/off
★	Enter into setting mode directly
Cnfg	Enter into config mode directly
ESC	Escape to the previous menu or mode
Shift	1. Shift between number and alphabetic when inputting 2.Shift targets model when measuring
BS	1. Delete the character at the left of the cursor when inputting 2. Open electronic level menu
Space	1. Input a black space when inputting 2. Input the target or instrument height
Func	Turn page
ENT	1. Select/Accept input data 2. Accept the option when selecting


3.3 Display

The LCD could display 8 lines with 24 characters per line. In measurement mode, it displays some common information in above 7 lines and displays soft functions in the last line.


Status screen

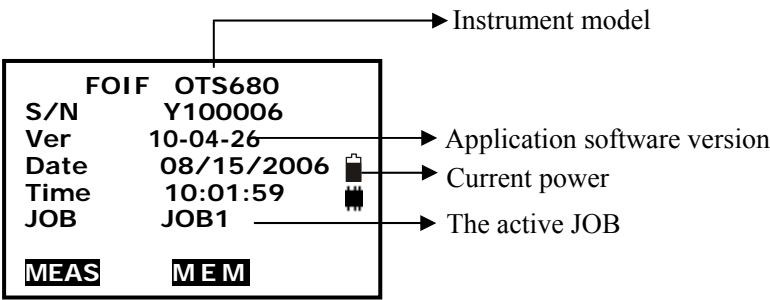

Basic measure mode

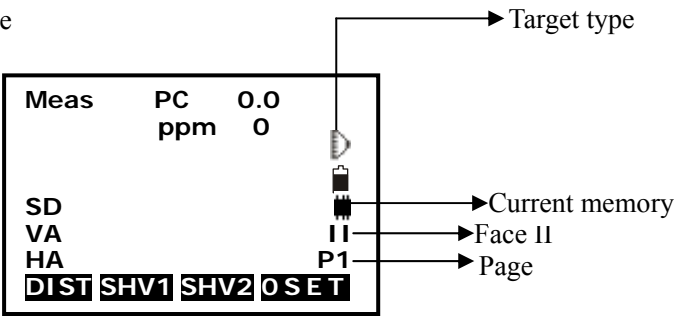

Measuring

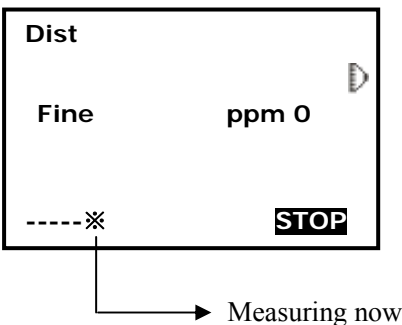

Setting mode (Press {★} directly)

Inst Config	
1.Backlight	: YES
2.LCD contrast	:5
3.Reticle lev	:7
4.Key Beep	:YES
5.EDM signal	:
EDM	

Config mode (Press {Cnfg} directly)

Config	
1.Meas condition	
2.Inst config	
3.Inst adjust	
4.Com setting	
5.Unit	
6.Date & Time	
7.Key Function	

3.5 Power On/Off


I. Power on



1. Confirm the instrument is leveling, press the red key {POWER}.

FOIF OTS680	
S/N	Y100056
Ver	10-06-21
Date	07/12/2010
Time	10:01:59
JOB	JOB1
MEAS	MEM

2. The instrument will power on and display the status screen.

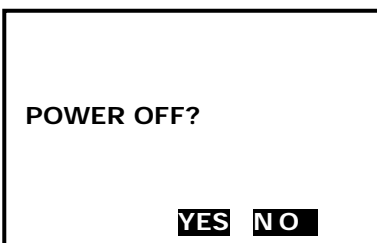


II. Power off

Press {POWER} key, the instrument will ask you to turn off the instrument or not, press F3(Yes), it will be turned off, press F4(No) back to previous screen.

3.5 Registration & Demo Mode

When you start TS680 for the first time you will see the registration screen.

To activate TS680 program you need to call FOIF local dealer, or email us the instrument serial number.

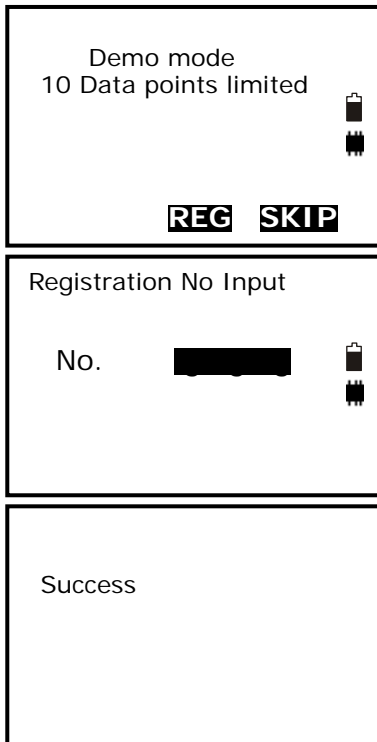

The image displays three sequential screenshots of the TS680 registration process, each enclosed in a black rectangular border.

The first screenshot shows the 'Demo mode' screen. It displays the text 'Demo mode' and '10 Data points limited' at the top. On the right side, there is a battery level icon and a signal strength icon. At the bottom, there are two buttons labeled 'REG' and 'SKIP'.

The second screenshot shows the 'Registration No Input' screen. It displays the text 'Registration No Input' at the top. Below this, there is a label 'No.' followed by a black rectangular input field. On the right side, there is a battery level icon and a signal strength icon.

The third screenshot shows the 'Success' screen. It displays the text 'Success' at the top.

We will then issue you a registration number that you can enter in the No. field. Press F3(REG) key to program resisting screen, when you enter the registration number you will see the words "Success" and the program will run in registered mode.

If you have no the registration number, you can press F4(SKIP) to run TS680 in demo mode. In Demo mode the program is limited to taking only 10 points.

3.6 How to Input Number and Alphabet

```
001:CODEAB
002: 
003:
004:
005:
006:
007:
↑ ↓ .P TOP LAST DEL
```

```
001:CODEAB
002:MY01
003: 
004:
005:
006:
007:
↑ ↓ .P TOP LAST DEL
```

1. Enter into input code status (See § 21.1 Input a code), the cursor is blinking and ready to input. The note “A” at the top right corner shows the active input mode, you can press the key {shift} to switch between alphabet and number.

2. Input the code in turn and press the blue key {ENT} to save it. You can press key {BS} to delete your wrong input before the cursor. The max length of a code is 16 characters.

Inst Config	
1.Backlight	: YES
2.LCD contrast	:5
3.Reticle lev	:7
4.Key Beep	:YES
5.EDM signal	:
EDM	

Inst Config	
1.Backlight	: YES
2.LCD contrast	:5
3.Reticle lev	:7
4.Key Beep	:YES
5.EDM signal	:
EDM	

Inst Config	
1.Backlight	: YES
2.LCD contrast	:5
3.Reticle lev	:7
4.Key Beep	:YES
5.EDM signal	:
EDM	

Inst Config	
1.Backlight	: YES
2.LCD contrast	:5
3.Reticle lev	:7
4.Key Beep	:YES
5.EDM signal	:
EDM	

Inst Config	
1.Backlight	: YES
2.LCD contrast	:5
3.Reticle lev	:7
4.Key Beep	:YES
5.EDM signal	:26
EDM	

EDM	
Mode	:Fine "r"
Reflector	:Prism
Prism const	:0
Temp.	:20℃
Pressure	:1013hPa
ppm	:0
OPPM	

3.7 How to Configure

Press key {★} on panel directly to enter into in any status, and do some basic settings.

1. Backlight

Press numeric key {1}, then press left key {▶} or right key {◀} to turn on or not.

2. LCD contrast

Press numeric key {2}, then press left key {▶} or right key {◀} to adjust it.

3. Reticle level

Press numeric key {3}, then press left key {▶} or right key {◀} to adjust it. If the value is zero, the illumination is turned off.

4. Key beep

Press numeric key {4}, then press left key {▶} or right key {◀} to turn on key beep or not, if you select NO, you will not hear the beep voice when press the key.

5. EDM returned Signal

Aim at a target, then press numeric key {5} and the instrument will beep, the EDM returned signal value will display simultaneously.

6. EDM setting menu

Press function key {F1} to open the EDM setting menu.

3.8 How to Set Parameters

Press key {Cnfg} on the keyboard to enter into config mode in any status, all the following items can be set.

3.8.1 Measure Condition Setting

<div style="border: 1px solid black; padding: 5px;"> Config 1.Meas condition 2.Inst config 3.Inst adjust 4.Com setting 5.Unit 6.Date & Time 7.Key Function </div>	1. Press key {Cnfg} to enter into config mode. 2. Select “ 1.Meas condition ” to set measurement parameters. All items display on two pages.
<div style="border: 1px solid black; padding: 5px;"> Meas condition P1 1.Dist mode :HD 2.Tilt adjust :XONYON 3.Refr.coeff :.20 4.VA display :VA 5.HA display :HAR 6.HA buzzer :No 7.Coord :N-E-Z </div>	3. Change the settings if necessary. Press keys { ▲ } / { ▼ } to select items and press keys { ◀ } / { ▶ } to set options. 4. Press key {ESC} back to the previous mode.

Table 3-1 List of measurement condition setting

Item	Options
1.Dist mode	SD * /HD/VD
2.Tilt adjust	XonYon * /XonYoff/XoffYoff
3.Refr.coeff	.14 * /.20/No
4.VA display	Zenith * /VA/V90
5.HA display	HAR * /HAL
6.HA buzzer	No * /Yes
7.Coord	N-E-Z * /E-N-Z
1.Min reading	1" * /5" /10" ; 0.0002g * /0.001g/0.002g; 0.005mil * /0.02mil/0.05mil
2.ppm correct	No * /Yes (auto correct ppm by sensors or not
Code effect	The manual input code is available once or always
Vdist mode	Display mode of vertical distance: to instrument center or to the ground

NOTE:

- ◆ Every first options with the symbol “ * ” are the factory setting.

3.8.2 Instrument Basic Setting

Config 1.Meas condition 2.Inst config 3.Inst adjust 4.Com setting 5.Unit 6.Date & Time 7.Key Function	1. Press key {Cnfg} to enter into config mode. 2. Select “ 2.Inst config ” to set instrument basic parameters. Three items display.
Inst config 1.Auto off :15min 2.LCD contrast :9 3.Reticle adjust :7	3. Change the settings if necessary. Press keys {▲}/ {▼} to select items and press keys {◀}/ {▶} to set the options. 4. Press key {ESC} back to the previous mode.

Table 3-2 Option list of basic setting

Item	Options
1.Auto off	30min * /No/5min/10min/15min (The instrument would power off automatically to save battery if no operation in setting time)
2.LCD contrast	0~13 (9 *)
3.Reticle adjust	0~9 (7 *)

NOTE:

- ◆ The options with the symbol “ * ” are the factory setting.

3.8.3 Communication Port Setting

Please set communication parameters before connecting your computer.

Config 1.Meas condition 2.Inst config 3.Inst adjust 4.Com setting 5.Unit 6.Date & Time 7.Key Function	1. Press key {Cnfg} to enter into config mode. 2. Select “ 4.Com setting ” to set the parameters of communication port.
Com setting 1.Baud rate :1200 2.Data bits :8bit 3.Parity :No 4.Stop bit :1bit 5.Check sum :No 6.Xon/Xoff :No 7.Comode :B-TOOTH	3. Change the settings if necessary. Press keys {▲}/ {▼} to select items and press keys {◀} / {▶} to set the options. 4. Press key {ESC} back to the previous mode.

Table 3-3 Option list of com setting

Item	Options
1.Baud rate	1200 * /2400/4800/9600/19200/38400
2.Data bits	8bit * / 7 bit
3.Parity	No * / Even/ Odd
4.Stop bit	1bit * / 2bit
5.Check sum	No * / Yes
6.Xon/Xoff	No * / Yes
7.Com mode	RS-232/B-TOOTH

Note:

- ◆ Every first options with the symbol “ * ” are the factory setting.

3.8.4 Unit Setting

Config
 1.Meas condition
 2.Inst config
 3.Inst adjust
 4.Com setting
5.Unit
 6.Date & Time
 7.Key Function

Unit
 1.Temp. :°C
 2.Pressure :hPa
 3.Angle :degree
 4.Dist :meter

1. Press key {Cnfg} to enter into config mode.
2. Select “**5.Unit**” to set unit.
3. Change the settings if necessary. Press keys {▲}/ {▼} to select items and press keys {◀} / {▶} to set the options.
4. Press key {ESC} back to the previous mode.

Table 3-4 Option list of unit setting


Item	Options
1.Temp.	°C * / °F
2.Pressure	hPa * / mmHg / inchHg/mbar/psi
3.Angle	degree * / gon / mil
4.Dist	meter * / Us-feet/Int-ft

Note:

- ◆ Every first options with the symbol “ * ” are the factory setting.


3.8.5 Date & Time Setting

The date and time displays at the status mode.

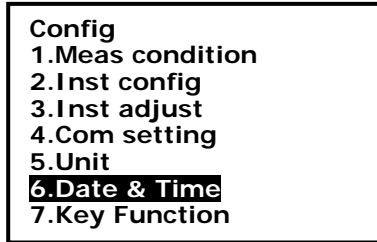

1. Press key {Cnfg} to enter into config mode.

2. Select “**6.Date & Time**”.

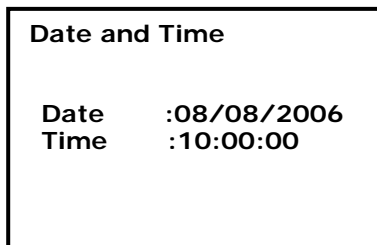


3. Input date and time. The date format: month/date/year.

4. Press key {ENT} to save settings and back to the previous mode.

3.8.7 Key Function Setting

1. Press key {Cnfg} to enter into config mode.

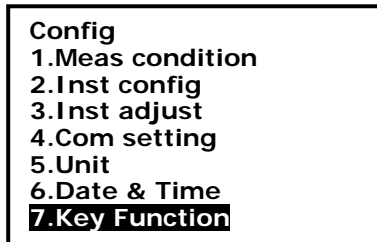


2. Select “**7.Key Func**”.

3. Press key {1} to enter **Key Set** menu

4. Press key {2} to enter **Key Save** menu


5. Press key {3} to enter **Key Resume** menu

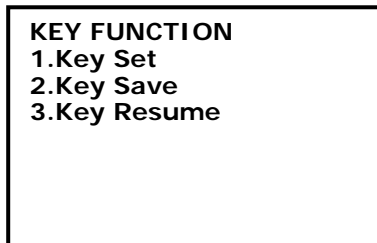

Key Set: the soft key's function at basic measurement mode can be changed

1. Move the cursor to the key, change the key's function according to your need by pressing keys {▲}/ {▼} to select.

2. Press Key {OK} to confirm the key defined

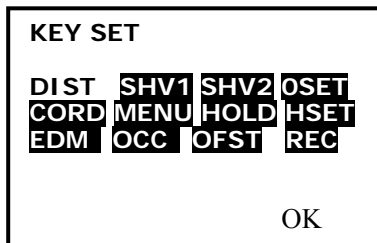

Following items can be defined:

Items	Descriptions
DIST	Start distance measure
SHV1	Display switching between SD/HAVA, HD/HA/VA and VD/HA/VA
SHV2	Display switching between SD/HD/VD and SD/HA/VA
OSET	Set horizontal angle to 0
CORD	Enter coordinate measurement menu
MENU	Enter program menu
HOLD	Hold the horizontal angle
HSET	Set horizontal angle
EDM	Enter distance setting menu
OCC	Setting the station point
OFST	Enter offset measurement menu
REC	Enter points collection menu
RES	Enter resection program menu
REMS	Enter angle repeat measurement menu
MLM	Enter missing line measurement menu
S.O.	Enter stake out measurement menu
TILT	Display electronic level
REM	Enter remote elevation measurement menu
HARL	Horizontal angle display switching between HR and HL
ZA/%	Vertical angle display switching grade and zenith
OUT	Output the current measurement data via RS-232C port
AREA	Enter area measurement menu
ROAD	Enter road measurement menu
IHT	Enter instrument height setting menu
LSO.	Enter line stake out measurement menu
PROJ	Enter point projection measurement menu

KEY FUNCTION SAVE

- 1.User Define 1**
- 2.User Define 2**

Key Save

1. Press key {1} to save the current key setting in **User Define 1**
2. Press key {2} to save the current key setting in **User Define 2**



KEY FUNCTION RESUME

- 1.User Define 1
- 2.User Define 2
- 3.Default Define

Key Resume

1. Press key {1} to resume the User Define 1 as the current Key setting
2. Press key {2} to resume the User Define 2 as the current Key setting
3. Press key {3} to resume the Default Define as the current Key setting

3.8.6 EDM Setting

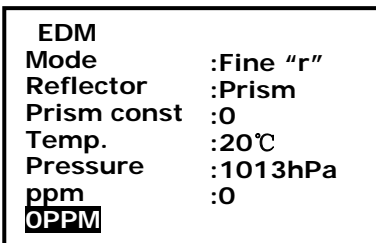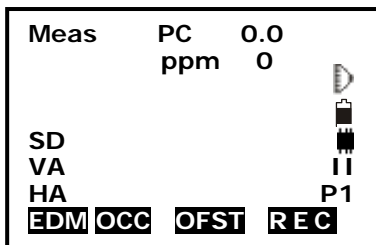

1. Press F1: [MEAS] in the status mode or select to enter into measure mode.

Press key {Func} to turn to page P3.

2. Press F1: [EDM] to enter into EDM setting.

3. Change the settings if necessary. Press keys {▲}/ {▼} to select the first three items and press keys {◀} / {▶} to set the options.

4. Press key {ESC} back to the previous mode.

Table 3-5 EDM setting


Item	Options
1.Mode	Fine "r" * / FineAVG 3 / Fine "s" / Rapid "s" / Tracking
2.Reflector	Prism * / Sheet/ No prism
3.Prism const	-99~99
4.Temp.	-30~60°C(20°C *)/-22~140°F
5.Pressure	500~1400hPa(1013hPa *); 375~1050mmHg(760mmHg *); 14.8~41.3 inchHg (29.9inchHg *) 500~1400mbar(1013mbar *); 7.2~20.3Psi(14.7Psi *)
6.ppm	-499~499(0 *), Press F1: [OPPM] to set temperature, pressure and ppm as factory setting.

Note:

- ◆ Options with the symbol “ * ” are the factory setting.
- ◆ ppm value could be calculated by inputted temperature and pressure, or input directly.
If the option of “ppm correct” is set as “Yes”, the temperature, pressure and ppm can not be inputted by hand.
- ◆ This operation is also available in stake out mode.
- ◆ You can press star {★}/F1[EDM] key to enter EDM setting menu directly.

4. Angle Measurement


4.1 Measure a Horizontal Angle of Two Points

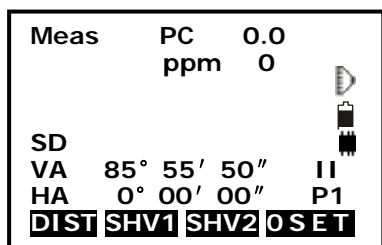


1. Sight the 1st target.

Press F4: [OSET] twice to set the 1st target as 0° at P1 in the measure mode.

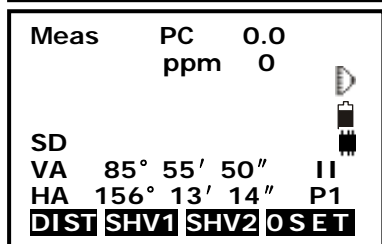

Press [SHV1] or [SHV2] to change display status firstly if in distance mode.

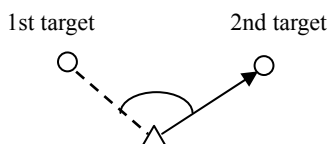

2. Sight the 2nd target. The displayed value is the included angle between two points.



4.2 Set the Horizontal Angle to a Required Value

Meas	PC	0.0	
	ppm	0	
			
			
SD			
VA	302.5432gon		II
HA	0.0000gon		P2
CORD MENU HOLD HSET			

Set H Angle	
1. Azimuth	
2. Back sight	

Set H Angle	
Azimuth	-399.9998
Tgt.H	0.000m
PT#	
Observe point!	
OK	

Meas	PC	0	
	ppm	0	
SD			
VA	302.5432gon		II
HA	399.9998gon		P1
CORD MENU HOLD HSET			

1. Take your instrument sight the 1st target.

Press F4: **[HSET]** at P2 in the measure mode.

2. Select the first item 1.Azimuth, and input the required value in Azimuth filed, then press {ENT} to save the value. And it displays as the horizontal angle.

The range and format of the input value:

gon: 0~399.9999

degree: 0~359.5959

mil: 0~6399.990

3. Sight the 2nd target. The horizontal angle from the 2nd target to the value set as the horizontal angle is displayed.

NOTE: Pressing **[HOLD]** performs the same function as above. The horizontal angle is in hold status when **[HOLD]** is flashing, press **[HOLD]** again to release the hold status.

5. Distance Measurement

Please set the following items before distance measurement:

- Measurement condition (See § 3.8.1 Measure Condition Setting)
- EDM (See § 3.8.6 EDM setting)

【Procedure of distance measurement】

Meas	PC	0
	ppm	0
SD		
HD		II
VD		P1
DIST	SHV1	SHV2 0SET

1. Aim at the target, press F3:[**SHV2**], the display mode of basic measurement will change to SD/HD/VD mode, and then press F1: [**DIST**] to start measure distance.

Dist	
Fine	ppm 0
-----✖	STOP

2. The symbol “✖” moves continually when measuring distance. Distance measuring mode, prism const and ppm value are also presented.

Meas	PC	0
	ppm	0
SD	10.329m	
HD	7.009m	II
VD	7.586m	P1
DIST	SHV1	SHV2 0SET

3. Press F4: [**STOP**] to finish measurement. The “SD”, “HD”, and “VD” will display as shown left.

Meas	PC	0
	ppm	0
SD	10.329m	
HD	7.009m	II
VD	7.586m	P1
DIST	SHV1	SHV2 0SET


4. Press F3: [**SHV2**], SD/HD/VD and SD/VA/HA are displayed alternatively.

NOTE:

- ◆ Make sure that the target setting in the instrument matches the type of target used.
- ◆ If the objective lens is dirty, it will affect the accurate of measured results. Dust it off with your special brush and wipe it with your special cloth (in your carrying case) before putting away.
- ◆ If an object with a high reflective factor (metal, white surface) exists between the instrument and the target when measuring, the accuracy of the measured results will be affected.
- ◆ An angle is also able to be measured when distance measurement.
- ◆ Measurement will automatically stop after a single measurement if the EDM mode is single (Fine “S” / Rapid “S”).
- ◆ If the distance measurement mode is average “Fine AVG”, the measured distances are displayed as “-1”, “-2”, “-3”... “-9” in turn, and the average value will display behind “-A” once the selected time’s measurement has been finished.

6. Coordinate Measurement

It is possible to find the 3D coordinates of a target by coordinate measurement. Please input the occupied coordinate, instrument height, target height, backsight coordinate (or azimuth angle) and azimuth before coordinate measurement.

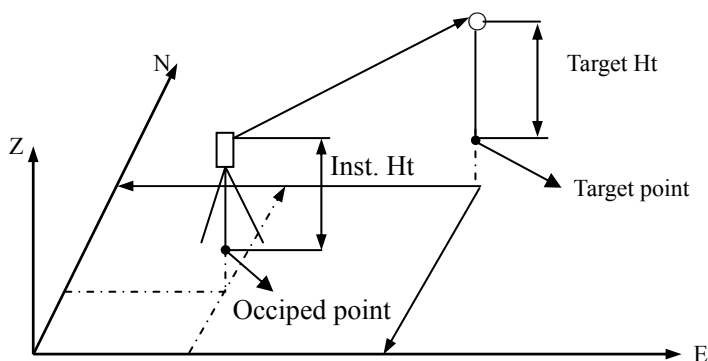

6.1 Input the Occupied Point Data

【Procedure of inputting occupied point data】

Meas	PC	0.0
	ppm	0
SD		
VA		
HA		P1
CORD	MENU	HOLD HSET

Coord
1. Occ. orientation
2. Measure
3. EDM
4. JOB select

Coord
1. Occ. coordinate
2. Set H angle

1. Measure the height of target and instrument with a tape, etc.

2. Press F1: **[CORD]** at P2 in the measurement mode.

3. Select “**1. Occ. orientation**”.

4. Select “**1. Occ. coordinate**” to input the occupied coordinates, instrument height and target height in corresponding field.

Occ. Coordinate	
NO:	0.000
E0:	0.000
Z0:	0.000
PT#	
Inst.H:	1.500m
Tgt.H:	1.400m
READ	RES REC OK

5. Press F3: **[REC]** to record the data in active occupied data list, see “ § 18.1 Record Occupied Data”. You could press F1: **[READ]** to read the existed data for occupied point from memory.

You could also press F2: **[RES]** to enter Resection program to get the station point coordinate, see “ § 12.

Resection”.

Press F4: **[OK]** to confirm your setting.

How to read the existed data:

Known point data, coordinate data and instrument occupied data in the current JOB and coordinate search JOB can be read. Confirm that the JOB containing the coordinates you wanna read is already selected in coordinate search JOB, see “ § 22.2 Select a JOB ”.

Occ. Coordinate	
NO:	0.000
E0:	0.000
Z0:	0.000
PT#	
Inst.H:	1.500m
Tgt.H:	1.400m
READ	RES REC OK

1. Press F1: **[READ]** when inputting the coordinate.

2. The list of existed coordinate displays as shown left:

Occ. : Occupied data saved in the current JOB or in the coordinate search JOB.

Coord: Measured coordiante data saved in the current JOB or in the coordinate search JOB

Pt# : Known point data saved in the current JOB or in the coordinate search JOB.

Occ.	15
Coord	56
Coord	20
PT#	50
Coord	45
Occ.	2
↑ ↓ .P TOP LAST SRCH	

◆ **[↑ ↓ .P]** : Press keys { **▲** } / { **▼** } to move one by one.

◆ **[↑ ↓ .P]**: Press keys { **▲** } / { **▼** } to turn the previous/next page.

Press F1 to switch between **[↑ ↓ .P]** status and **[↑ ↓ .P]** status.

◆ **[TOP]**: Press it and the first point on the first page will display.

◆ **[LAST]**: Press it and the last point on the last page will display.

◆ **[SRCH]**: Press it to enter into “coordinate data search” mode. Input the required point number to search.

Occ. Coordinate	
NO:	100.000
E0:	100.000
Z0:	10.000
PT#	5
Inst.H:	1.500m
Tgt.H:	1.300m
READ	RES REC OK

3. Select the required data and press the key {ENT}. The corresponding data will display. You could re-edit the data and it won’t affect the original coordinate data.


4. Press F4: [OK] to save the setting.

NOTE:

- ◆ The point number that was read is displayed until the current JOB is changed or a new point number is selected.
- ◆ If more than two points with the same point name exist in the current JOB, the instrument finds the first recorded data only.

6.2 Azimuth Setting

The azimuth of backsight could be inverse calculated by the coordinates of occupied and backsight.

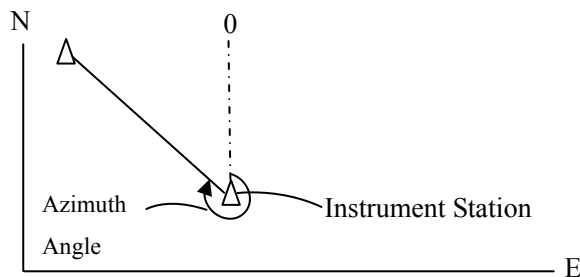

Set H angle
1.Azimuth
2.Back sight

1. Select “**2. Set H angle**”, see “§ 6.1 Input the occupied point data”. Then select “**2. Backsight**”.

Set H angle/BS

NBS: 20.000
EBS: 20.000
ZBS: 20.000
Pt# P20

READ

OK

2. Input the coordinate of backsight. You could also press F1: [READ] to select existed point data. If you input the same coordinates with the occupied point, a message “Same coordinates” will appear and disappear in 5sec, please re-input the data.

3. Press F4: [OK] to accept the inputted occupied and backsight coordinates, the calculated azimuth angle will display.

Set H angle/BS
Azimuth 450000
Tgt.H 0.000m
Pt#

MEAS

REC

OK

4. Aim at the backsight point, and then press F1:[MEAS] to check the backsight, or press F3: [REC] to record and set the station, then back to the previous mode. You could also press F4: [OK] to set the station, but the data will not be recorded.

Note:

- ◆ You can select “1. Azimuth” to input the azimuth angle directly.
- ◆ After input the coordinate of backsight, you can press F1:[MEAS] to check for backsight checking, HD between station and backsight, dHD and dVD between calculated backsight and measured backsight will be display.

Set H angle/BS	
Azimuth	45° 00' 00"
Tgt.H	1.000m
Pt#	
HD	0.163m
dHD	-0.163m
dVD	11.655
	REC OK

press F3: [REC] to record and set the station, then back to the previous mode. You could also press F4: [OK] to set the station, but the data will not be recorded.

6.3 3D Coordinate Measurement

The target coordinate could be measured after the setting of occupied point and backsight azimuth.

The formular used to calculate:

$$N1 = N0 + S \times \sin Z \times \cos Az$$

$$E1 = E0 + S \times \sin Z \times \sin Az$$


$$Z1 = Z0 + S \times \cos Z + IH - TH$$

Where:

N0-E0-Z0: occupied point coordinates

S: SD Z: Zenith angle Az: Azimuth angle

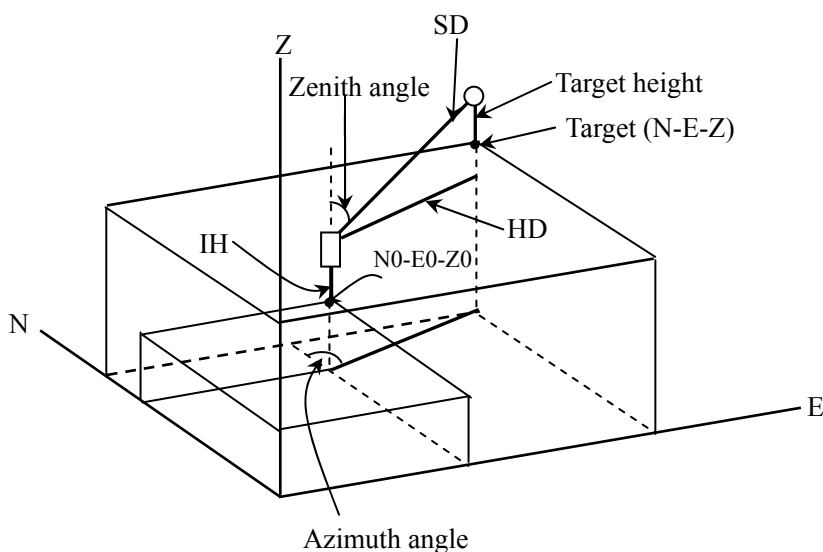

IH: Instrument height TH: Target height



【Procedure of 3D coordinates measurement】

Coordinate
1. Occ. Orientation
2. Measure
3. EDM
4. JOB select

Coord Measure

N	1000.000	
E	1000.000	
Z	10.466	
VA	132.3648gon	II
HA	150.3536gon	
MEAS	TAGT	REC

1. Aim at the target point.
2. Select “**2. Measure**” to start. The coordinate value of the target is displayed.
3. Press F2: [**TAGT**] to re-input the occupied data if necessary, see “ § 6.1 Input the occupied point data”. You can press F4: [**REC**] to record the data.
4. Aim at the next target, press F2: [**TAGT**] to re-input the target height if necessary, and press F1: [**MEAS**] to continue. Follow this operation till all targets have been measured.
5. Press key {ESC} back to the coordinate mode.

7. Stake out Measurement

Stake out measurement is used to stake out the required point. The difference between the previously inputted data to the instrument (the stake out data) and the measured value can be displayed by measuring the horizontal angle, distance or coordinates of the sighted point.

The horizontal angle difference and distance difference are calculated and displayed using the following formulas:

Horizontal angle difference

$dHA = \text{Horizontal angle of stake out data} - \text{measured horizontal angle}$

Distance difference

Distance Displayed item

SD: S-O SD = measured slope distance – slope distance of stake out data

HD: S-O HD = measured horizontal distance – horizontal distance of stake out data


VD: S-O VD = measured height difference – height difference of stake out data

NOTE:

- ◆ Stake out data can be input in various modes: SD, HD, VD, coordinates and REM measurement.
- ◆ EDM settings could be set in this mode.

7.1 Distance Stake out

The point to be found based on the horizontal angle from the reference direction and the distance from the instrument station.

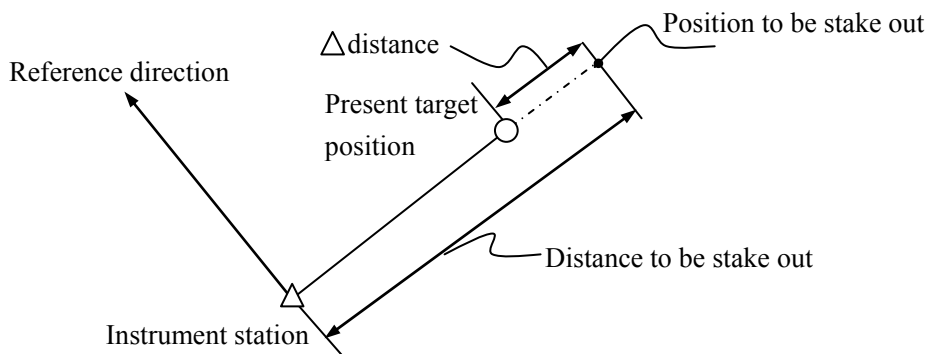

【Procedure of distance stake out measurement】

Menu	P1
1.Coordinate	
2.Stake out	
3.Area	
4.Offset	
5.MLM	
6.REM	
7.Resection	

1. Press F2: **[MENU]** at P2 in the measure mode.

Select “**2. Stake out**”.

S-O
1. Occ. Orientation
2. S-O data
3. EDM
4. JOB select

2. Select “**1. Occ. Orientation**”.

Input the occupied orientation data, see “ § 6.1
Input the occupied point data ”.

Then set the azimuth angle of the backsight point,
see “ § 6.2 Azimuth setting ”.

S-O
1. Occ. Orientation
2. S-O data
3. EDM

3. Select “**2. S-O data**”.

Stake out
1.Height
2.Angle & Dist
3.Coord

4. Select “**2. Angle & Dist**”.

Press F2: **[SHV]** to shift between S-O SD, S-O HD,
S-O VD.

Input the following items:

SD/HD/VD: distance from the instrument station
to the position to be stake out;

Ang.: included angle between the direction of the
reference and the point to be stake out. See “ § 4.2
Set the Horizontal Angle to a Required value ”.

Press F4: **[OK]** to set the input values.

S-O	SD
SD	5.000m
Ang.	20.0000gon
Tgt.H	0.000m
[SHV]	[OK]

S-O dSD ↓	0.000m
S-O dHA ←	0.0000gon
SD	
VD	149.3610gon
HA	334.9916gon
[MEAS]	[NEXT]
	[OK]

6. Horizontally rotate the instrument until “dHA” is
near 0 and set the target on the sight line.

Press F1: **[MEAS]** to start distance measurement.

S-O
1. Occ. Orientation
2. S-O data
3. EDM

7. The difference of measured and stake out value "**S-O dSD**" is displayed.

Move the prism forward and backward until "**S-O dSD**" is 0m.

←: Move the prism left

→: Move the prism right

↓: Move the prism forward


↑: Move the prism backward

Press F4: **[OK]** back to stake out mode.

7.2 Coordinates Stake out Measurement

After setting coordinates for the point to be stake out, the instrument calculates the stake out HA and HD. By selecting the HA and then the HD stake out functions, the required coordinate location can be stake out.

To get the Z coordinate, attach the target to a pole etc, with the same target height.

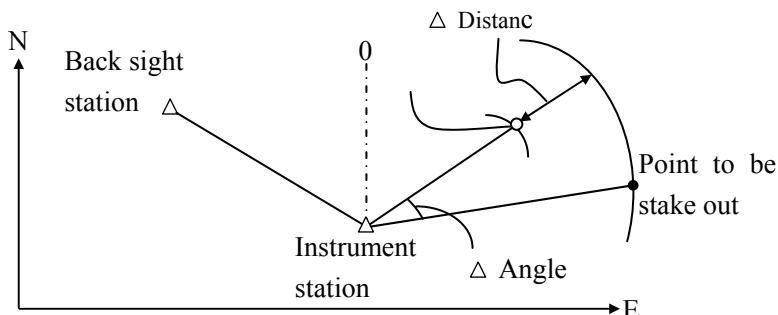

【Procedure of coordinate stake out measurement】

Menu
1.Coordinate
2.Stake out
3.Area
4.Offset
5.MLM
6.REM
7.Resection

P1

1. Press F1: **[MENU]** at P2 in the measure mode.
 Select "**2. Stake out**".

2. Select "**1. Occ. Orientation**".

Input the occupied orientation data, see " § 6.1
 Input the occupied point data".

Then set the azimuth angle of the backsight point,
 see " § 6.2 Azimuth setting".

3. Select "**2. S-O data**", then select "**3.Coord**".

Stake out
1.Height
2.Angle & Dist
3.Coord

S-O Coord	
Np:	157.000
Ep:	0.178
Zp:	0.000
Pt#	
Tgt.H	1.500m
READ	REC OK

4. Input the coordinates of the stake out point.

Press F1: **[READ]** to read the existed coordinates as stake out coordinate.

Press F4: **[OK]** to set the data.

↓	-147.328m
↓	0.000m
↓	19.310m
S-O dHD ↑	-147.328
S-O dHA→	146.7194gon
VA	296.1184gon
HA	249.0324gon
MEAS	NEXT OK

5. Press F1: **[MEAS]** begin coordinate stake out measurement. Move the prism to find the point to be stake out.

▲ : Move the prism upward

▼ : Move the prism downward

Press key {ESC} back to stake out mode.

7.3 REM Stake out Measurement

Perform this operation to find a point where a target cannot be directly installed, see “ § 11 REM”.

【Procedure of REM stake out measurement】

S-O
1. Occ. Orientation
2. S-O data
3. EDM

1. Set a target directly below or directly above the point to be found, then use a measuring tape etc. to measure the target height (height from the surveying point to the target).

Press F1: **[MENU]** at P2 in the measure mode, then select “**2. Stake out**”.

2. Select “**1. Occ. Orientation**”.

Input the occupied orientation data, see “ § 6.1 Input the occupied point data ”.

3. Select “**2. S-O data**”, then select “**1. Height**”.

Stake out
1.Height
2.Angle & Dist
3.Coord

S-O Ht	
Ht.	2.000m
Tgt.H	0.000m
OK	

4. Input height from the surveying point to the position to be stake out. Then press F4: **[OK]** to set the data.

S-O Ht	▼	9.562	
SD	10.251m		🔋
VA	79.6986gon		📏
HA	249.0404gon		I
MEAS REM			

5. Press F1: **[REM]** to begin REM stake out measurement. Move telescope to find the point to be stake out.

: Move the telescope near the zenith

: Move the telescope near the nadir

Press key {ESC} back to stake out mode.

8. Area


Calculate an area shaped with several points. The coordinate data of the points could be either measured or input by hand.

Input:

Coordinates: P1 (N1, E1)
P2 (N2, E2)
P3 (N3, E3)
...

Output:

Area: S

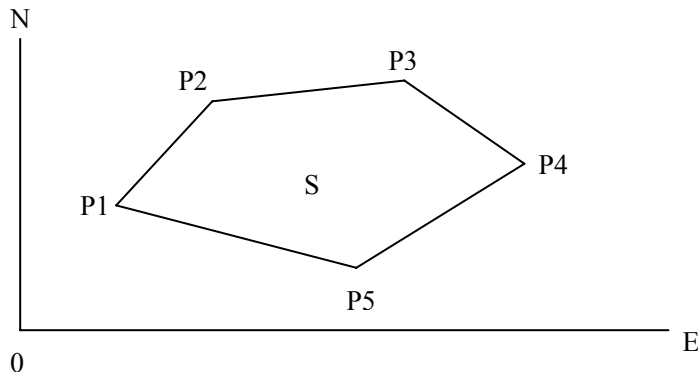

NOTE:

- ◆ The number of points: 3 ~ 30.
- ◆ Make sure these points must be measured or listed clockwise or anticlockwise, or mistake will result.

8.1 Area Calculation by Measured Data

【Procedure of area calculation】

Area

1.Occ.Orientation

2.Area

1. Select F2: [MENU]/ 3. Area /2.Area.

01:

02:

03:

04:

05:

06:

07:

READ **MEAS**

2. Aim at the first point, and then press F4: [MEAS].

N	10.000	
E	5.000	
Z	53.493	
VA	152.6296gon	
HA	62.1314gon	

OK **MEAS**

3. Press F4: **[MEAS]** to re-measure distance or press F1: **[OK]**, the measured data is set as "Pt-01".

01:Pt_01
02:Pt_02
03:Pt_03
04:Pt_04
05:
06:
07:

CALC **MEAS**

4. Repeat steps 2 and 3 till all points are measured one by one. Make sure measure them clockwise or anticlockwise. Press F2: **[CALC]** and the calculated area will display.

Area Calculation
Pt: 4
Area m2
ha

OK

5. Press F4: **[OK]** back to menu mode.

8.2 Area Calculation by Reading Existed Coordinates

【Procedure of area calculation】

Menu P1

1.Coordinate
2.Stakeout
3.Area
4.Offset
5.MLM
6.REM
7.Resection

1. Select F2: **[MENU]**/ 3. Area /2.Area.

01:
02:
03:
04:
05:
06:
07:

READ **MEAS**

2. Press F1: **[READ]** to display existed coordinates data list.

Occ.	O1
Pt#	Pt1
Coord	C1
Pt#	Pt2
Pt#	Pt3
Pt#	Pt4
Pt#	Pt5
↑ ↓ .P TOP LAST SRCH	

01:O1
02:Pt1
03:C1
04:Pt2
05:
06:
07:
READ CALC

Area Calculation	
Pt:	4
Area	m2
	ha
OK	

3. Pt#: Known point data saved in the active JOB or in the coordinate search JOB.

Occ./Coord: Coordinate data saved in the active JOB or in the coordinate search JOB.

4. Select the first point in the list and press key {ENT} to set.

The selected point is set as “Pt-01”.

5. Repeat steps 2 and 4 till all points are selected.

Make sure read the points clockwise or anticlockwise.

6. Press F2: [CALC], and the calculated area will display. Press F4: [OK] to escape.

9. Offset Measurement


Offset measurement are performed in order to find a point where a target cannot be installed directly or to find the distance and angle to a point which cannot be sighted.

It is possible to find the distance and angle to a point you wish to measure (target point) by installing the target at a location (offset point) a little distance from the target point and measuring the distance and angle from the surveying point to the offset point.

The target point could be found in the following three ways.

9.1 Single-distance Offset Measurement

Finding a point by entering the horizontal distance from the target point to the offset point.

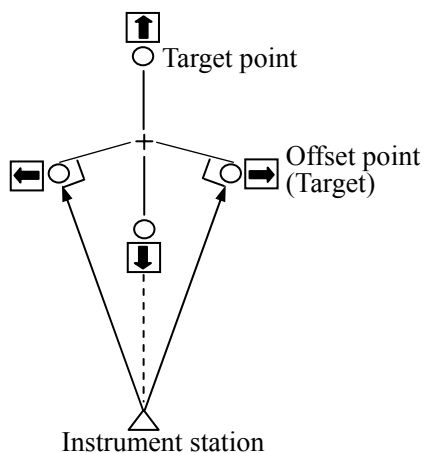

When the offset point is positioned to the left or right of the target point, make sure the angle formed by lines connecting the offset point to the target point and to the instrument station is almost 90° .

When the offset point is positioned in front of or behind the target point, install the offset point on a line linking the instrument station with the target point.

【Procedure of single-distance offset measurement】

Menu	P1
1.Coordinate	
2.Stake out	
3.Area	
4.Offset	
5.MLM	
6.REM	
7.Resection	

1. Set the offset point close to the target point and measure the distance between them, then set up a prism on the offset point.
2. Aim at the offset point and press F1: [MEAS] to measure the distance at P1 in measure mode.

Offset
1.Occ. Orientation
 2.Offset/Dist
 3.Offset/Angle
 4.Offset/2Dist

3. Select [MENU]/4. **Offset**, or press F3: [OFST] at P3 of basic measurement menu.

4. Select “**1. Occ. orientation**” to input the instrument occupied data, see “ § 6.1 Input the occupied point data”.

Offset
 1.Occ. Orientation
2.Offset/Dist
 3.Offset/Angle
 4.Offset/2Dist

5. Select “**2. Offset/Dist**”.

Offset/Dist

SD	10.186m	
VA	90.000gon	
HA	64.5154gon	

MEAS **OK**

6. User could press F1: [MEAS] to re-measure the offset point or press F4: [OK] to the next step.

7. Input distance and direction of offset point:.

① Dist: horizontal distance from the target point to the offset point.

② Direc: direction of the offset point.

←: on the left of the target point

→: on the right of the target point

↓: in front of the target point

↑: at back of the target point

Offset/Dist

Dist	10.000m
Direc	↓

OK

8. Press F4: [OK] to calculate and display the distance and angle of the target point.

Offset/Dist

SD	13.511m
VA	346.9636gon
HA	249.0298gon

REC **NEZ** **NO** **YES**

9. Press F1: [REC] to save;


Press F2: [NEZ] to display NEZ coordinate;

Press F3: [NO] back to step 6;

Press F4: [YES] back to offset mode.

9.2 Angle Offset Measurement

Sighting the direction of the target point to find it from the included angle. Set offset points for the target point on the right or left sides of and as close as possible to the target point and measure the distance to the offset points and the horizontal angle of the target point.

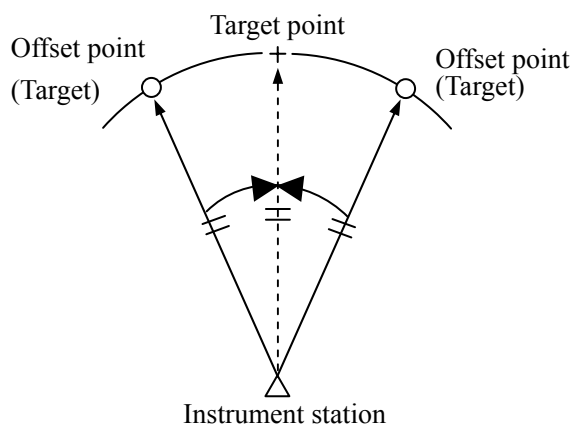

【Procedure of angle offset measurement】

Menu	P1
1.Coordinate	
2.Stake out	
3.Area	
4.Offset	
5.MLM	
6.REM	
7.Resection	

Offset
1.Occ. Orientation
2.Offset/Dist
3.Offset/Angle
4.Offset/2Dist

Offset/Angle	
SD	10.186m
VA	90.0000gon
HA	64.5154gon
Aim at target?	
MEAS	OK

Offset/Ang	
SD	13.511m
VA	346.9636gon
HA	249.0298gon
REC	NEZ
NO	YES

1. Set the offset points close to the target point (making sure the distance from the instrument station to the target point and distance to the offset point are same, the height of the offset points and the target point are the same), then use the offset points as the target.

2. Aim at the offset point and press F1: **[MEAS]** to measure the distance at P1 in measure mode.

3. Select **[MENU]** at P2 in measure mode, and then select “**4. Offset**”, or press F3: **[OFST]** at P3 directly.

4. Select “**3. Offset/Angle**” after inputting instrument occupied data, see “ § 6.1 Input the occupied point data”.

5. Accurately sight the direction of the target point and press F4: **[OK]**, the distance and angle of the target point are displayed.

6. After finishing measurement:

Press F1: **[REC]** to save;


Press F2: **[NEZ]** to display NEZ coordinate;

Press F3: **[NO]** back to step 6;

Press F4: **[YES]** back to offset mode.

9.3 Dual-Distance Offset Measurement

By measuring the distance between the target point and the two offset points. Set two offset points (1st target and 2nd target) on a straight line from the target point, measure the 1st and 2nd target, then input the distance between the 2nd target and the target point to find the target point.

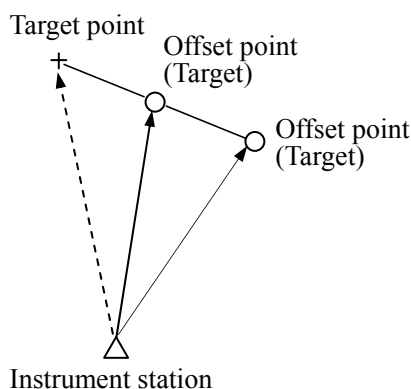

【Procedure of dual-distance offset measurement】

Menu	P1
1.Coordinate	
2.Stake out	
3.Area	
4.Offset	
5.MLM	
6.REM	
7.Resection	

Offset
1.Occ. Orientation
2.Offset/Dist
3.Offset/Angle
4.Offset/2Dist

Observe 1st offset	
N	10.186
E	10.000
Z	10.000
VA	90.0000gon
HA	64.5154gon
MEAS	OK

1. Set two offset points (1st target, 2nd target) on a straight line from the target point and use the offset points as target.
2. Select [MENU] at P2 in measure mode, and then select “4. Offset”, or press F3: [OFST] at P3 directly.
3. Select “4. Offset/2Dist” after inputting the instrument occupied data, see “ § 6.1 Input the occupied point data”.
4. Aim at the 1st target and press F1: [MEAS] and measured data will display. Press F4: [OK] to accept this value.

Observe 2nd offset	
N	10.186
E	10.000
Z	10.000
VA	90.0000gon
HA	64.5154gon
MEAS	OK

5. Sight the 2nd target, press F1: **[MEAS]** and measured data will display, press F4: **[OK]** to accept this value.

Dist	<div style="background-color: black; width: 100px; height: 1.2em; display: inline-block;"></div> m
------	--

6. Input the distance from 2nd point to the target point and press key {ENT}, the angle and distance of the target point are displayed.

Offset/2Dist	
SD	13.511m
VA	346.9636gon
HA	249.0298gon
REC	NEZ
NO	YES


7. Press F1: **[REC]** to save;
 Press F2: **[NEZ]** to display NEZ coordinate;
 Press F3: **[NO]** back to step 6;
 Press F4: **[YES]** back to offset mode.

10. MLM

MLM is used to directly measure slope distance, horizontal distance and the height difference from one base point to other points without moving the instrument.

NOTE:

- ◆ The last measured data could be set as the base point for the next starting operation.
- ◆ The height difference between one point and the base point could be displayed as grade mode.

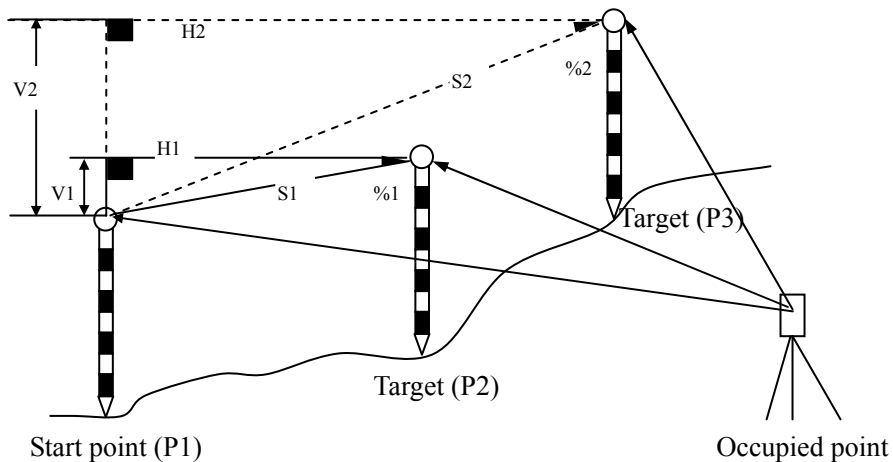

10.1 Measuring Distance between Two or More Points

【Procedure of measuring】

Menu	P1
1.Coordinate	
2.Stakeout	
3.Area	
4.Offset	
5.MLM	
6.REM	
7.Resection	

1. Press F2: [MENU] at P2 in the measure mode.
Select "5. MLM".

MLM	
SD	33.421ft
HD	155.6594gon
VD	355.9246gon
<div> <div>MLM</div> <div>MOVE</div> <div>MEAS</div> </div>	

2. Aim at the start point P1, then press F4: [MEAS] and the measured data will display.
3. Aim at the target point P2 and press F1: [MLM] to begin measure, SD, HD, VD will display.

MLM	
S/%	%
SD	
HD	
VD	
MLM	MOVE
MEAS	

4. Aim at the next point P3 and press F1: [MLM] to begin measure. Repeat this operation to measure other target points.

5. Press F2: [MOVE], the last target measured becomes the new starting position to perform MLM of next target.

Press F4: [MEAS] to re-measure the starting position.


6. Press key {ESC} back to menu mode.

Note:

- ◆ Once “S/%” is displayed, the distance between two points is displayed as the gradient

10.2 Change the Starting Point

The previous measured data could be set as the base point for the next operation.

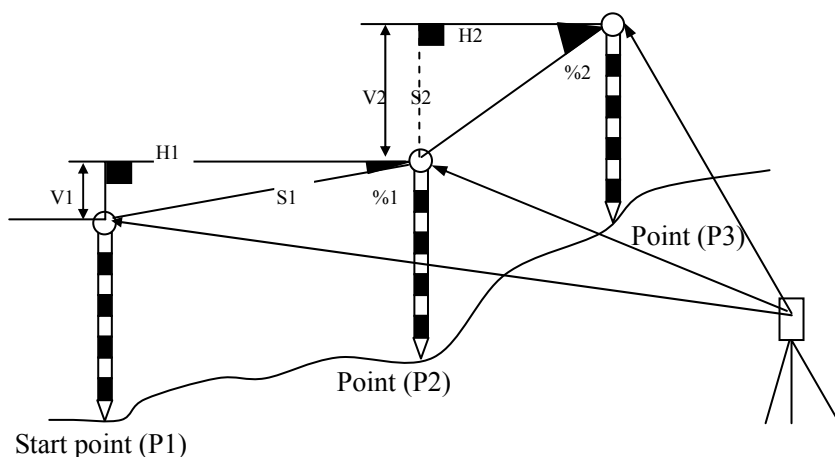

【Procedure of changing the starting point】


MLM	
Move base point?	
SD	-0.001m
VA	368.3854gon
HA	243.4068gon
NO YES	

1. Measure the start point P1 and the first target P2 following above steps 1, 2 and 3.

2. After measuring the two points, press F2: [MOVE], and press F4: [YES] to set the last measured point as new starting point, or press F3: [NO] to give up.

11. REM

REM is a function used to measure the coordinate and height to a point where a target cannot be directly installed such as power lines, overhead cables or bridges, etc.

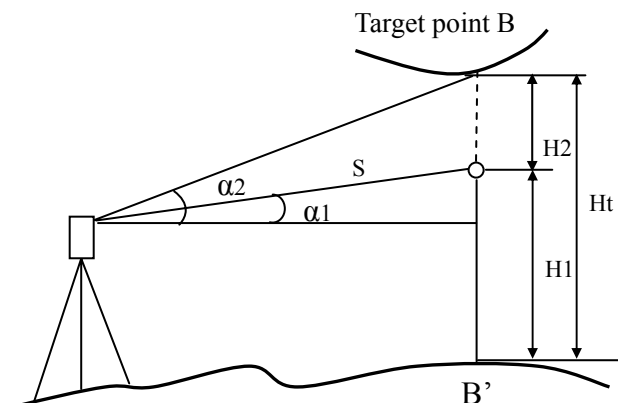

Here is the equation used to calculate the data presented in above figure:

$$Ht = H1 + S \cos \alpha 1 \tan \alpha 2 - S \sin \alpha 1$$

【Procedure of REM】

Menu	P1
1.Coordinate	
2.Stake out	
3.Area	
4.Offset	
5.MLM	
6.REM	
7.Resection	

1. Set a target directly under or directly over the object and measure the target height with a tape measure etc.
2. Press F2: [MENU] on P2 of the basic measurement mode, then select “6.REM” on P1 to enter into REM status.

REM	
Need prism obs	
SD	
HD	
VD	
REM	MEAS

3. Reference point measurement.
Aim at the prism accurately, and press F4: [MEAS] to measure distance. Press F4: [STOP] and the measured data are displayed. Press F4: [MEAS] to re-measure.

REM	
Ht.	1.518ft
SD	33.421ft
HD	0.000ft
VD	15.790ft
REM	MEAS

4. Aim at the target accurately and press F2: [REM]. The height from ground to the target is displayed in “Ht”. Press F4: [MEAS] to repeat and press key {ESC} back to menu mode.

12. Resection

Resection program is used to determine the coordinates of an instrument station (unknown) by measuring several known points. Coordinate data in memory could be read.

Input

Coordinates of known points: X_i, Y_i, Z_i


Measured HA: H_i

Measured VA: V_i

Measured distance: D_i

Output

Coordinate of occupied data: X_o, Y_o, Z_o

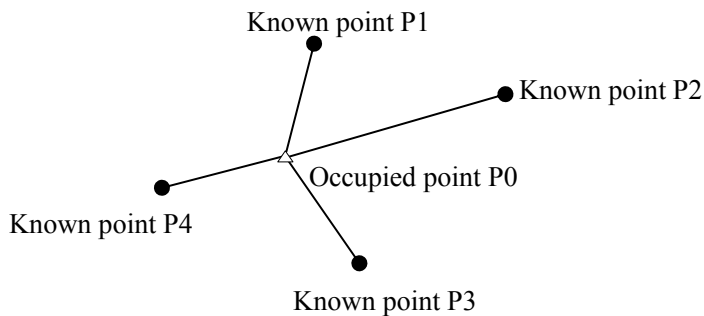

NOTE:

◆ All N, E, Z value or only Z value of the occupied point is calculated by measuring known points.


◆ Coordinate resection measurement overwrite the N, E, Z data of the instrument occupied point, while elevation resection measurement overwrite Z data only. Perform resection measurement, see “§ 12.1 Coordinate Resection” and “§ 12.2 Elevation Resection”.


◆ Inputted known coordinate data and calculated data could be recorded in the current JOB.

12.1 Coordinate Resection

Between 2 and 5 known points can be measured by distance measurement and angle measurement.

【Procedure of coordinate resection】

<div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> Menu 1.Coordinate 2.Stake Out 3.Area 4.Offset 5.MLM 6.REM 7.Resection </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> Resection 1.NEZ 2.Elevation </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> <p style="text-align: center;">No. 1Pt#</p> Np: Ep: Zp: Pt# Tgt.H READ REC NEXT MEAS </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> <p style="text-align: center;">Resection No.1PT</p> N E Z Pt# DIST ANG </div> <div style="border: 1px solid black; padding: 5px;"> <p style="text-align: center;">Resection No.1Pt</p> SD 10.188m VA 189.9284gon  HA 47.2432gon Tgt.H m <div style="text-align: right;">NO YES</div> </div>	<p>1. Select [MENU] at P2 of basic measurement mode, and then select “7. Resection”, or select [RES] at P3 directly.</p> <p>2. Select “1.NEZ” and input known point data. After inputting the data of the first known point, press F3: [NEXT] to input the second point data.</p> <p>3. After all known points data have been set, press F4: [MEAS]. Press F1: [READ] to read existed coordinate data.</p> <p>4. Sight the first known point and press F1: [DIST] to begin measurement. If known points number is more than two, F2: [ANG] will display, you can confirm the known point by angle measurement.</p> <p>5. Press F4: [YES] to use the measured data of the first known point. Press F3: [NO] to re-measure this point. You can also input target height here.</p>
--	---

Resection No.2Pt	
SD	10.188m
VA	189.9284gon 
HA	47.2432gon
Tgt.H	m
CALC	NO YES

Occ. Coord
N
E
Z
dN
dE
NEXT DISP REC OK

Resection
Set Azimuth
NO YES

6. Repeat procedures 4 and 5 of other points.

When the minimum quantity of measured data required for the calculation is present, **[CALC]** will be displayed.

Press F1: **[CALC]** to calculate. Instrument occupied coordinate and standard deviation are displayed.

Press F3: **[NO]** to re-measure the point.

7. Press F1: **[NEXT]** to add other known points.

Press F2: **[DISP]** to view the tolerance of measured known points

Press F3: **[REC]** to record the calculated result.

Press F4: **[OK]** to finish coordinate resection.

The instrument occupied coordinate setting is finished.

8. In this <Set Azimuth> screen, aim the first point then press F4: **[YES]** to set the first known point as backsight point and azimuth, press F3: **[NO]** to back

to measure mode.

12.2 Elevation Resection

Only Z (elevation) of an instrument station is determined by this measurement. Between 1 and 5 known points can be measured by distance measurement only.

【Procedure of elevation resection】

Menu
1.Coordinate
2.Stake Out
3.Area
4.Offset
5.MLM
6.REM
7.Resection

1. Press F2: **[MENU]** on P2 of the basic measurement mode, and then select “**7. Resection**”, or press F4: **[RES]** at P3 directly.

Resection
1.NEZ
2.Elevation

2. Select “**2. Elevation**” and input the known point.

No. 1Pt#

Z
Pt#
Tgt.H
READ REC NEXT MEAS

Resection No.1PT

Z
Pt#
DIST

Resection No.1Pt

SD 10.188m
VA 189.9284gon
HA 47.2432gon
Tgt.H m
CALC NO YES

Occ.Coord

Z
dZ
NEXT REC OK

3. After setting the elevation for the first known point, press F3: **[NEXT]** to set the second point data.

4. After all known points data have been set, press F4: **[MEAS]**.

Press F1: **[READ]** to read existed coordinate data.

5. Sight the first known point and press F1: **[DIST]** to begin measurement. The measured data are displayed.

6. Press F4: **[YES]** to use the measured data of the first known point data.

Press F3: **[NO]** to re-measure the point. You can also input target height here.

After finishing two measurements, **[CALC]** will be displayed.

6. Press F1: **[CALC]** to calculate. Instrument occupied elevation and standard deviation are displayed.


7. Press F1: **[NEXT]** to add other known points.

Press F3: **[REC]** to record the calculated result.

Press F4: **[OK]** to finish elevation resection. Only Z (elevation) of the instrument occupied coordinate is set. N and E values would not be overwritten.

12.3 Resection Calculation Process

The N, E coordinates are found by angle and distance measurement equations, and the instrument occupied coordinates are found using the least squares method. The Z coordinate is found by treating the average value as the instrument occupied coordinate.

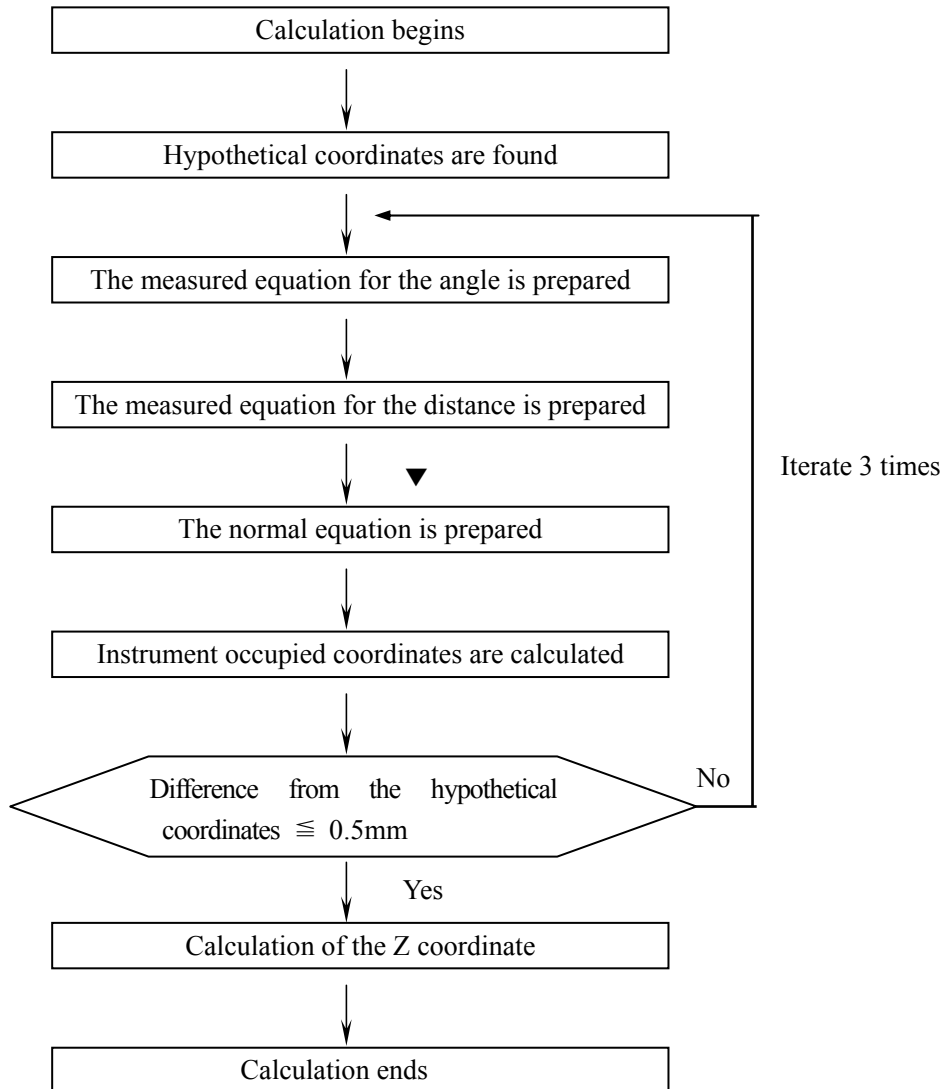


12.4 Precautions When Performing Resection

In some cases it is impossible to calculate the coordinates of occupied point if the unknown point and three or more known points are arranged on the edge of a single circle. It is also impossible to calculate if the included angle between the known points is too small. It is difficult to imagine that the longer the distance between the instrument occupied and known points, the narrower the included angle between the known points. Be careful for the points can easily be aligned on the edge of a single circle.

An arrangement such as shown below is desirable.




It is sometimes impossible to perform a correct calculation such as shown below.

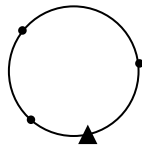


When they are on the edge of a single circle, take one of the following methods:


- (1) Move the instrument station as close as possible to the center of the triangle.

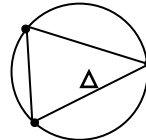

- (2) Measure one more known point which is not on the circle.

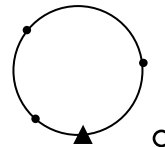


- (3) Perform a distance measurement on at least one of the three points.

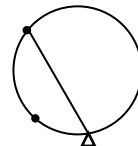

13. Point Projection

Point projection is used for projecting a point to an established baseline. The point to project can be either measured or input. Displays the distances from the first point and point to project to the position at which a line extending from point to project intersects the baseline at right angles.

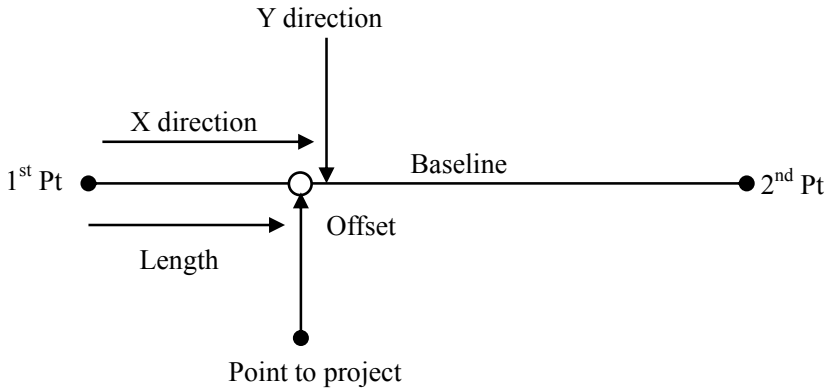

Length: Distance along the baseline from 1st point to 2nd point (X direction).

Offset: Distance from point to project to the position at which a line extending from point of project intersects the baseline at right angles (Y direction).

13.1 Define Baseline

【Procedure of defining baseline】

Menu	P2
1. Point projection	
2. Stake out line	
3. Traverse	
4. Inverse	
5. Polarize	
6. Repeat Measure	
7. Arc staking out	

1. Press F2: [MENU] at P2 of basic measurement mode.

2. Turn to P2, select “1. Point projection”.

Point projection
1.Occ. Orientation
 2.Define baseline
 3.Point projection

3. Input the instrument occupied data, see “§6.1 Input the occupied point data”.

Point projection
1.Occ. Orientation
2.Define baseline
 3.Point projection

4. Select “2. Define baseline”.

Define 1st Pt.

Np:	0.000
Ep:	0.000
Zp:	0.000
Pt#:	

READ REC MEAS OK

5. Input the first point data, or press F1: **[READ]** to use existed coordinates data, or press F3:**[MEAS]** to measure the point.

Define 2nd Pt.

Np:	0.000
Ep:	0.000
Zp:	0.000
Pt#:	

READ REC MEAS OK

6. Press F4: **[OK]** to input the second point data.

Azimuth	300gon
HD	10.412m
Grade	1:150

1: ** % OK

7. Press F4: **[OK]** to finish defining baseline. The grade of the baseline will display.

8. Press F2: **[1:**]** or F3: **[%]** to change the grade display mode.

NOTE:

◆ Defined baseline could be used in both stake out line measurement and point projection.

13.2 Point Projection

The baseline must be defined before performing point projection.

【Procedure of point projection】

Point projection 1.Occ. Orientation 2.Define baseline 3.Point projection	
---	--

1. Select “**3. Point projection**” after finishing defining baseline.

2. Input the point coordinate.

Press F2: **[MEAS]** to measure the point to project.

When recording the data as a known point, press key {Func}, and press F2: **[REC]** on P2. Record method, see “ § 23.1 Input Known Point Coordinate by Keys”.

3. Press F4: **[OK]** to calculate Length, Offset and dVD will display.

Length: Distance along the baseline from 1st point to 2nd point (X direction).

Offset: Distance from point to project to the position at which a line extending from point of project intersects the baseline at right angles (Y direction)

dVD: Elevation between the baseline and the projected point.

Point projection Np: 0.000 Ep: 0.000 Zp: 0.000 Pt#: READ MEAS P1 OK	
---	--

Point projection Length 1385.260m Offset -203.107m dVD 2.212m NEZ REC S-O	
---	--

Press F1: **[NEZ]** to display switching between coordinate and distance data.


Press F2: **[REC]** to record the coordinate as a known data.

Press F4: **[S-O]** to switch to stake out measurement of the projected point. See “6 Stake out measurement”.

Press key {ESC} to continue point projection of a new point.

14. 2 Stake Out Line-Point

This measurement can be used to find the required point coordinates by inputting the length and offset based on baseline.

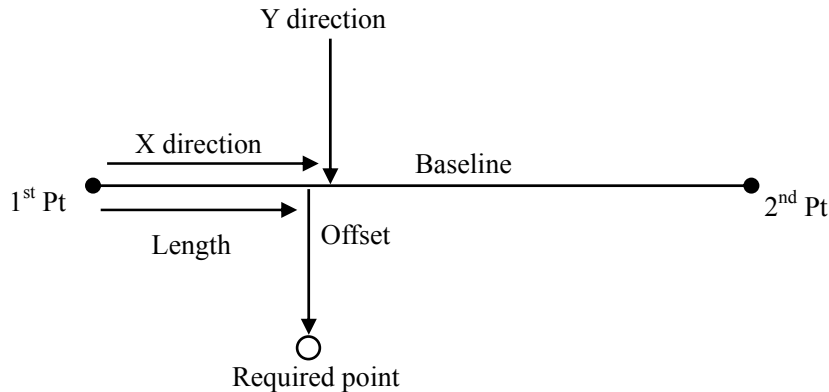

Length: Distance along the baseline from 1st point to the position at which a line extending from the required point intersects the baseline at right angles (X direction)

Offset: Distance from the required point to the position at which a line extending from the required point intersects the baseline at right angles (Y direction).

【Procedure of stake out】

- | | |
|---|---|
| <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> Stake out line
 1.Occ. Orientation
 2.Define baseline
 3.Stake out line </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> Stake out line
 1.Point
 2.Line </div> <div style="border: 1px solid black; padding: 5px;"> Stake out line

 Length
 Offset

 <div style="text-align: right; border: 1px solid black; padding: 2px 5px;">OK</div> </div> | <ol style="list-style-type: none"> 1. Select “3. Stake out line” after defining a baseline. 2. Select “1. Point” 3. Input values of length and offset, then press F4: [OK], the coordinate of the required point is calculated and displayed. |
|---|---|

Stake out line	
Np:	0.000
Ep:	0.000
Zp:	0.000
REC S-O	



4. Press F3: **[REC]** to record the value as a known point, see “ § 20.1 Input Known Point Coordinate by Keys”.

Press F4: **[S-O]** to stake out the required point, see “ § 7. Stake out Measurement”.

Press key {ESC} to continue.

14.3 Stake out Line/Line

Stake out line-line tells how far horizontally the measured point is from the baseline and how far vertically the measured point is from the connected line. Make sure to define a baseline before this operation.

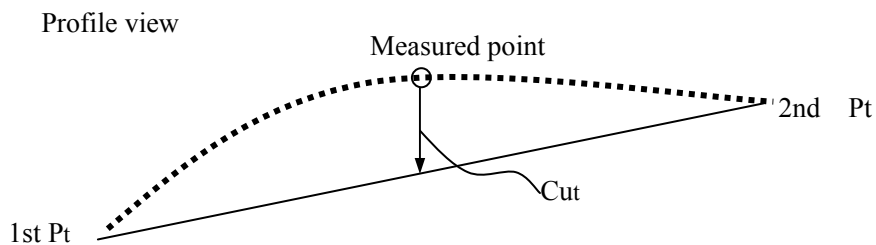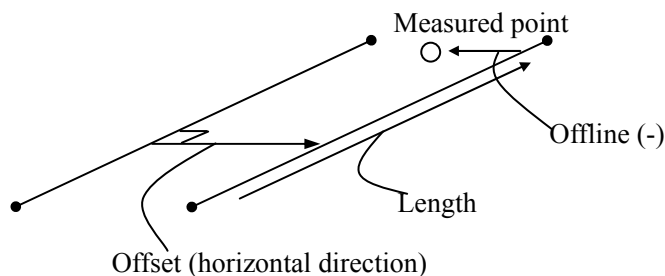

Offline: A positive value indicates the point is on the right of the baseline and a negative value indicates it is on the left.

Cut: indicates that the point is below the baseline.

Fill: indicates that the point is above the baseline.

Length: distance along the baseline from 1st point to the measured point.

【Procedure of stake out line/line】

Stake out line 1. Occ. Orientation 2. Define baseline 3. Stake out line
--

1. Select “**3. Stake out line**” after defining a baseline.

Stake out line 1. Point 2. Line

2. Select “**2. Line**”.

Stake out line Offset
MEAS

3. Input offset value: the horizontal move distance of baseline, right side indicates positive value and left side indicates negative value. Go to step 4 without inputting.

4. Aim at the target and press F4: [**MEAS**] to measure. The measured results are displayed.

Stake out line	
SD	33.417ft
VA	300.9994gon
HA	44.6568gon
Tgt.H	P2
NO YES	

5. Press F3: [**NO**] to re-measure the target.

Press F4: [**YES**] to use the measured values. The difference between the measured data and the baseline displays:

Offline: A positive value indicates the point is on the right of the baseline and a negative value indicates it is on the left.

“Cut” indicates that the point is below the baseline.

“Fill” indicates that the point is above the baseline.


Length: Distance along the baseline from the first point to the measured point.

Stake out line	
Offline	-0.995m
Fill	14.401m
Length	3.993m
REC MEAS	

6. Aim at the next target and press F4: [**MEAS**] to continue the measurement.

15. Traverse Surveying

Measure the coordinate of foresight point and save it in the list, this point would be taken as the occupied point after transferring to point 2, and the previous occupied point will be taken as the backsight point, the azimuth angle will be calculated and set.

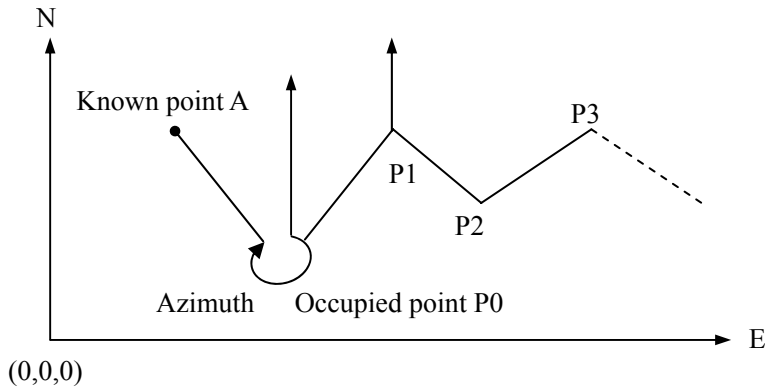

15.1 Save Coordinate

Here is the operation of how to measure the foresight point and save it in the list.

【Procedure of saving coordinate】

Meas	PC	0
	ppm	0
SD	33.417ft	
VA	300.9994gon	I
HA	44.6568gon	P2
MENU HOLD HSET EDM		

1. Press F2: **[MENU]** on P2 of the basic measurement mode.




Menu	P2
1.Point projection	
2.Line stakeout	
3.Traverse	
4.Inverse	
5.Polarize	

2. Turn to P2, select “**3.Traverse**”.

Traverse
1.Save coord
2.Read coord

3. Press “**1.Save coord**”.




Save coord

VD	29.183ft	
VA	315.3212gon	
HA	64.5876gon	

DIST **I . HT**

3. Aim at the target point and then press F1: **[DIST]**. You can press F4: **[I .HT]** to re-input instrument height or target height here.




Save coord

VD	19.682ft	
VA	159.9150gon	
HA	68.0594gon	

MEAS **REC SET**

4. Press F4: **[SET]** to save the data, or press F3: **[REC]** to record it in the list.

Save coord

N	5.000	
E	5.000	
Z	29.877	

> Set? **NO YES**

5. Press F3: **[NO]** back to the previous mode and press F4: **[YES]** to set the data.

15.2 Read Coordinate

Set the measured foresight point in the saved coordinates list as the occupied point, and the previous occupied point becomes the back point.

Traverse
1.Save coord
2.Read coord

1. Move the instrument to the measured foresight point.

2. Select “**2. Read coord**”.

Read coord

HA	-0.0002gon
----	------------

> Set? **NO YES**

3. First aim the previous occupied point, then press F4: **[YES]** to set the previous foresight point coordinate as the occupied point coordinate or press F3: **[NO]** to give up.

16. Inverse

The distance and azimuth from a start point to an end point could be calculated according to input their coordinates.

Input:

Coordinate of start point: N0,E0,Z0

Coordinate of end point : N1,E1,Z1

Output:

Distance: D

Azimuth: Az

【Procedure of Inversing】

1. Press F2: **[MENU]** on P2 of the basic measurement mode.

2. Turn to P2, select “**4.Inverse**”.

3. Input coordinates of the start point, and press F3: **[REC]** to record the data in the list if necessary. You could press F1: **[READ]** to read the existed data. Press F4: **[OK]** to set.

4. Input coordinates of the end point. See the previous step.

5. The inversed value will display. Press F3: **[NEXT]** to continue, press F4: **[OK]** back to menu mode.

Menu	P2
1.Point projection	
2.Line stakeout	
3.Traverse	
4.Inverse	
5.Polarize	
6.Repeat Measure	
7.Arc staking out	

Coord Inverse	
Start point	
N	1000.000
E	1000.000
Z	39.383
Pt#	
READ	REC OK

Coord Inverse	
End point	
N	1000.000
E	1000.000
Z	10.000
Pt#	
READ	REC OK

Coord Inverse	
Azimuth	-0.0002gon
HD	0.000ft
VD	-29.383ft
	NEXT OK

17. Polar Coordinates Calculation

The coordinates of the end point could be calculated according to input azimuth, distance and the NEZ coordinates of start point.

Input:


Coordinate of start point: N_0, E_0, Z_0

Azimuth: Az

Distance: $Dist$

Output:

Coordinate of end point: N_1, E_1, Z_1

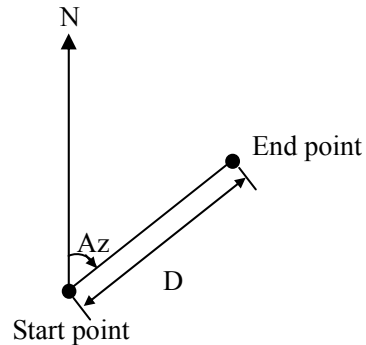

【Procedure of Polarize】

Menu	P2
1.Point projection	
2.Line stake out	
3.Traverse	
4.Inverse	
5.Polarize	
6.Repeat Measure	
7.Arc staking out	

1. Press F2: **[MENU]** on P2 of the basic measurement mode.

2. Turn to P2, select “**5.Polarize**”.

Calc polar coord	
Pt#	C1
N	1000.000
E	1000.000
Z	39.383
Azimuth	1.0000gon
Dist	0.000ft
READ	OK

3. Input the data in corresponding items. You could press F1: **[READ]** to read the existed coordinate data for start point. Press F4: **[OK]** to enter.

Calc polar coord	
N	1000.000
E	1000.000
Z	0.000
OK	REC

4. The calculated data displays. Press F3: **[REC]** to record it in the list, and press F1: **[OK]** back to menu mode.

18. Repetition Angle Measurement

Repetition angle measurement can be done by horizontal angle right measurement mode.

- | | |
|--|---|
| <div style="border: 1px solid black; padding: 5px;"> <div style="display: flex; justify-content: space-between;"> Menu P2 </div> <div> 1.Point projection
 2.Line stake out
 3.Traverse
 4.Inverse
 5.Polarize
 6.Repeat Measure
 7.Arc staking out </div> </div> | 1. Press F2: [MENU] on P2 of the basic measurement mode. |
| <div style="border: 1px solid black; padding: 5px;"> <div>Angle Remeasure</div> <div>>OK?</div> <div style="display: flex; justify-content: space-around; margin-top: 20px;"> ---- ---- YES NO </div> </div> | 2. Turn to P2, select 6.Repeat Measure . |
| <div style="border: 1px solid black; padding: 5px;"> <div>Angle Remeasure [0]</div> <div>Ht: 0° 00' 00"</div> <div>Hm:</div> <div style="display: flex; justify-content: space-around; margin-top: 20px;"> 0SET MEAS FREE HOLD </div> </div> | 3. Press the F3:[Yes] key. |
| <div style="border: 1px solid black; padding: 5px;"> <div>Angle Remeasure [1]</div> <div>Ht: 45° 10' 00"</div> <div>Hm: 45° 10' 00"</div> <div style="display: flex; justify-content: space-around; margin-top: 20px;"> 0SET MEAS FREE HOLD </div> </div> | 4. Collimate the target A and press the F1[0SET] key.
5. Press the F3:[Yes] key. |
| <div style="border: 1px solid black; padding: 5px;"> <div>Angle Remeasure [1]</div> <div>Ht: 45° 10' 00"</div> <div>Hm: 45° 10' 00"</div> <div style="display: flex; justify-content: space-around; margin-top: 20px;"> 0SET MEAS FREE HOLD </div> </div> | 6. Collimate the target B using the horizontal clamp and tangent screw.
Press the F4:[HOLD] key. |
| <div style="border: 1px solid black; padding: 5px;"> <div>Angle Remeasure [1]</div> <div>Ht: 45° 10' 00"</div> <div>Hm: 45° 10' 00"</div> <div style="display: flex; justify-content: space-around; margin-top: 20px;"> 0SET MEAS FREE HOLD </div> </div> | 7.Recollimate the target A using the horizontal clamp and tangent screw, and press the F3:[FREE] key. |
| <div style="border: 1px solid black; padding: 5px;"> <div>Angle Remeasure [2]</div> <div>Ht: 90° 20' 00"</div> <div>Hm: 45° 10' 00"</div> <div style="display: flex; justify-content: space-around; margin-top: 20px;"> 0SET MEAS FREE HOLD </div> </div> | 8. Recollimate the target B using the horizontal clamp and tangent screw, press the F4:[HOLD] key.

9. Repeat 7 to 8 to measure the desired number of repetition. |

Angle Remeasure [4]

Ht: 180° 40' 00"
Hm: 45° 10' 00"

0SET MEAS FREE HOLD

10. Press F2: [Meas] or [ESC] key to return to the normal mode.

Angle Remeasure

Exit
>OK?

---- ---- YES NO

11. Press the F3:[YES] key.

NOTE:

- Horizontal angle can be accumulated up to (3600°00'00" – minimum reading) (horizontal angle right).
In case of 5 second reading, horizontal angle can be accumulated up to +3599°59'55".
- Error will be displayed when the results differ from first measurement by more than $\pm 30''$.

19. Arc Staking Out Measurement

Stake out a designed arc by arc staking out measurement, see below figure, after define the arc by 2points-arc or 3points, the instrument will help you move the rod to the arc.

Here:

S.P– Start point of arc

E.P– End point of arc

C.P– Circle center point of arc


Station(from S.P to A) - the station on the arc computed radially from the current position of the prism.

Offset(from rod to B) – offset distance from the current position to the arc.

S-O dHA – If your line of sight does not intersect the arc, it will display to ask you rotate you telescope until sight line intersect the arc, and then **In/Out** will display. Offset angle is from the current position to the arc

Fill/Cut – Cut value indicate that the rod is higher than the arc, fill indicates the it is lower

In/Out(from Rod to A)– This is the distance you need to move in out to get to the arc.

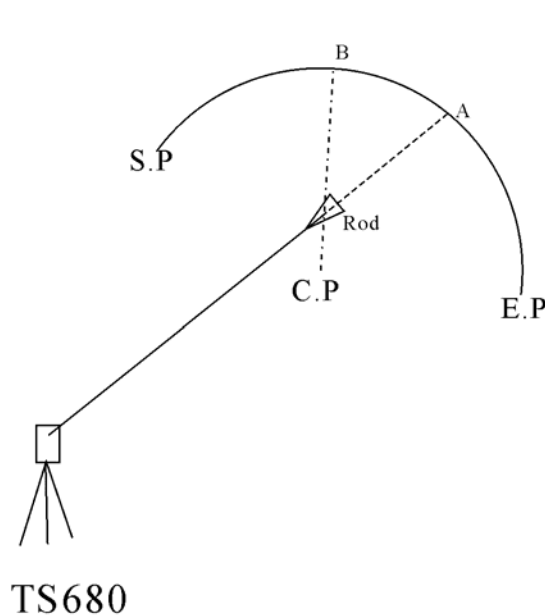

19.1 Two Point Arc Staking Out

Arc Stakeout
1.Occ.Orientation
2.2pt+radius arc
3.Three Point arc

1. Press F2: **[MENU]** on P2 of the basic measurement mode, select **7.Arc Staking out** to enter arc staking out menu, select 1.Occ.Orientation to set the station. And then select 2. 2pt+radius arc to start 2-point arc staking out measurement.

Define/Start PT

Pt# J2
 Np: 11.829
 Ep: 0.000
 Zp: 1.846

READ REC MEAS OK

2. Input the coordinate of arc start point.
 Press F1[READ] to read the existed coordinate as stake out coordinate
 Press F4:[OK] to set the data.

3. Input the coordinate of arc end point.
 Press F1[READ] to read the existed coordinate as stake out coordinate
 Press F4:[OK] to set the data.

Define/End PT

Pt# J3
 Np: 11.282
 Ep: -2.130
 Zp: 1.503

READ REC MEAS OK

4. Input the radius of arc, press F4:[OK] to set the data.

Arc define/Rad Input

Rad 100.000

OK

5. Press F1:[MEAS] to measure current rod, the staking date will display.

Are stake out/Measure

Stn : 2.930m
 Offset: 8.304m
 S-O dHA 12 27 49
 Fill: 1.545

MEAS OK

Station - the station on the arc computed radially from the current position of the prism.

Offset – offset distance from the current position to the arc.

S-O dHA – offset angle from the current position to the arc

Fill/Cut – Cut value indicate that the rod is higher than the arc, fill indicates the it is lower

In/Out– This is the distance you need to move in out to get to the arc.

Are stake out/Measure	
Stn :	1.112m
Offset:	0.013m
In:	0.013m
Fill:	0.306m
MEAS	OK

6. According the S-O dHA angle to move the rod until the telescope sight intersect the arc.

7. Repeat moving and measuring the rod until all the stake data are accepted. Press F4: [ESC] to escape this program.

Are stake out/Measure	
Stn :	1.109m
Offset:	0.003m
In:	0.003m
Fill:	0.006m
MEAS	OK

19.2 Three Point Arc Staking Out

Arc Stakeout	
1.Occ.Orientation	
2.2pt+radius arc	
3.Three Point arc	

1. Press F2: [MENU] on P2 of the basic measurement mode, select **7.Arc Staking out** to enter arc staking out menu, select 1.Occ.Orientation to set the station. And then select 3.Three point arc to start three-point arc staking out measurement.

Define/Start PT	
Pt#	J1
Np:	0.000
Ep:	0.000
Zp:	0.000
READ	REC
MEAS	OK

2. Input the coordinate of arc start point.
Press F1[READ] to read the existed coordinate as stake out coordinate
Press F4:[OK] to set the data.

Define/End PT	
Pt#	J2
Np:	11.282
Ep:	-2.130
Zp:	1.503
READ	REC
MEAS	OK

3. Input the coordinate of arc end point.
Press F1[READ] to read the existed coordinate as stake out coordinate
Press F4:[OK] to set the data.

Define/Mid PT	
Pt#	J5
Np:	3.027
Ep:	-0.685
Zp:	0.305
<div> <div>READ</div> <div>REC</div> <div>MEAS</div> <div>OK</div> </div>	

4. Input the coordinate of arc middle point.
 Press F1[READ] to read the existed coordinate as stake out coordinate
 Press F4:[OK] to set the data.

Are stake out/Measure	
Stn :	0.015m
Offset:	115.491m
S-O dHA	5 16 17
Fill:	1.541
<div> <div>MEAS</div> <div>OK</div> </div>	

5. Press F1:[MEAS] to measure current rod, the staking date will display.

Station - the station on the arc computed radially from the current position of the prism.

Offset – offset distance from the current position to the arc.

S-O dHA – offset angle from the current position to the arc

Fill/Cut – Cut value indicate that the rod is higher than the arc, fill indicates the it is lower

In/Out(from Rod to A)– This is the distance you need to move in out to get to the arc.

Are stake out/Measure	
Stn :	0.015m
Offset:	10.025m
In:	0.013m
Fill:	0.306m
<div> <div>MEAS</div> <div>OK</div> </div>	

Are stake out/Measure	
Stn :	0.012m
Offset:	0.003m
In:	0.003m
Fill:	0.006m
<div> <div>MEAS</div> <div>OK</div> </div>	


6. According the S-O dHA angle to move the rod until the telescope sight intersect the arc.

7. Repeat moving and measuring the rod until all the stake data are accepted. Press F4: [ESC] to escape this

program.

20. Road Staking Out Measurement

This program is especially designed for Road Layout measurement. It can be used for horizontal curve layout. Normally one road is constituted by several elements, such as line, circle curve or Spline.

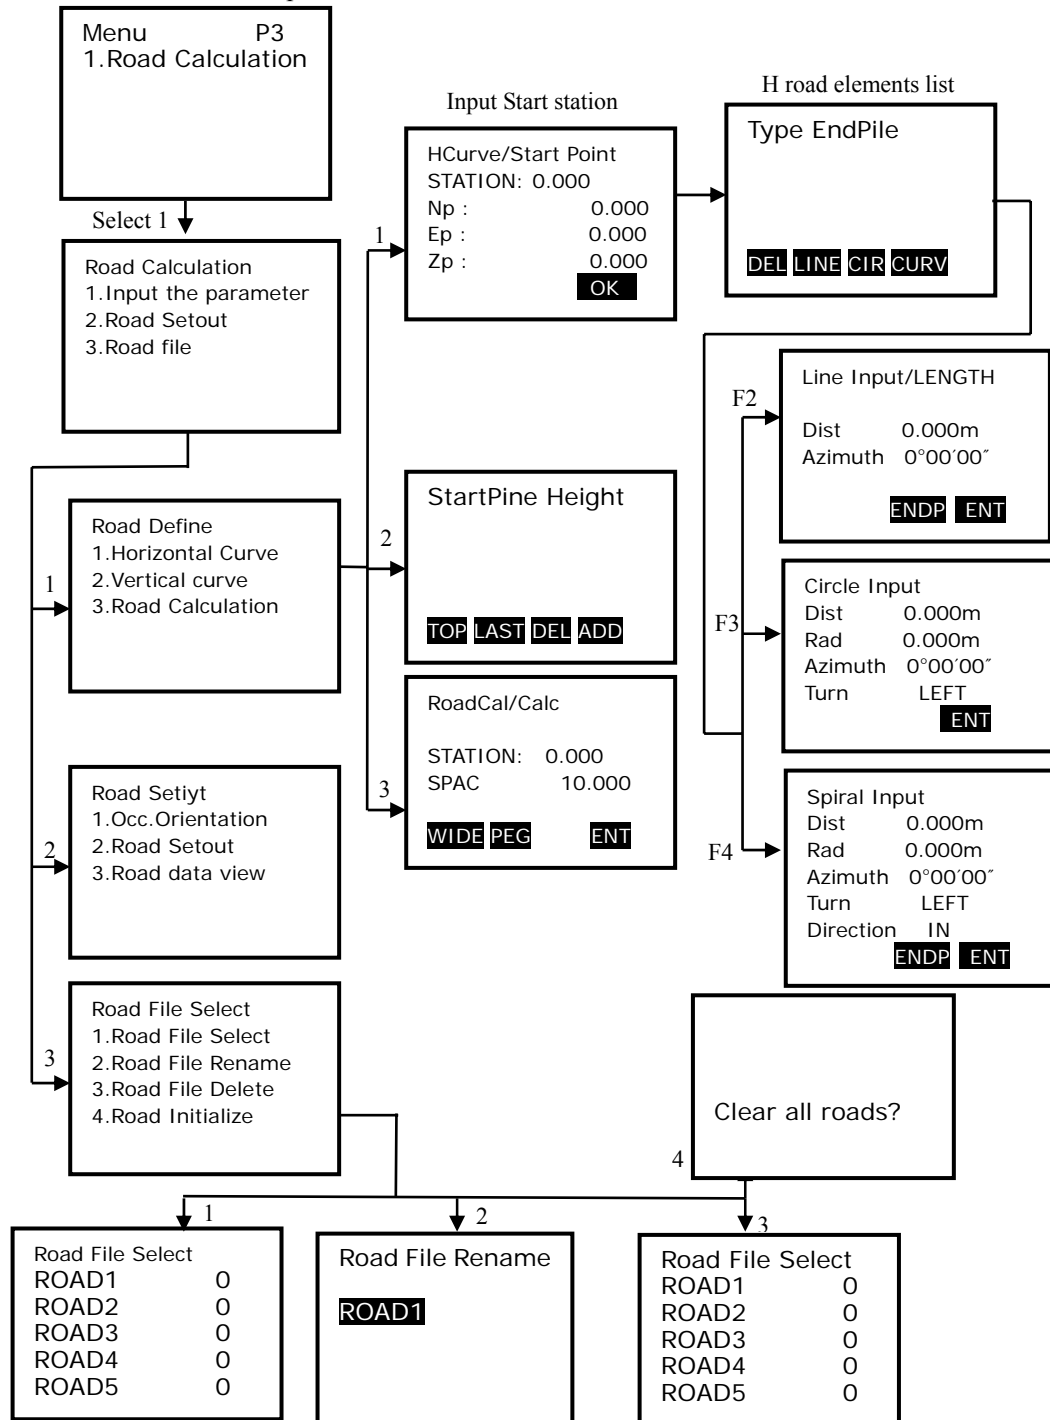

20.1 Input the Start Station

Road Calculation
1.Input the parameter
2.Road Setout
3.Road file

Road Define
1.Horizontal Curve
2.Vertical curve
3.Road Calculation

HCurve/Start Point
STATION: 0.000
Np : 0.000
Ep : 0.000
Zp : 0.000
OK

Type EndPile
DEL LINE CIR CURV

1. Press F2: **[MENU]** on P2 of the basic measurement mode, on the page 3 select **1.Road Calculation** enter road menu.

2. Select **1.Input the parameter** to enter road design menu. And then select **1.Horizontal Curve**, start point entering menu will display.

3. Enter the start point station and coordinate, press F4:[OK] key. Road horizontal elements editing menu will display.

20.2 Input Road Horizontal Elements

Three types elements can be input, including line, curve and spiral.

20.2.1 Input Line Element

Line Input/LENGTH
Dist 100m
Azimuth 0°00'00"
ENDP ENT

1. Make sure the instrument is in horizontal elements editing menu, press F2 to display line element inputting menu.

Input the line length and azimuth in the **Dist** and **Azimuth** filed.

Press F4:[ENT] key to confirm.

NOTE:

Line Input/END POINT	
Pt#	
N	100m
E	0.000m
Z	0.000m
<div> <div>READ</div> <div>LINE</div> <div>ENT</div> </div>	

Type EndPile	
Line 100.000	
<div> <div>DEL</div> <div>LINE</div> <div>CIR</div> <div>CURV</div> </div>	

You can press F3:[ENDP] to enter the end point inputting menu.

Input the end point coordinate directly, or press F1:[READ] to recall from memory.

Press F3:[LINE] to back to the LENGTH menu

Press F4:[ENT] to confirm, you will see the line element in the list menu.

Here EndPile means the end station of this element.

20.2.2 Input Circle Element

CIRCLE INPUT	
Dist	100.000m
Rad	100.000m
Azimuth	0°00'00"
Turn	RIGHT
<div>ENT</div>	

Type EndPile	
Line 100.000	
Circle 200.000	
<div> <div>DEL</div> <div>LINE</div> <div>CIR</div> <div>CURV</div> </div>	

1. Make sure the instrument is in horizontal elements editing menu, press F3 to display curve element inputting menu.

Input the curve parameters, including length[Dist], radius[Rad], azimuth[Azimuth] and turn [Turn].

2. Press F4:[ENT] key to confirm, back to the horizontal elements menu.

Here EndPile means the end station of this element.

NOTE:

1. Normally the azimuth will calculate and display following previous element.

2. When you set the turn, move the cursor to [Turn] item, press ◀ or ▶ key to shift between Left and Right.

20.2.3 Input Spiral Element

Spiral Input	
Dist	100.000m
Rad	100.000m
Azimuth	57°17'44"
Turn	RIGHT
Direction	IN
ENT	

Type	EndPile
Line	100.000
Circle	200.000
Spiral	300.000

DEL	LINE	CIR	CURV
------------	-------------	------------	-------------

1. Make sure the instrument is in horizontal elements editing menu, press F4 to display spiral element inputting menu.

Input the curve parameters, including length[Dist], radius[Rad], azimuth[Azimuth], turn [Turn] and direction[Direction].

2. Press F4:[ENT] key to confirm, back to the horizontal elements menu.

Here EndPile means the end station of this element.

NOTE:

1. Normally the azimuth will calculate and display following previous element.
2. When you set the turn or direction, move the cursor to [Turn] or [Direction] item, press ◀ or ▶ key to shift the options.
3. If you set the Direction is IN, here the inputted Rad is End radius of spiral, its start radius is default as ∞ ; if you set the direction is OUT, here the inputted is start radius of spiral, its end radius is default as ∞ .

20.2.4 Road Horizontal Element Editing

In the horizontal element editing menu, the inputted element can be edited.

Type	EndPile
Line	100.000
Circle	200.000
Spiral	300.000
Circle	400.000
Spiral	500.000
Line	600.000
DEL	LINE CIR CURV

Type	EndPile
Line	100.000
Circle	200.000
Spiral	300.000
Circle	400.000
Spiral	500.000
Line	600.000
DEL	LINE CIR CURV

● Delete horizontal element

1. Move ▲ or ▼ key, the cursor will move to different element.

2. Press F1:[DEL] to delete the selected element, the two elements adjacent with deleted one will connect automatically.

Type	EndPile
Line	100.000
Spiral	200.000
Circle	300.000
Spiral	400.000
Line	500.000
DEL LINE CIR CURV	

● Edit horizontal element

Type	EndPile
Line	100.000
Spiral	200.000
Circle	300.000
Spiral	400.000
Line	500.000
DEL LINE CIR CURV	

Line Input/CIRCLE	
Dist	200.000m
Rad	100.000m
Azimuth	0°00'00"
Turn	RIGHT
Direction	IN
ENT	

Type	EndPile
Line	100.000
Spiral	300.000
Circle	400.000
Spiral	500.000
Line	600.000
DEL LINE CIR CURV	

Road Define	
1.Horizontal Curve	
2.Vertical curve	
3.Road Calculation	

1. Move ▲ or ▼ key, the cursor will move to different element.


2. Press ENT key to edit the selected element.

3. Press F4:[ENT] key to confirm, other elements following the edited one will upgrade automatically.

4. After all the horizontal elements are confirmed, press [ESC] key back to previous menu.

20.3 Input Road Vertical Elements

Road vertical elements is confirmed by some intersection points, you should input same parameters for the intersection points, including station, height, and length from this intersection point to next intersection point.

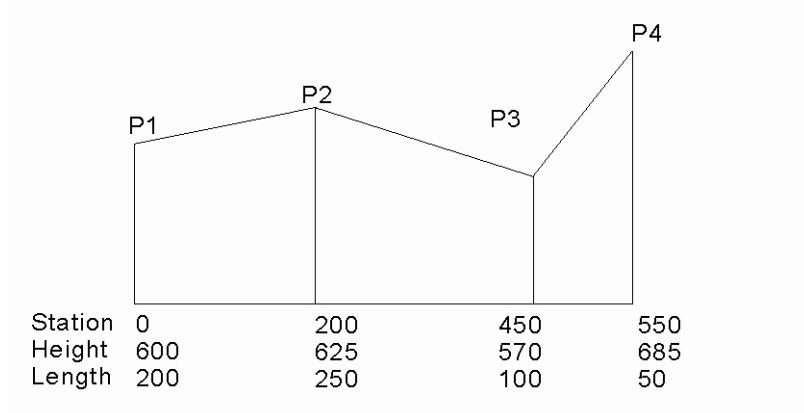

20.3.1 Input Vertical Road Element.

Road Define
 1.Horizontal Curve
2.Vertical curve
 3.Road Calculation

StartPile	Height

FIST
LAST
DEL
ADD

VCurve/Element

STATION	0.000
Ht.	600.000
Lengh	200

ENT

1. Make sure the instrument is in Road Define menu, select **2.Vertical Curve** to vertical elements editing menu.

Here:

Press F1:[FIST] key, the cursor will move to the first element.

Press F2:[LAST] key, the cursor will move to the last element.

Press F3:[Del] key to delete the selected element.

Press F4:[ADD] key to add a new vertical element.

2. Press F4 to display Vertical road element inputting menu. Input the parameter for vertical element.

Press F4:[ENT] key to confirm.

StartPile	Height
0.000	600.000

FIST	LAST	DEL	ADD
-------------	-------------	------------	------------

VCurve/Element	
STATION	200.000
Ht.	625.000
Lengh	250

ENT

StartPile	Height
0.000	600.000
200.000	625.000
400.000	570.000
500.000	685.000
550.000	700.000

FIST	LAST	DEL	ADD
-------------	-------------	------------	------------

3. You will see the just inputted element in the vertical element editing menu.

4. Press F4:[ADD] to input next one.

Here the STATION is displayed automatically, it comes from the previous element's length.

Press F4: key to confirm.

5. Repeat step 4 to input all the vertical elements for the road.

20.3.2 Edit Vertical Road Element

In the horizontal element editing menu, the inputted element can be edited.

StartPile	Height
0.000	600.000
200.000	625.000
400.000	570.000
500.000	685.000

FIST	LAST	DEL	ADD
-------------	-------------	------------	------------

● Delete vertical element


1. Move F1:[FIST], F2:[LAST], ▲ or ▼ key, the cursor will move to different element.

StartPile	Height
0.000	600.000
200.000	570.000
300.000	685.000

FIST	LAST	DEL	ADD
-------------	-------------	------------	------------

2. Press F3:[DEL] to delete the selected element, the two elements adjacent with deleted one will connect automatically.

For the example, after delete the second element, the vertical road curve figure is shown below:

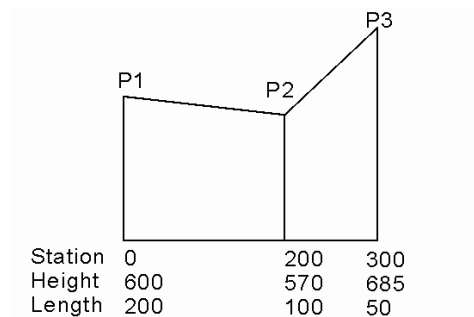

● Edit horizontal element

StartPile	Height
0.000	600.000
200.000	625.000
400.000	570.000
500.000	685.000

FIST LAST DEL ADD

1. Move ▲ or ▼ key, the cursor will move to different element.

VCurve/Element	
STATION	200.000
Ht.	625.000
Lengh	180 m

ENT

2. Press ENT key to edit the selected element.


StartPile	Height
0.000	600.000
200.000	625.000
380.000	570.000
480.000	685.000

FIST LAST DEL ADD

3. Press F4:[ENT] key to confirm, other elements following the edited one will upgrade automatically.

4. After all the horizontal elements are confirmed, press [ESC] key back to previous menu.

For the example, after edit the second element, the vertical road curve figure is shown below:

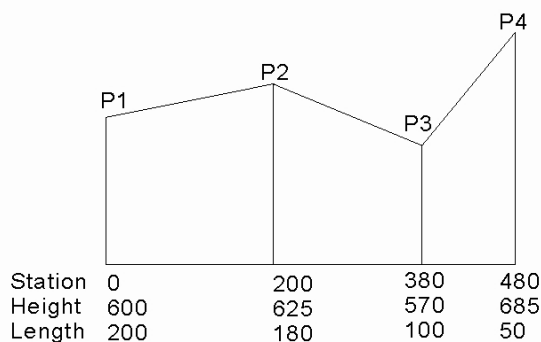

20.4 Road Calculation

20.4.1 Input the road width element

Road Define 1.Horizontal Curve 2.Vertical curve 3.Road Calculation

1. Make sure the instrument is in Road Define menu, select **3.Road Calculation**

2. Press F1:[WIDE] to road width setting menu.

RoadCal/Calc STATION:0.000 SPAC 0.000 m WIDE PEG ENT

Press F1:[FIST] key, the cursor will move to the first element.

Press F2:[LAST] key, the cursor will move to the last element.

Press F3:[Del] key to delete the selected element.

Press F4:[ADD] key to add a new vertical element.

3. Press F4:[ADD] to enter road wide inputting menu.

SPile LW FIST LAST DEL ADD
--

4. Input the parameters of road width.

STATION: the road will take this width begin from this point to next road width element

Lwide: left width

Rwide: right width

Press F4:[ENT] key to confirm.

Wide Input STATION: 0.000m Lwide 3.000m Rwide 4.000m ENT
--

5.Repeat step 4 to input other road width.

SPile LW 0.000 3.000 100.000 5.000 300.000 6.000 FIST LAST DEL ADD

6. Press [ESC] back to road calculation menu.

RoadCal/Calc STATION:0.000 SPAC 0.000 m WIDE PEG ENT

20.4.2 Additional Station Setting

Some special stations can be calculated and stake out, the setting procedures are same with road width element inputting, but their result are different; for road width element, the inputted parameters are available from setting station to next element, but for additional station setting, the inputted parameters are available only for setting station.

Road Define
1.Horizontal Curve
2.Vertical curve
3.Road Calculation

1. Make sure the instrument is in Road Define menu, select **3.Road Calculation**

RoadCal/Calc
STATION:0.000
SPAC 0.000 m
WIDE PEG ENT

2. Press F2:[PEG] to enter additional station setting menu.

SPile	LW
FIST	LAST
DEL	ADD

Press F1:[FIST] key, the cursor will move to the first element.

Press F2:[LAST] key, the cursor will move to the last element.

Press F3:[Del] key to delete the selected element.

Press F4:[ADD] key to add a new vertical element.

3. Press F4:[ADD] to enter road wide inputting menu.

Wide Input
STATION: 155.500
Lwide 10.000m
Rwide 10.000m
ENT

4. Input the parameters of road width.

STATION: the road will take this width begin from this point to next road width element

Lwide: left width

Rwide: right width

Press F4:[ENT] key to confirm.

SPile	LW
155.500	10.000
FIST	LAST
DEL	ADD

5.Repeat step 4 to input other road width.

6. Press [ESC] back to road calculation menu.

20.4.3 Road Calculation

After design the road, input the interval to calculate the staking points.

RoadCal/Calc
STATION:0.000
SPAC 20.000 m

WIDE PEG ENT

1. Input the interval of staking points on the road.

Road Define
1.Horizontal Curve
2.Vertical curve
3.Road Calculation

2. Press F4:[ENT] to calculate, “calculating” will display until “Cal complete” appear, the program go back to previous menu automatically.

NOTE: If following display, it means there are some staked points exist in this file already.
Press F3:[YES] key to cover these points, or press F4:[NO] back to previous screen.

OVERLAP

YES NO

20.5 Road Staking Out Data View

After design and calculate the road, all the staking points can be view.

```

Road Calculation
1.Input the parameter
2.Road Setout
3.Road file
  
```

1. Press F2: [MENU] on P2 of the basic measurement mode, on the page 3 select **1.Road Calculation** enter road menu.

```

Road Setout
1.Occ.Orientation
2.Road Setout
3.Road data view
  
```

2. Select **2.Road Setout** to road setout menu.

```

STAKE    1
STAKE    2
STAKE    3
STAKE    4
STAKE    5
STAKE    6
STAKE    7
↑ ↓ .P TOP LAST SRCH
  
```

3. Select **3.Road data view** to view the staking station data, the station list will display.

Here:

STAKE: Center station serial number

RSTAKE: Right station serial number

LSTAKE: Left station serial number

Press F1:[↑ ↓ .P] key to change the function of ▲ and ▼ keys, if it is light, press ▲ or ▼ to move cursor between adjacent points. If it is backlight display, press ▲ or ▼ key to move cursor to display adjacent pages.

Press F2:[TOP] key to move cursor to first station.

Press F3:[LAST] key to move cursor to last station

Press F4:[SRCH] key to enter the serial number(PT#) to look for the station.

```

Road RoadCoordSO
Pt#      1
Code    0.000C
Np :    0.000
Ep :    0.000
Zp :    600.000
READ PREV NEXT ENT
  
```

```

Np :    0.000
Ep :    0.000
Zp :    600.000
Pt#      1
Code    0.000C
NEXT PREV
  
```

4. Press F4:[ENT] to display the coordinate of selected station.

PT#: Station serial number

Code: Station mileage, “C” means center station, “R” means right station, “L” means left station.

Press F1:[NEXT] key to display next station.

Press F2:[PREV] key to display previous station.

20.6 Road Stake Out

Road Calculation
1.Input the parameter
2.Road Setout
3.Road file

Road Setout
1.Occ.Orientation
2.Road Setout
3.Road data view

Road RoadCoordSO
Pt# 1
Code 0.000C
Np : 0.000
Ep : 0.000
Zp : 600.000
READ PREV NEXT ENT

Road RoadCoordSO
Pt# 1
Code 0.000C
Np : 0.000
Ep : 0.000
Zp : 600.000
READ PREV NEXT ENT

1. Press F2: **[MENU]** on P2 of the basic measurement mode, on the page 3 select **1.Road Calculation** enter road menu.

2. Select **2.Road Setout** to road setout menu.

At road setout menu select **2.Road file** to road setout menu, select **1.Occ.Orientation** to set the station and backsight.

3. Select **2.RoadSetout** to stake out road, the first center station of road will display.

Here:

PT#: Station serial number

Code: Station mileage, "C" means center station, "R" means right station, "L" means left station.

Press F1:[READ] key to open the station list.

Press F2:[PREV] key to display previous station..

Press F2:[NEXT] key to display next station.

4. Press F4:[ENT] to enter coordinate staking out screen, see chapter "7.2 Coordinates Stake out Measurement" to do that.

20.7 Road File Management

20.7.1 Select a Road File

All the elements you inputted and the staking data you calculated are recorded in the current road file. You can select other file to define other road, normally one file includes one road.

NOTE:

- ◆ There are 10 road files in total, the factory default setting is “ROAD1”.
- ◆ The default names are “ROAD1”, “ROAD2”... “ROAD10”, you can rename them if necessary.

Road Calculation
1.Input the parameter
2.Road Setout
3.Road file

Road file
1.Road File Select
2.Road File Rename
3.Road File Delete
4.Road Initialize

Road File Select	P1
ROAD1	96
ROAD2	55
ROAD3	0
ROAD4	0
ROAD5	0
ROAD6	0
ROAD7	10

Road File Select	P1
ROAD1	96
ROAD2	55
ROAD3	0
ROAD4	0
ROAD5	0
ROAD6	0
ROAD7	10

Procedures:

1. Press F2: **[MENU]** on P2 of the basic measurement mode, on the page 3 select **1.Road Calculation** enter road menu.

2. Select **3.Road file** to road file management menu.

3. Select **1.Road File Select** to display road file list, the cursor will stay on current Job file.

4. Press ▼ or ▲ arrow key to move cursor, after reach to the job you want to select, press [ENT] key to confirm. The program will back to road file management menu automatically.

20.7.2 Rename a Road File

Road Calculation

- 1.Input the parameter
- 2.Road Setout
- 3.Road file**

Procedures:

1. Press F2: [MENU] on P2 of the basic measurement mode, on the page 3 select **1.Road Calculation** enter road menu.

Road file

- 1.Road File Select
- 2.Road File Rename**
- 3.Road File Delete
- 4.Road Initialize

2. Select **3.Road file** to road file management menu.

Road File Rename

Road4

3. Select **2.Road File Rename**, current road file will display.

Road File Rename

FOIFMA

4. Input new name, press [ENT] key to confirm. The program will back to road file management menu automatically.

NOTE:

The max length of road file name is 8 characters, special symbols can not be accepted, such as “#, ? /.....”

20.7.3 Delete a Road File

Road Calculation
1.Input the parameter
2.Road Setout
3.Road file

Road file
1.Road File Select
2.Road File Rename
3.Road File Delete
4.Road Initialize

Road File Select	P1
ROAD1	96
ROAD2	55
ROAD3	0
FOIFMA	100
ROAD5	0
ROAD6	0
ROAD7	10

FOIFMA

Confirm to delete?

NO YES

Road File Select	P1
ROAD1	96
ROAD2	55
ROAD3	0
ROAD4	0
ROAD5	0
ROAD6	0
ROAD7	10

Procedures:

1. Press F2: **[MENU]** on P2 of the basic measurement mode, on the page 3 select **1.Road Calculation** enter road menu.

2. Select **3.Road file** to road file management menu.

3. Select **3.Road File Delete**, road file list will display.

4. Press ▼ or ▲ arrow key to move cursor, after reach to the job you want to delete, press [ENT] key, it will ask you to confirm to delete, press F3:[NO] back to file list, the file will not be deleted.

5. Press F4:[YES] to delete this file, all the inputted and calculated data in this file will be cleared, and the file name change to initial status.

20.7.4 Delete all Road Files

Road Calculation
1.Input the parameter
2.Road Setout
3.Road file

Procedures:

1. Press F2: [MENU] on P2 of the basic measurement mode, on the page 3 select **1.Road Calculation** enter road menu.

Road file
1.Road File Select
2.Road File Rename
3.Road File Delete
4.Road Initialize

2. Select **3.Road file** to road file management menu.

Clear all roads?

NO **YES**

3. Select **4.Road Initialize**. it will ask you to confirm to clear all roads, press F3:[NO] back to road file management menu, no file is deleted.

Initing

4. Press F4:[YES] to delete all road files, Initing will display, at last it will back to road file management menu automatically.

NOTE:

Pay more attention to this operation, after initialization, all the files back to initial status, the deleted elements and data can not be resumed.

Road File Select		P1
ROAD1	0	
ROAD2	0	
ROAD3	0	
ROAD4	0	
ROAD5	0	
ROAD6	0	
ROAD7	0	

21. Record

You can record measured data, occupied data and notes into the active JOB. The memory is 60000 points in total.

21.1 Record Occupied Data

You can input occupied data into the active JOB. The record items include: occupied coordinates, point number, instrument height, code, user, date, time, weather, wind, temperature, air pressure and ppm. If the current occupied data have not been recorded in the active JOB, the previous occupied data will be used as the active one.

【Procedure of recording occupied data】

Meas	PC	0.0	
	ppm	0	
SD			
VA	302.5432gon		II
HA	0.0000gon		P3
EDM	OCC	OFST	REC

1. Press F4: [REC] on P3 in basic measurement mode to enter into record mode. The active JOB will display.

REC	JOB-MY
1.Occ. data	
2.Angle data	
3.Coord data	
4.Note	
5.View	
6.JOB select	

2. Select “1. Occ. data” to set occupied station.

Pt#	J2
Inst.H	0.000m
Code	ROAD
N0:	0.000
E0:	0.000
Z0:	0.000
User	MA
READ	RES REC OK

3. You can input the following items by hand: PT#, instrument height(Inst.H), code, N0-E0-Z0, , user, date, time, weather, wind, temperature, pressure, and ppm. Press key “▲”/ “▼” to select item or press [FUNC] to turn page.

Press F1:[READ] to read coordinate from memory. See “ § 6.1 Input the occupied point data”.

Press F2:[RES] to enter resection program and get the station coordinate

Press F3:[REC] to record the station coordinate into memory.

Date	:08/08/2006
Time	:10:00:00
Weather	:Cloudy
Wind	:Light
Temp	:25℃
Pressure	
ppm	
OPPM	RES REC OK

At the page 2 of station setting screen, press F1: [OPPM] to set ppm value as 0 directly.

4. Press F1: [OK] to set the station coordinate.

5. Set the backsight information, and back to Rec menu.

NOTE

◆ If the inputted Pt# is the same as an existed one, the instrument will display as shown left.

Press F3: **[NO]** to re-input;


Press F4: **[YES]** to overwrite;

Press F1: **[ADD]** to save, and the original one will not be deleted.

Pt#	J2	
Inst.H	0.000m	▲
Code	ROAD	
NO:	0.000	
EO:	0.000	
ZO:	0.000	
Overwrite ?		
ADD	NO	YES

- ◆ The max length of Pt# is 14 characters.
- ◆ The instrument height range: -9999.999~9999.999.
- ◆ The max length of code and user is 16 characters.
- ◆ Date and time are not allowed to change here.
- ◆ Weather options: Fine, Cloudy, Flurry, Rain, Snow.
- ◆ Wind options: Calm, Gentle, Light, Strong, Gust.
- ◆ The temperature range: -30 ~ 60℃.
- ◆ The pressure range: 500 ~ 1400 hPa(mbar)/ 375 ~ 1050 mmHg /14.8~41.3 inch Hg/ 7.3~20.3 Psi.
- ◆ The ppm range: -499 ~ 499 ppm.

21.2 Collect Angle Data

Meas	PC	0.0
	ppm	0
		
SD		
VA	302.5432gon	II
HA	0.0000gon	P3
EDM	OCC	OFST
		REC

REC	JOB-MY
1.Occ. data	
2.Angle data	
3.Collect Points	
4.Note	
5.View	
6.JOB select	

REC/Angle	Free 44000
VA	148.7080gon
HA	352.4228gon
Pt#	PP01
Tgt.H	1.45ft
Code	NO
AUTO	OSET
	REC

1. Enter into record mode. The active JOB will display.

2. Select “**2. Angle data**”, then aim at the target, the angle will display in real time.

3. Press F4: **[REC]** to input the following items: point number, target height and code, press F1: **[OK]** to save data.

You could press F1: **[AUTO]** to perform this process directly if PT#, code and tgt.H are unnecessary to re-set.

Press F2: **[OSET]** to set horizontal angle as 0

4. Repeat step 3 to collimate and collect other points angle data..

21.3 Distance&Coordinate Data

【Procedure of recording distance&coordinate data 】

Meas	PC	0.0	
	ppm	0	
SD			
VA	302.5432gon		II
HA	0.0000gon		P3
EDM	OCC	OFST	REC

1. Press F4: **[REC]** on P3 in basic measurement mode to enter into record mode. The active JOB will display.

REC	JOB-MY
1.Occ.	data
2.Angle	data
3.Collect	Points
4.Note	
5.View	
6.JOB	select

2. Select “**3. Collect Points**”.

REC/Dist+C	Free	43997
N		5.000
E		5.000
Z		5.000
Pt#	D10	
Tgt.H		1.45ft
Code	NO002	
AUTO	DIST	OFST REC

3. Aim at the target and press F2: **[DIST]** to measure distance, and then **[REC]** will display at the last line, press F4: **[REC]** to input the following items: point number, target height and code, press F1: **[OK]** to save data.

You could press F1: **[AUTO]** to perform this process directly if PT#, code and tgt.H are unnecessary to re-set.

4. Aim at other targets, repeat step 3 to collect other points.


NOTE:

- ◆ After performing the process once, both distance measurement data and coordinate data are recorded into memory as the same Pt#.
- ◆ Distance measured data is recorded firstly, and then coordinate data is recorded.
- ◆ Press **[FUNC]** key, the screen will switch between coordinate mode and distance mode.


REC/Dist+C	Free	43995
SD		19.655
VA	81° 26' 35"	
HA	359° 48' 04"	
Pt#	D10	
Tgt.H		1.45ft
Code	NO002	
AUTO	DIST	OFST REC

21.4 Record Note


【Procedure of recording note】

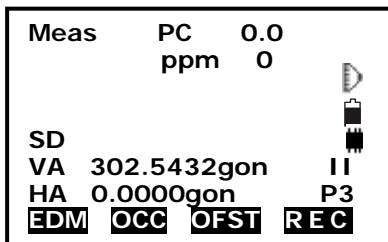

1. Press F3: [REC] on P3 in measure mode to enter into record mode. The active JOB will display.

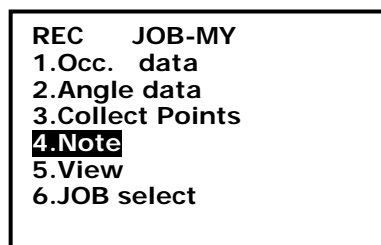

2. Select “4. Note”.

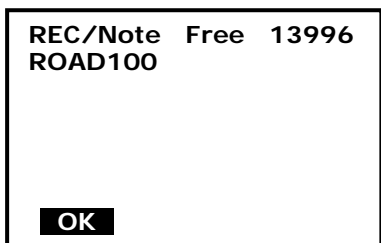

3. Input note and press F1: [OK] to save. The max length is 60 characters.

NOTE:

- ◆ Max note length is 60 characters.

21.5 View Data

【Procedure of view data 】

Meas	PC	0.0	
	ppm	0	
SD			
VA	302.5432gon		
HA	0.0000gon		P3
EDM	OCC	OFST	REC

1. Press F3: [REC] on P3 in measure mode to enter into record mode. The active JOB will display.

REC	JOB-MY
1.Occ.	data
2.Angle	data
3.Collect	Points
4.Note	
5.View	
6.JOB	select

2. Select "5. View".

Stn	J2
Dist	J3
Coord	J3
Dist	J4
Coord	J4
Dist	J5
Coord	J5
↑ ↓ .P	TOP LAST SRCH

3. All recorded data of the active JOB will display,

Press F1:[↑ ↓ .P] key to change the function of ▲ and ▼ keys, if it is light, press ▲ or ▼ to move cursor between adjacent points. If it is back light, press ▲ or ▼ key to move cursor to display adjacent pages.

Press F2:[TOP] key to move cursor to first point..

Press F3:[LAST] key to move cursor to last point

Press F4:[SRCH] key to enter the serial number(PT#) to look for the point.

SD	3.133m
VA	84° 39' 42"
HA	352° 28' 59"
Pt#	J4
Tgt.H	1.45ft
Code	NO002
NEXT	PREV

4.Select one and press key {ENT} to view, press [ESC] back to list.

NOTE:

- ◆ If the point number is the same, only the newer recorded data could be viewed.
- ◆ The data inputted beforehand could be viewed here.

21.6 Select job

【Procedure of job select】

Meas PC 0.0
 ppm 0

SD
VA 302.5432gon
HA 0.0000gon P3

EDM **OCC** **OFST** **REC**

1. Press F3: [**REC**] on P3 in measure mode to enter into record mode. The active JOB will display.

REC JOB-MY
1.Occ. data
2.Angle data
3.Collect Points
4.Note
5.View
6.JOB select

2. Select 6.JOB select to set job, see “22.1 Select a JOB” to operate.

JOB selection
: **JOB2**
S.F. = 1.000000
Coord search JOB
:JOB3


LIST **S.F.**

22. JOB Management

22.1 Storage Media Select


For TS680 series, SD card slot is an standard equipment, user can record the measured data in internal memory or SD card directly. Before your work, it is necessary select appropriate storage media. For both memory, the file management procedures are same.

【Procedure of storage select】

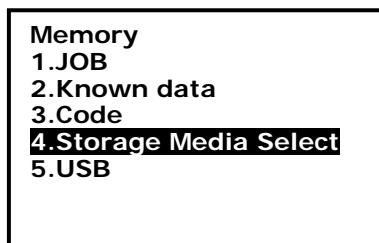


1. Select [**MEM**] in the status mode to enter into memory management.


2. Select “**4. Storage Media Select**” to enter storage media setting screen.

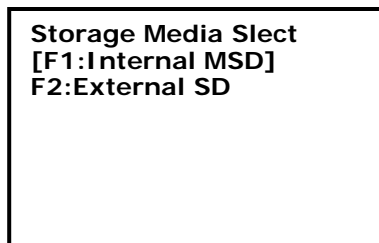



3. Press F1:Internal MSD to set the internal card as current storage media.

Or press F2:External SD to set the external SD card as current storage media.

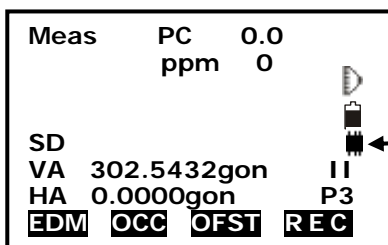

If the internal card is current storage media,  will display on screen right.

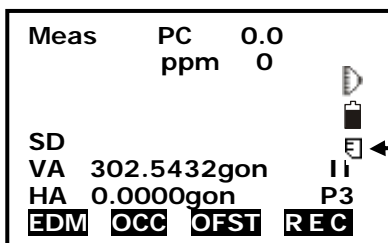

If the external SD card is current storage media,  will display on screen right.

NOTE

1. If the SD card is first using on the total station, when select it as storage media, “Initialing” will take about 30s.
2. If there is no SD card in the card slot, if you select F2:External SD, <NO SD CARD>

will display.

3. At power on mode, if you insert or pull out the SD card, <SD INSERT> or <SD is pulled out> will display, but these operations are not recommended.

4. All the menu for internal memory or external SD card are same.

22.2 Select a JOB

The active JOB or coordinate search JOB could be selected. The data (known data, measured data, occupied data, coordinates, note, etc) are recorded in the active JOB, and user is able to search and read coordinate in the coordinate search JOB when coordinate measuring, resection or stake out.

NOTE:

- ◆ There are 20 JOBS in total, the factory default setting is “JOB1”.
- ◆ The default names are “JOB1”, “JOB2”... “JOB20”, you can rename them if necessary.
- ◆ Scale factor could be set for every JOB, but only the one of the active JOB could be modified.

Here is the equation used to calculate the data: $HD2 = HD1 \times S.F.$

Where, HD2: corrected horizontal distance

HD1: measured horizontal distance

S.F. : scale factor

【Procedure of JOB selection and scale factor setting】

Memory

- 1. JOB
- 2. Known data
- 3. Code
- 4. Storage Media Select
- 5. USB

1. Press F3: [MEM] in the status mode to enter into memory management.

2. Select “1. JOB” to enter JOB management.

JOB

- 1. JOB select
- 2. JOB rename
- 3. JOB delete
- 4. Download
- 5. Com setting
- 6. File Copy

3. Select “1. JOB select” to set an active JOB and a coordinate search JOB.

JOB selection

: JOB2
S.F. = 1.000000
Coord search JOB
: JOB3

LIST

S.F.

4. Press F1: [LIST] to display all JOBS on three pages.
Press F4: [S.F.] to modify the scale factor.

JOB selection	P1
JOB A	15
JOB1	56
JOB-MY	20
MYJOB	50
JOB-B	45
JOB01	2
JOB-C	0

5. Select an active JOB. The numbers to the right represent the number of data items in each JOB. Press key {ENT} to save the setting.

JOB-MY
S.F.=0.999998

6. Input the scale factor if necessary. The range: 0.5000000 ~ 2.000000, and the factory setting is 1.000000.

JOB selection
:JOB-MY
S.F.=0.999998
Coord search JOB
:CORD1
LIST

7. Select a coord search JOB following above steps 4 and 5.

22.3 Rename a JOB

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

1. Press F3: [MEM] in the status mode to enter into memory management.

2. Select “1. JOB” to enter JOB management.

JOB
1.JOB select
2.JOB rename
3.JOB delete
4.Download
5.Com setting
6.File Copy

3. Select “2. JOB rename” to rename the active JOB.

JOB rename	A
JOB-Paul01	

4. Input a new name and press key {ENT} to save the setting. The maximum length of a JOB name is 12 characters.

22.4 Delete a JOB

It is possible to delete an existed JOB. Once the JOB has been deleted with the recorded data cleared, the JOB name returns to the default one.

【Procedure of JOB deletion】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

1. Press F3: [**MEM**] in the status mode to enter into memory management.

2. Select “**1. JOB**” to enter JOB management.

JOB
1.JOB select
2.JOB rename
3.JOB delete
4.Download
5.Com setting
4.File Copy

3. Select “**3. JOB delete**” .

JOB deletion		P1
JOBA	15	
JOB1	56	
JOB-Paul01	20	
MYJOB	50	
JOB-B	45	
JOB01	2	
JOB-C	0	

4. 20 JOBS display on three pages. The numbers to the right represent the points quantity recorded in each JOB. Select the useless JOB that you wanna delete and press key {ENT}.

JOB-C
Confirm to delete?
NO YES

5. Press F3: [**NO**] to give up or press F4: [**YES**] to delete the JOB.

22.5 Output JOB Data

Measured data, occupied data, known point data, note and coordinates data existed in all JOBS could be outputted to PC via serial port.

NOTE:

- ◆ The software FOIF exchange is available in your CD-ROM or download from www.foif.com.cn.
- ◆ Be sure the communication port setting of instrument and PC is the same, see “ § 3.8.3 Communication Port Setting”, you can select **MEM/1.JOB/5.Com setting** to set the communication parameters also.

【Procedure of download】

<div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> Memory 1.JOB 2.Known data 3.Code 4.Storage Media Select 5.USB </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> JOB 1.JOB select 2.JOB rename 3.JOB delete 4.Download 5.Com setting 6.File Copy </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> <table border="0" style="width: 100%;"> <tr> <td>JOB deletion</td> <td style="text-align: right;">P1</td> </tr> <tr> <td>JOBA</td> <td style="text-align: right;">15</td> </tr> <tr> <td>JOB1</td> <td style="text-align: right;">56</td> </tr> <tr> <td>JOB-Paul01</td> <td style="text-align: right;">20</td> </tr> <tr> <td>MYJOB</td> <td style="text-align: right;">50</td> </tr> <tr> <td>JOB-B</td> <td style="text-align: right;">45</td> </tr> <tr> <td>JOB01</td> <td style="text-align: right;">2</td> </tr> <tr> <td>JOB-C</td> <td style="text-align: right;">0</td> </tr> </table> </div> <div style="border: 1px solid black; padding: 5px;"> Com output <div style="text-align: center;"> Sending 0 </div> </div>	JOB deletion	P1	JOBA	15	JOB1	56	JOB-Paul01	20	MYJOB	50	JOB-B	45	JOB01	2	JOB-C	0	<ol style="list-style-type: none"> 1. Select [MEM] in the status mode to enter into memory management. 2. Select “1. JOB” to enter JOB management. 3. Connect your instrument and computer via communication cable (standard component). 4. Select “4. Download” to enter into com output mode and all JOBS display. 5. Select the JOB to be output. 6. Press key {ENT} to start to send out via RS-232C port, it will back to JOB list mode after finishing. <p>More details see the Help file of FOIFExchange, see chapter “2.1 Data transfer via RS-232C port”.</p>
JOB deletion	P1																
JOBA	15																
JOB1	56																
JOB-Paul01	20																
MYJOB	50																
JOB-B	45																
JOB01	2																
JOB-C	0																

22.6 File Copy

It is possible to copy the job from current internal memory to SD card, or copy known data from SD card to internal memory.

【Procedure of JOB copy】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

1. Select **MEM/1.JOB/6.File Copy**.

JOB
1.JOB select
2.JOB rename
3.JOB delete
4.Download
5.Com setting
6.File Copy

2. Select “**6. File Copy**”, the job list for current memory will display.

JOB deletion		P1
JOB A	15	
JOBCDD	56	
JOB-Paul01	20	
MYJOB	50	
JOB-B	45	
JOB01	2	
JOB-C000000	0	

3. 20 JOBS display on three pages, select one job you want to copy. And press [ENT] key to confirm.

JOBCDD
Confirm to Copy?
NO YES

4. Press F3: **[NO]** to give up or press F4: **[YES]** to copy.

5. For more information, please read the Help file of FOIFExchange on chapter “2.3 Data transfer via SD card”.

22.7 Connect PC via USB port

TS680 is equipped with USB port, you can connect it with PC for data transferring.

【Procedure of USB port connecting】

Memory

- 1.JOB
- 2.Known data
- 3.Code
- 4.Storage Media Select
- 5.USB**

1. Select [**MEM**] in the status mode to enter into memory management.

U FUNCTION
Plug the USB
Exit Press ESC

2. Select “**5.USB**” to enter USB port connecting screen.

U FUNCTION
Stop Press ESC

3. Connect instrument and PC via USB cable, TS680 will display “U FUNCTION Stop Press ESC”. It means the TS680 is connected with PC already. Press [ESC] to disconnect them, and the instrument back to previous menu.

Memory

- 1.JOB
- 2.Known data
- 3.Code
- 4.Storage Media Select
- 5.USB**

For more information to see the Help file of FOIFExchange on chapter “2.2 Data transfer via USB slave port”.

23. Known Data Management

There are 6 items in known data management.

23.1 Input Known Point Coordinate by Keys

You could input or delete coordinates of known point in the active JOB by key entry or entry from PC. The existed data you have input beforehand could be used as occupied point, backsight point, coordinates of known point or stakeout point. The memory is 60000 points in total.

【Procedure of Inputting known points coordinate】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

1. Press F3: [**MEM**] in the status mode to enter into memory management.

JOB selection	P1
DAFENG	10
JOBFF	3000
WOMENSHI	1256
FATELU	100
KEMEN	560
JOB6	0
JOB7	0

2. Select “**2.Known data**”, job list will display. Select one Job you want to operate, press [ENT] key to confirm, known data menu will display, you can see the active JOB on the second line..

Known data
JOB JOB6
1.Key input
2.Com input
3.Delete
4.View
5.Clear
6.Com setting

3. Select **1.Key Input**.

JOB6	Free	45912
Pt#	S1	
N	10.500	
E	11.544	
Z	100.000	
	OK	

4. Input point number and coordinates. The active job and free memory is displayed at the top right corner. Press F4: [**OK**] to save settings and continue to input other points. Press key {ESC} back to the known data mode.

JOB6	Free	45911
Pt#	S1	
N	10.500	
E	11.544	
Z	100.000	
Overwrite?		
ADD	NO	YES

5. Once the Pt# is the same as an existed one, it will display as shown left:

Press F3: [**NO**] to re-input;

Press F4: [**YES**] to overwrite;

Press F1: [**ADD**] to save, and the original one will not be deleted.

23.2 Input Known Point Coordinate via RS-232C

【Procedure of Inputting known points coordinate】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

1. Connect instrument and PC via RS-232C communication cable. Press F3: [**MEM**] in the status mode to enter into memory management.

JOB selection	P1
DAFENG	10
JOBFF	3000
WOMENSHI	1256
FATELU	100
KEMEN	560
JOB6	0
JOB7	0

2. Select “**2.Known data**” , job list will display. Select one Job you want to operate, press [ENT] key to confirm, known data menu will display, you can see the active JOB on the second line..

Known data
JOB JOB6
1.Key input
2.Com input
3.Delete
4.View
5.Clear
6.Com setting

3. Select “**2.Com input**”.

Com input
Receiving 0

4. Run FOIFExchange software PC, see the help file of FOIFExchange to upload known data to current JOB, the chapter is “2.1.2 Upload Known data from PC to TS680 internal memory”.

When data transferring, the number following Receiving will upgrade continually, at last it will back to known data mode after finishing.

23.3 Delete known point coordinate

【Procedure of known points deletion】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

JOB selection	P1
DAFENG	10
JOBFF	3000
WOMENSHI	1256
FATELU	100
KEMEN	560
JOB6	510
JOB7	0

Known data
JOB JOB6
1.Key input
2.Com input
3.Delete
4.View
5.Clear
6.Com setting

Pt#	1
Pt#	2
Pt#	3
Pt#	A
Pt#	B
Pt#	S1
Pt#	S1
↑ ↓ .P TOP LAST SRCH	

N	0.000
E	0.000
Z	10.919
Pt#	S1
NEXT PREV DEL	

1. Press F3: **[MEM]** in the status mode to enter into memory management.

2. Select “**2.Known data**” , job list will display. Select one Job you want to operate, press **[ENT]** key to confirm, known data menu will display, you can see the active JOB on the second line..

3. Select “**3.Delete**” and all known points in current JOB will display.

4. Select a point you want to delete, the point coordinate will display.

5. Press F1: **[NEXT]** to display the next point data;

Press F2: **[PREV]** to display the previous point data;

Press F4: **[DEL]** to delete it and continue to delete other points;

Press key **{ESC}** back to known data management mode.

23.4 View known points data

【Procedure of known points view】

```
Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB
```

1. Press F3: **[MEM]** in the status mode to enter into memory management.

```
JOB selection      P1
DAFENG            10
JOBFF             3000
WOMENSHI         1256
FATELU            100
KEMEN             560
JOB6              510
JOB7              0
```

2. Select “**2.Known data**” , job list will display. Select one Job you want to operate, press [ENT] key to confirm, known data menu will display, you can see the active JOB on the second line..

```
Known data
JOB   JOB6
1.Key input
2.Com input
3.Delete
4.View
5.Clear
6.Com setting
```

3. Select “**4.View**” and all known points of the current JOB will display.

```
Pt#    1
Pt#    2
Pt#    3
Pt#    A
Pt#    B
Pt#    S1
Pt#    S2
↑↓.P TOP LAST SRCH
```

4. Select a required point.

Here:

Press F1:[**↑ ↓ .P**] key to change the function of **▲** and **▼** keys, if it is light, press **▲** or **▼** to move cursor between adjacent points. If it is back light, press **▲** or **▼** key to move cursor to display adjacent pages.

Press F2:[**TOP**] key to move cursor to first point..

Press F3:[**LAST**] key to move cursor to last point

Press F4:[**SRCH**] key to enter the serial number(PT#) to look for the point.

```
N          50.000
E          100.000
Z          10.919
Pt#    S1
NEXT PREV
```

5. The coordinate and point number will display.

Press F1: **[NEXT]** to display the next point data;

Press F2: **[PREV]** to display the previous point data.

23.5 Clear all known points' data

【Procedure of clearing all known points】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

JOB selection	P1
DAFENG	10
JOBFF	3000
WOMENSHI	1256
FATELU	100
KEMEN	560
JOB6	510
JOB7	0

Known data
JOB JOB6
1.Key input
2.Com input
3.Delete
4.View
5.Clear
6.Com setting

Clear
Confirm to delete?

NO YES

1. Press F3: [**MEM**] in the status mode to enter into memory management.

2. Select “**2.Known data**” , job list will display. Select one Job you want to operate, press [ENT] key to confirm, known data menu will display, you can see the active JOB on the second line..

3. Select “**5.Clear**”.

4. Press F3: [**NO**] back to known data management.

Press F4: [**YES**] to delete all known points data of the active JOB completely.

24. Code Management

You could edit codes in this mode. All existed codes in memory could be read for all jobs, and the selected code could be recorded together with occupied data or measured data.

24.1 Edit Code list

【Procedure of inputting a code】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

1. Select [MEM] in the status mode to enter into memory management.

2. Select “3.Code” to enter into code management.

Code
1.Code Edit
2.Clear list

3. Select “1.Code Edit”, the code will display.

4. Press ▲ or ▼ key to move the cursor, and input or correct code.

001:CODE
002:CODEA
003:CODEB
004:CODEBCD
005:CODEBDEG
006:CODEBES
007:
↑ ↓ .P TOP LAST DEL

Here:

Press F1:[↑ ↓ .P] key to change the function of ▲ and ▼ keys, if it is light, press ▲ or ▼ to move cursor between adjacent codes. If it is back light, press ▲ or ▼ key to move cursor to display adjacent pages.

Press F2:[TOP] key to move cursor to first code

Press F3:[LAST] key to move cursor to last code

Press F4:[DEL] key to selected code.

NOTE:

- ◆ The codes recorded in memory could be read for all JOBs.
- ◆ 50 codes can be inputted.

24.2 Clear all Codes

【Procedure of clearing all codes】

Memory
1.JOB
2.Known data
3.Code
4.Storage Media Select
5.USB

1. Press F3: [**MEM**] in the status mode to enter into memory management.

2. Select “**3.Code**” to enter into code management.

Code
1.Code Edit
2.Clear list

3. Select “**2.Clear list**”.

Clear all codes,
Confirm to delete?

NO YES

4. Press F3: [**NO**] back to previous mode;

Press F4: [**YES**] to delete all codes recorded in memory of all JOBs completely.

001:
002:
003:
004:
005:
006:
007:
↑ ↓ .P TOP LAST DEL

5.If you select “**1.Code Edit**”, you will find no code inside.

25. Warning and Error Messages

“Low Signal !”

Please accurately re-sight the target.

“Same coordinates”

The coordinates of the backsights are the same, please re-define or re-input.

“Out of value”

The difference value of coordinates is over range

“Out of range”

The stake out height is over range.

“Need 1st obs”

During missing line measurement, the observation of the starting position was not completed normally. Sight the starting position accurately and press [**OBS**] to perform the measurement again.

“Change 1st obs?”

During missing line measurement, the observation of the target was not completed normally. Sight the target accurately and press [**MLM**] to perform the measurement again.

“Need prism obs”

During REM measuring, the observation of the target was not completed normally. Sight the offset point accurately and press [**MEAS**] to perform the measurement again.

“No Free Space!”

There is no more space to enter data. Record the data again after deleting unnecessary data from the JOB or coordinate data from memory.

“No data”


When searching for coordinate data or searching for code data, the search stopped either because the item in question does not exist or the data volume is large.

26. Check and Adjustment

26.1 The Instrument Constant

I. Check

It is suggested to observe and compare the instrument with a testing baseline which is set on stable ground with a particular accuracy, though error is not generally included in the instrument constant. If the testing line is unavailable, you can select a flat place and set up the instrument and a target in the same height.

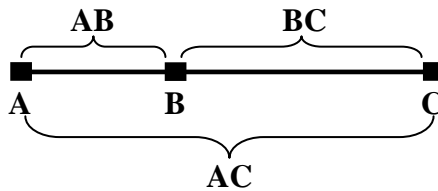

1. Select a point B on the approximately horizontal line AC with about 100 meters long. Measure the distances of lines AB, AC and BC.

2. The instrument constant can be calculated;

$$\text{instrument constant} = AB + BC - AC$$

3. Repeat steps 1 and 2 ten times, and get the average value for instrument const, if the average value is within $\pm 3\text{mm}$, adjustment is unnecessary.

4. If the difference is over $\pm 3\text{mm}$ after the preceding operations, it is necessary to reset the instrument constant.

II. Adjustment

If the instrument const is necessary to reset, please contact FOIF service representative to perform that.


26.2 Tubular Level

I . Check

1. Mount the instrument on a stable device (as tripod, adjusting device), and fix it.
2. Level the instrument until the plate level is parallel to a line linking leveling foot screws A and B, then adjust the two screws to center the bubble.
3. Turn the instrument $180^\circ/200\text{gon}$, observe the moving direction of the bubble, if it is still centered, no adjustment is necessary, if not, you have to adjust it.

II . Adjustment


1. Mount the instrument on a stable device and fix it.
2. Level it roughly.
3. Turn the instrument and make the tubular level be parallel to a line linking two leveling foot screws, then adjust the two screws to center the bubble.
4. Turn the instrument $180^\circ/200\text{gon}$, adjust the Adj-screw with adjustment pin slightly to correct half of the bubble's displacement when it doesn't move,
5. Repeat operations 3, 4 until the bubble remains centered in any position.

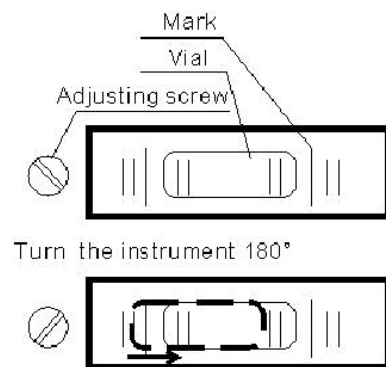

26.3 Circular Level


I . Check

1. Mount the instrument on a stable device and fix it.
2. Level it accurately by the plate level.
3. Observe the bubble of the circular level, if it is centered, no adjustment is necessary, if not, you have to adjust it.

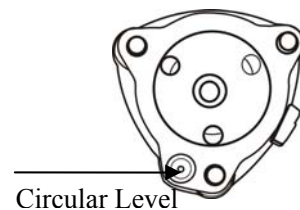

II . Adjustment

1. Mount the instrument on a stable device and fix it.
2. Level it accurately by the plate level.
3. Adjust the three adj-screws to center the bubble by a wrench.

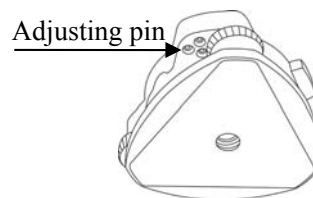


NOTE: Be careful when adjusting the three screws, and the tightening tension is identical for them.

26.4 The Optical Sight


I . Check

1. Mount the instrument on a tripod and fix it.
2. Set a cross mark target which apart from the instrument about 50m.
3. Take the telescope sight the cross mark.
4. Observe the optical sight collimator whether collimating the cross mark, if collimate the mark, adjustment is not necessary; if not, adjust it.

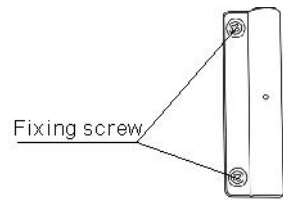

II . Adjustment

1. Mount the instrument at the tripod and fix it.
2. Set a cross mark target which apart from the instrument about 50m.
3. Take the telescope sight the cross mark.
4. Loosen two fixing screws, adjust the collimator, then fix the two screws again.

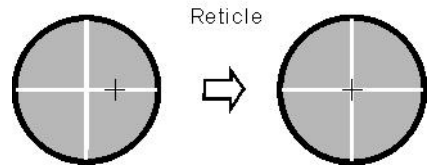



26.5 Optical Plummet (optional)

I . Check

1. Mount the instrument at the tripod and fix it.
2. Set a cross mark under the instrument
3. Coincide the center mark of the optical plummet with the cross mark by adjusting three leveling foot screws.
4. Turn the instrument $180^\circ/200\text{gon}$, check the center mark and cross mark, if they are coincide, no adjustment is necessary, if not, adjust it.

II . Adjustment

1. Set the instrument on stable device and fix it.
2. Set a cross mark under the instrument.
3. Use the three leveling screws and coincide the center mark of plummet and cross mark on the ground.
4. Rotate the instrument $180^\circ/200\text{gon}$ around and take off the cover of the optical plummet eyepiece, adjust the four adjusting screws with the adjusting pin to shift the center mark to the cross mark, correct only one-half of the displacement in this manner.
- (5) Repeat the operation in (3) and (4) until coincide the center mark of the plummet and cross mark on the ground.

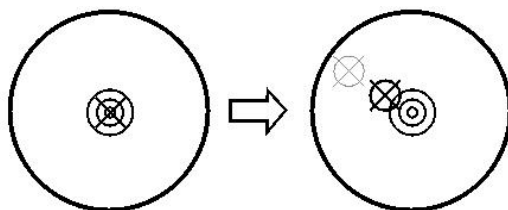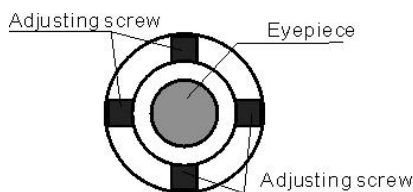

NOTE: When adjust the screws of plummet reticle, firstly loosen the screw on the moving direction of reticle, secondly tighten another screw by the same mount, clockwise turning is for tightening, and anticlockwise turning is for loosening, the turning mount for tightening or loosening should be same.

26.6 Laser Plummet

I . Check

- (1) Set the instrument on stable device and fix it;
- (2) Set a cross mark on the ground under the instrument;
- (3) Turn the three leveling screws until the instrument keeps leveling and the laser spot coincides with the cross mark on the ground;
- (4) Rotate the instrument 180° (200gon) around and check the laser spot and cross mark, if they are coincide, adjustment is not required. Otherwise, adjust it.


II . Adjustment

- (1) Set the instrument on stable device and fix it;
- (2) Set a cross mark on the ground under the instrument;
- (3) Turn the three leveling screws until the instrument keeps leveling and the laser spot coincides with the cross mark on the ground;
- (4) Rotate the instrument 180° (200gon) around and take off the protecting cover of the laser plummet, adjust the four adjusting screws with the screwdriver to move the laser spot to the cross mark, correct only one-half of the displacement in this manner.
- (5) Repeat operation 3, 4 until the instrument keeps leveling and the laser spot coincides with the cross mark when rotating alidade of instrument to any direction.

26.7 Vertical Cross-hair on Telescope

I . Check


- (1) Set the instrument up the tripod and carefully level it.
- (2) Set a point A front the instrument 50m apart;
- (3) Collimate the point A and adjust the vertical tangent screw; If the point appears to move continuously on the hair, adjustment is not required. Otherwise, adjust it.

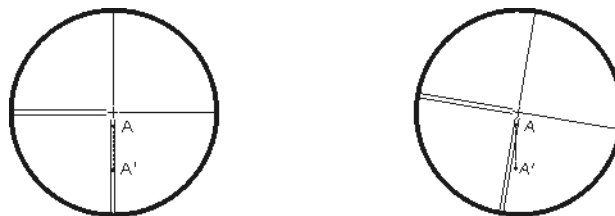

II. Adjustment

- (1) Set the instrument, and set the point A front the instrument 50m apart.
- (2) Take off cover of telescope eyepiece, there are 4 screws for the reticle part.
- (3) Loosen all four fixing screws slightly with the cross screw-driver.
- (4) Revolve the eyepiece section so that the vertical cross-hair coincides to point A, finally, re-tighten the four screws.
- (5) Repeat the checking and adjusting until there is no deviation.

NOTE: After the adjustment of cross-hair, please check the collimation error and vertical index error, see “ § 27.11 EDM Optical Axis and the Telescope Sighting Axis Error”.

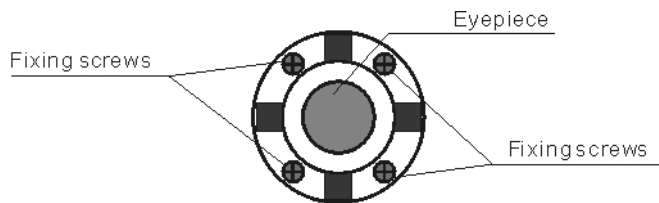

26.8 Horizontal Collimation Error C


If the telescope's sight line isn't perpendicular to the horizontal axis, the collimation error will appear. The assembling, transportation and operation will cause this error.

I. Check

- (1) Set-up the instrument on tripod or adjustment platform and leveling accurately.
- (2) Aim at the cross-hairs of collimator or the obvious target at a distance. Gets the face left angle reading H_1 and the face right angle reading H_r .
- (3) Calculating the horizontal collimation error C according to $C = (H_1 - H_r \pm 180^\circ) / 2$, if $C < 8''$, no adjustment will be necessary. If $C > 8''$, proceed with the following adjustment.

II. Adjustment

- (1) Power on the instrument after leveling-up, and rotate telescope to initial.
- (2) Aim at the cross-hairs of collimator or the obvious target at a distance. Gets the face left angle reading H_1 and the face right angle reading H_r .
- (3) Rotate the instrument in face right position, turning horizontal tangent screw until $H_r' = H_r + C$.
- (4) Loosen the shield of telescope's reticle. Adjusting two screws at left and at right until the vertical hairs of telescope's reticle coincides with the cross-hairs of collimator or target.
- (5) Repeat the check and adjustment procedure until the error is accepted.

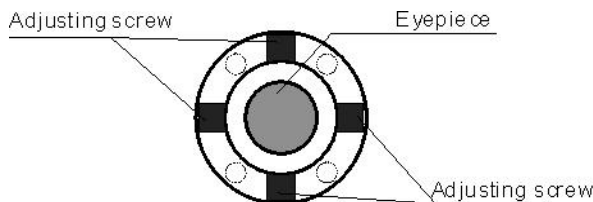

NOTE:

1. When adjusting the screws of reticle, firstly loosen the screw on the moving direction of reticle, secondly tighten another screw by the same mount, clockwise turning is for tightening, and anticlockwise turning is for loosening, the turning mount for tightening or loosening should be same.
2. After the reticle adjustment, it is necessary to adjust the vertical index error by program, see “ § 23.10 Vertical Index Error”.

26.9 Tilt Sensor

If the tilt angle shown on the display shifts from tilt angle 0° (zero point), the instrument is not correctly leveled. This will adversely affect angle measurement. Perform the following procedures to cancel the tilt zero point error.

I . Check

Set-up the instrument on tripod or adjustment platform, and level it accurately.

Config

- 1.Meas condition
- 2.Inst config
- 3.Inst adjust**
- 4.Com setting
- 5.Unit
- 6.Date & Time

1. Press F3: [**OSET**] twice to set HA to 0° on P1 in measure mode.

Press key {Cnfg} to enter into config mode.

2. Select “**3.Inst adjust**” to set instrument basic parameters, two items display.

Inst adjust

- 1.Tilt correct**
- 2.Index error correct

3. Select “**1. Tilt correct**”.

Tilt offset

X -0.0020gon
Y 0.0032gon
HA 127.1202gon
Take F1 I

4. Wait a few seconds for this display to stabilize, then read the automatically compensated angles X1 and Y1.

OK

Tilt offset	
X	-0.0008gon
Y	0.0012gon
Take F1	II
OK	

5. Rotate the instrument 180° /200gon. Loosen the horizontal clamp and turn the instrument 180° /200gon while referring to the displayed horizontal angle, then re-tighten the clamp. Wait a few seconds for the display to stabilize, then read the automatically compensated angles X2 and Y2.

Calculate the following offset values (tilt zero point error):

$$X_{\text{offset}} = (X1 + X2) / 2$$

$$Y_{\text{offset}} = (Y1 + Y2) / 2$$

When the offset value falls within the range $\pm 20''$, adjustment is not necessary. If one of the offset values (X_{offset} , Y_{offset}) exceeds $\pm 20''$, adjust the value as follows.

II. Adjustment

Tilt offset	
X	-0.0008gon
Y	0.0012gon
Take F2	II
OK	

6. Press F3: **[OK]** to set the horizontal angle to 0° , "Take F2" is displayed.

7. Rotate the top of instrument 180° /200gon. Wait a few seconds for the display to stabilize, then press F3: **[OK]**.

X Old	0.0020gon
Y Old	0.0022gon
X New	0.0006gon
Y New	-0.0004gon
Set ?	
YES NO	

8. If both correction constant are in the range, press F3: **[YES]** to renew the correction angle, or press F4: **[NO]** to give up this adjustment,

26.10 Vertical Index Error

The deviation between vertical circle zero position and horizontal direction is vertical index (i), it is necessary to concern this error when measure vertical angle. The instrument program applied a formula to correct this error.

Warning: Before starting this operation, be sure to read this manual carefully, otherwise it may cause data faulty.

Because of the close relationship between vertical index and compensator zero position, it is necessary to check and adjust compensator zero position before adjusting vertical circle, the value should be stable when reading.

I. Check:

Please adjust the reticle of telescope and correct the collimation error before this operation.

(1) Mount the instrument at the tripod or a stable device and level it accurately, then turn on the instrument.

(2) Aim at the cross-hairs of collimator or the obvious target at a distance, VA should be about $\pm 10^\circ$. Read the face left angle VI and face right angle Vr.

(3) Calculate the index error according to the formula below:

$$i = (VI + Vr - 360^\circ) / 2$$

(4) If $i < 10''$, no adjustment is necessary, or you have to adjust it.

II. Adjustment by program:

Set-up the instrument on tripod or adjustment platform, and level it accurately.

Config

- 1.Meas condition
- 2.Inst config
- 3.Inst adjust**
- 4.Com setting
- 5.Unit
- 6.Date & Time

1. Press key {Cnfg} to enter into config mode.

2. Select “**3.Inst adjust**” to set instrument basic parameters. Two items display.

Inst adjust

- 1.Tilt correct
- 2.Index error correct**

3. Select “**2.Index error correct**”.

Index error correct

VA 95.8860gon
HA 115.4506gon

Take F1 I

OK

4. Sight a reference point in face I and press F3: [**OK**].

Index error correct

VA 295.8860gon
HA 115.4506gon

Take F2 II

OK

5. Sight the reference point in face II. Rotate the instrument $180^\circ / 200\text{gon}$ and sight the same point, then press F3: [**OK**].

Index Error	
Old	0.0048gon
New	0.0012gon
Set ?	YES NO


6. Press F3: [YES] to set the correction, and press F4: [NO] to give up.

26.11 EDM Optical Axis and the Telescope Sighting Axis Error

It is necessary to check this error after the adjustment of telescope reticle error.

I. Check (For RTS680 series)

- (1) Install the instrument at the tripod or a stable device and level it accurately, then turn on the instrument's power on.
- (2) Set a prism about 2m far away from the instrument.
- (3) Aim at the prism center with telescope reticle
- (4) Enter EDM signal testing screen, see “ § 4.7 Setting Mode”.
- (5) Observe through eyepiece, turn the focusing knob until the read mark is clear, if the deviation between mark and cross-hair is not over 1/5 of red mark diameter, adjustment is unnecessary.

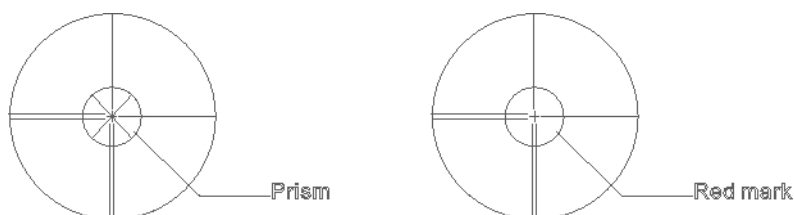

II. Check (For OTS680 series)

- (1) Install the instrument at the tripod or a stable device and level it accurately, then power on the instrument.
- (2) Set a reflective sheet about 5m-20m far away from the instrument.
- (3) Aim at the sheet cross-mark with telescope reticle.



- (4) Enter EDM signal testing screen, see “ § 4.7 Setting Mode”.
- (5) Observe the laser spot, if the laser spot coincides with the cross-mark of reflective sheet, adjustment is unnecessary.

NOTE:

- 1. Laser radiation—Avoid direct eye exposure.
- 2. If the instrument needs adjustment, please contact your local dealer.

27. Technical Data

RTS680 series

Telescope

Length	156mm
Image	Erect
Objective aperture	Φ45mm
Magnification	30×
Field of view	1° 30'
Mini focus distance	1.0m
Reticle illumination	10 brightness levels

Angle measurement

Reading system	Absolute encoder
Circle diameter	79mm
Angle unit	degree/gon/mil, selectable
Minimum display	1"/5"/10", selectable
	0.0001°/0.0005°/0.001°, selectable
	0.2mgon/1mgon/2mgon, selectable
Detecting mode	Both circles adopt diametrical detection
Accuracy	681 1"
	682 2"
	685 5"

Distance measurement

Distance unit	m/ft, selectable
Measurement range(good condition)	Single prism 1 to 3000m
Mini-reading	Fine mode 1mm(0.01ft)
	Tracking mode 10mm (0.1ft)
Accuracy	±(1.5mm + 2ppm·D)/ ±(1mm + ppm·D) optional
Measurement time	Fine/Rapid/Tracking: 1.5s/0.9s/0.5s
	Initial: 3s
Temperature unit	°C/°F, selectable
Pressure unit	hPa/mmHg/inchHg, selectable
Temperature input range	-30°C to +60°C (1°C steps)
Pressure input range	510hPa to 1066hPa(1hPa setps)
Prism constant condition	-99.9mm ~ +99.9mm
Refraction and earth curvature correction	OFF/0.14/0.2, selectable
Reflecting prism constant correction	-99.9mm to +99.9mm

Level vial sensitivity

Plate level	30" / 2mm
Circular level	8' / 3mm

Compensation

System	Liquid dual axis
Range	±3'

Optical plummet(Optional)

Accuracy	±0.8mm/1.5m
Image	Erect
Magnification	3×
Focusing range	0.5m ~ ∞
Field of view	4°

Laser plummet *²

Accuracy	±1mm/1.5m
Laser class	Class 2/IEC60825-1
Focus range	0.5m ~ ∞
Laser wave length	635nm

Display

LCD	8 lines×24 characters
Illumination	Yes

Memory

Internal memory	60000 points
External SD card	60000 points

Data communication

I/O	RS-232C/USB/SD card/Bluetooth(optional) * ³
-----	--

Power

Battery	3400mAh Li-ion rechargeable battery
Voltage	7.2 V DC
Continuous operation time	9 hours(At +20℃)
Chargers	FDJ6-Li (100V to 240V 50/60Hz)
Charging time	Approx. 4 hours

Others

CPU	32-bit
EDM technology	Digital signal processing, single mainboard

Working temperature	-20°~+50°C
Dimension	220×184×360mm(W×D×H)
Weight	5.5kg
Water proof	IP55 (IEC60529)

OTS680 Power series

Telescope

Length	156mm
Image	Erect
Objective aperture	Φ45mm
Magnification	30×
Field of view	1°30′
Mini focus distance	1.0m
Reticle illumination	10 brightness levels

Angle measurement

Reading system	Absolute encoder for 680 series
Circle diameter	79mm
Angle unit	degree/gon, selectable
Minimum display	1"/5"/10", selectable
	0.0001°/0.0005°/0.001°, selectable
	0.2mgon/1mgon/2mgon, selectable
Detecting mode	Both circles adopt diametrical detection
Accuracy	681 1"
	682 2"
	685 5"

Distance measurement

Laser wave length	650-690nm
Laser class	
Reflectorless	Class 3R (IEC 60825-1)
Reflective sheet	Class 3R (IEC 60825-1)
Prism	Class 1(IEC 60825-1)
Measurement range (Overcast, no haze, visibility about 30 km; no heat shimmer)	
Reflectorless * ¹	
R300	1 to 300m
R500	1 to 500m
Single prism	1 to 3000m/Class 1
	1000~7000m/Class 3R

Reflective sheet/RP60	1 to 800m
Accuracy	
Prism mode	1.5mm+2ppm/1mm+1.5ppm(optional)
Reflective sheet/RP60	3mm+2ppm
Reflectorless mode	
R300	3mm+2ppm(1-150m)/5mm+2ppm ($\geq 150m$)
R500	3mm+2ppm(1-200m)/5mm+2ppm ($\geq 200m$)
Measurement time(Initial:2.5s)	
Prism	typical 1.0-1.5s,
Reflective sheet(RP60)	typical 1.5s
Reflectorless	typical 1.5-5s, max. 20s
Display resolution	
Fine mode	0.1mm (0.001ft) /1mm (0.01ft)
Tracking mode	10mm(0.1ft)
Distance unit	m/ft, selectable
Temperature unit	°C/°F, selectable
Pressure unit	hPa/mmHg/inchHg, selectable
Temperature input range	-30°C to +60°C (1°C steps)
Pressure input range	510hPa to 1066hPa(1hPa setps)
Prism constant condition	-99.9mm to +99.9mm
Refraction and earth curvature correction	OFF/0.14/0.2, selectable
Reflecting prism constant correction	-99.9mm to +99.9mm
Level vial sensitivity	
Plate level	30" / 2mm
Circular level	8' / 2mm
Compensation	Dual-axis
System	Liquid type
Range	$\pm 3'$
Optical plummet(Optional)	
Accuracy	$\pm 0.8mm/1.5m$
Image	Erect
Magnification	3×
Focusing range	0.5m $\sim \infty$
Field of view	4°

Laser plummet*²

Accuracy	±1mm/1.5m
Laser class	Class 2/IEC60825-1
Focus range	0.5m ~ ∞
Laser wave length	635nm

Display

LCD	8 lines×24 characters(128x240 dots)
-----	-------------------------------------

Memory

Internal memory	60000 points
External SD card	60000 points

Data communication

I/O	RS-232C/USB/SD card/ Bluetooth™* ³ (optional)
-----	--

Power

Battery	3400mAh Li-ion Rechargeable battery
Voltage	7.2V DC
Continuous operation time	9 hours(At +20°C)
Chargers	FDJ6-Li(100V to 240V 50/60Hz)
Charging time	Approx. 4 hours

Others

CPU	32-bit
EDM technology	Digital signal processing, single mainboard
Build-in temp.& pressure sensor	Standard
Working temperature	-20°~+50°C
Dimension	220×184×360mm(W×D×H)
Weight	5.5kg
Water proof	IP55(IEC60529)

***¹ Technical Data for OTS Power series EDM Reflectorless Measurement Range**

Option	Kodak Gray Card	Range D	Range E	Range F
		m	m	m
R300	White side, 90% reflective	200	250	300
	Gray side, 18% reflective	100	120	150
R500	White side, 90% reflective	300	400	500
	Gray side, 18% reflective	150	200	250

**Atmospheric
Conditions**

D: Object in strong sunlight, severe heat shimmer

E: Object in shade, sky overcast

F: Underground, night and twilight

*² Laser plummet mounted on the bottom of the vertical axis

*³ Bluetooth

OTS680 Ultra series

Telescope

Length	156mm
Image	Erect
Objective aperture	Φ45mm
Magnification	30×
Field of view	1°30′
Mini focus distance	1.0m
Reticle illumination	10 brightness levels

Angle measurement

Reading system	Absolute encoder for 680 series	
Circle diameter	79mm	
Angle unit	degree/gon, selectable	
Minimum display	1"/5"/10", selectable	
	0.0001°/0.0005°/0.001°, selectable	
	0.2mgon/1mgon/2mgon, selectable	
Detecting mode	Both circles adopt diametrical detection	
Accuracy	681	1"
	682	2"
	685	5"

Distance measurement

Distance Measurement with Reflectors

Range

Reflector	Laser class	Range A	Range B	Range C
Standard prism (Standard mode)	Class1 (IEC 60825-1)	1800	3000	3500
Standard prism (Long mode)	Class2 (IEC 60825-1)	3000	5000	6000
Reflector sheet (60mm×60mm)	Class2 (IEC 60825-1)	800	1000	1200
Mini prism	Class1 (IEC 60825-1)	800	1000	1200

Shortest measuring distance: 1m

Atmospheric conditions

Range A: Strong haze, visibility 5 km; or strong sunlight, severe heat shimmer

Range B: Light haze, visibility about 20 km; or moderate sunlight, slight heat shimmer

Range C: Overcast, no haze, visibility about 40 km; no heat shimmer

Accuracy

Accuracy refers to measurements to standard reflectors.

Laser class	EDM measuring mode	Standard deviation ISO17123-4	Measurement time, typical [s] (Condition B)
Standard mode- Class1(IEC 60825-1)	Prism-Standard	1mm+1.5ppm	1.0s~5.0s
	Prism-Fast	3mm+1.5ppm	0.5s~3s
	Sheet-Standard	2mm+2ppm	1.0s~5.0s
	Sheet-Fast	5mm+2ppm	0.5s~3s
Long mode- Class2(IEC 60825-1)	Prism-Standard >3.5km	2mm+2.5ppm	0.7s~6s

Beam interruptions, severe heat shimmer and moving objects within the beam path can result in deviations of the specified accuracy.

Distance Measurement without Reflectors (Non-Prism mode)

Range

Kodak Gray Card	Laser class	Range D	Range E	Range F
White side, 90% reflective	Standard mode:	500	800	1000
Grey side, 18% reflective	Class2(IEC 60825-1)	250	400	500
White side, 90% reflective	Long mode:	800	1000	1200
Grey side, 18% reflective	Class3R(IEC 60825-1)	400	500	600

Shortest measuring distance: 0.1m(from instrument center)

Atmospheric conditions

Range D: Sunny, Strong haze, visibility 5 km, severe heat shimmer

Range E: Sunny, Light haze, visibility about 20 km; slight heat shimmer

Range F: Overcast, no haze, visibility about 40 km; no heat shimmer

Measuring time and accuracy

Standard measuring	Standard deviation ISO 17123-4	Measurement time, typical [s] (Condition E)	Measure time, maximum [s] (Condition D)
0.1m~500m	2mm+2ppm	0.7s~6s	20s
>500m	4mm+2ppm	3s~12s	50s

Fast measuring	Standard deviation ISO 17123-4	Measurement time, typical [s] (Condition E)	Measure time, maximum [s] (Condition)
0.1m~500m	3mm+2ppm	0.7s~3s	10s
>500m	5mm+2ppm	1.5s~6s	25s

* Beam interruptions, severe heat shimmer and moving objects within the beam path can result in deviations of the specified accuracy.

* Accuracy and measure time depend on atmospheric conditions, target object and observation situation.

Laser dot size

Distance [m]	Laser dot size, approximately [mm]
30m	12mm x 8 mm
50m	15mm x10 mm
100m	20mm x15 mm

Distance measurement characteristics

Principle: Pulse phase measurement

Type: Coaxial, visible red laser

Carrier wave: 660nm

Measuring system: Digital signal System analyzer; Multi-object recognizing technology

Mini-reading

Fine mode	1mm (0.01ft)
Tracking mode	10mm(0.1ft)
Distance unit	m/ft, selectable
Temperature unit	°C/°F, selectable
Pressure unit	hPa/mmHg/inchHg, selectable
Temperature input range	-30°C to +60°C (1°C steps)
Pressure input range	510hPa to 1066hPa(1hPa setps)
Prism constant condition	-99.9mm to +99.9mm
Refraction and earth curvature correction	OFF/0.14/0.2, selectable
Reflecting prism constant correction	-99.9mm to +99.9mm

Level vial sensitivity

Plate level 30" / 2mm

Circular level 8' / 2mm

Compensation

Dual-axis

System	Liquid type
Range	$\pm 3'$
Optical plummet(Optional)	
Accuracy	$\pm 0.8\text{mm}/1.5\text{m}$
Image	Erect
Magnification	$3\times$
Focusing range	$0.5\text{m} \sim \infty$
Field of view	4°
Laser plummet*²	
Accuracy	$\pm 1\text{mm}/1.5\text{m}$
Laser class	Class 2/IEC60825-1
Focusing range	$0.5\text{m} \sim \infty$
Laser wave length	635nm
Display	
LCD	8 lines \times 24 characters
Memory	
Internal memory	60000 points
External SD card	60000 points
Data communication	
I/O	RS-232C/USB/SD card/Bluetooth(optional) *3
Power	
Battery	3400mAh Li-ion Rechargeable battery
Voltage	7.2 V DC
Continuous operation time	9 hours(At +20°C)
Chargers	FDJ6-Li(100V to 240V 50/60Hz)
Charging time	Approx. 4 hours
Others	
CPU	32-bit
EDM technology	Digital signal processing, single mainboard
Working temperature	$-20^\circ \sim +50^\circ\text{C}$
Dimension	220 \times 184 \times 360mm(W \times D \times H)
Weight	5.5kg
Water proof	IP55(IEC60529)

*² Laser plummet mounted on the bottom of the vertical axis

*³ Bluetooth

28. Accessories

● Carrying case	1 pcs
● Battery	2 pcs
● Charger	1 pcs
● Adjusting pins	2 pcs
● Cleaning cloth	1pcs
● Screwdriver	1 pcs
● Wrench	1 pcs
● Silica gel	1 pcs
● Certification	1 pcs
● Packing list	1 pcs
● Instruction manual	1 pcs
● CD-ROM	1 pcs
●RS-232C Communication cable	1 pcs
● Reflective sheet/RP30	4 pcs (only for OTS680 series)
● Reflective sheet/RP60	1 pcs (only for OTS680 series)
● Laser caution sign board	1 pcs (only for OTS680 series)

Appendix I: Atmospheric correction formula and chart

(Just for reference)

Factory setting: temperature: 20°C, pressure: 1013hPa, 0ppm

The correction:

$$K_{pt} = 274.417 - 0.2905 * p / (1 + 0.0036 * t) \dots \dots \dots \text{RTS}$$

$$K_{pt} = 278.960 - 0.2902 * p / (1 + 0.0036 * t) \dots \dots \dots \text{OTS}$$

Where: p--Pressure value (hPa)

t--Temperature value (°C)

Kpt--Atmospheric correction (ppm)

Example:

t=20°C, p=1013hpa, L0=1000m.

Then: Kpt=0ppm (RTS)

Kpt=4ppm (OTS)


$$L = L_0(1 + K_{pt}) = 1000 \times (1 + 0 \times 10^{-6}) = 1000.000\text{m} \quad (\text{RTS})$$

$$L = L_0(1 + K_{pt}) = 1000 \times (1 + 4 \times 10^{-6}) = 1000.004\text{m} \quad (\text{OTS})$$


The atmospheric value is obtained easily with the atmospheric correction chart.

Find the measured temperature in horizontal axis, and pressure in vertical axis on the chart.

Read the value from the diagonal line, which is the required atmospheric correction value.

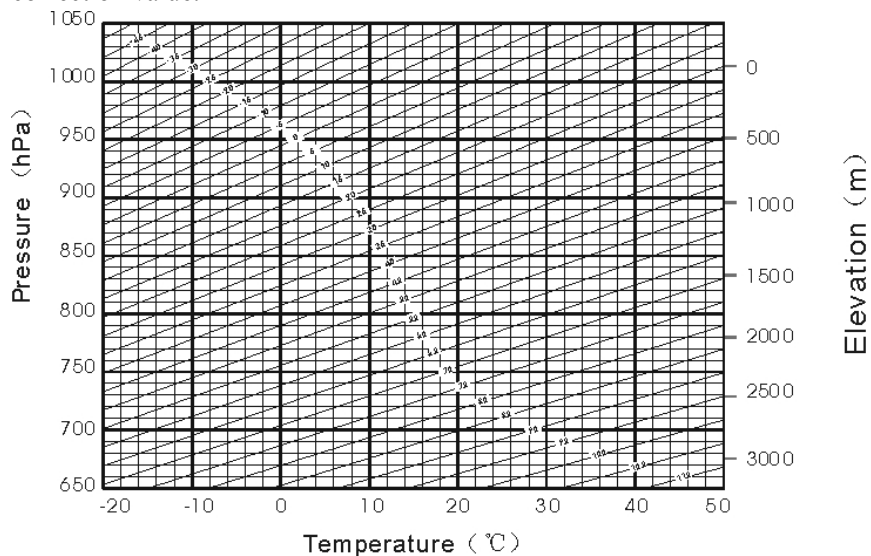

For RTS series

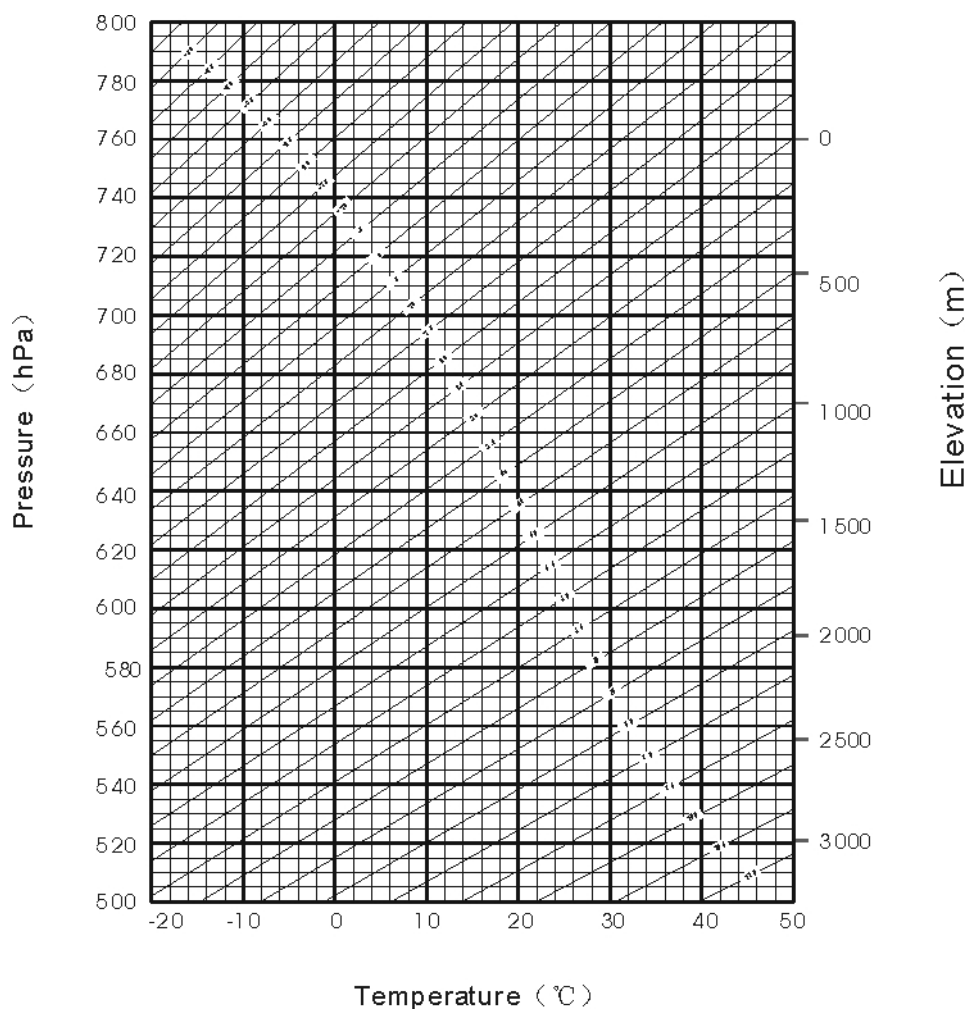

For OTS series

Appendix II : Correction for refraction and earth curvature

curvature

Considering the correction of refraction and earth curvature for distance measurement, the formula for slope distance, horizontal distance and vertical distance applied in the instrument are as followings:

$$SD = D_0 \times (1 + ppm \times 10^{-6}) + mm$$

SD — —Displayed slope distance (m)

D_0 — —Real measured distance (m)

ppm — — Scale coefficient (mm/km)

mm — —Target constant (mm)

$$HD = Y - A \times X \times Y$$

$$VD = X + B \times Y^2$$


HD — —Horizontal distance (mm)

VD — —Vertical distance (mm)

$$Y = SD \cdot |\sin \xi|$$

$$X = SD \cdot \cos \xi$$

ξ — —Zenith angle

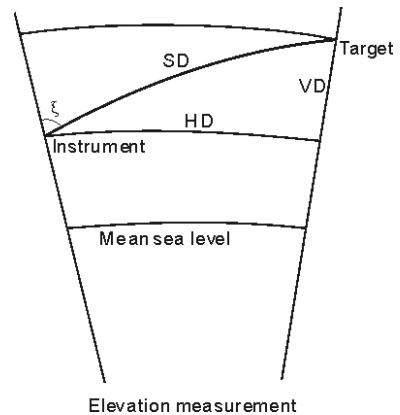

$$A = \frac{1 - \frac{K}{2}}{R}$$

$$B = \frac{1 - \frac{K}{2}}{2R}$$

$$K = 0.142 \text{ or } 0.20$$

$$R = 6.37 \times 10^6 \text{ (m)}$$

The conversion formula for horizontal and vertical distance is as follows when correction for refraction and earth curvature is not applied:

$$HD = SD \cos \xi \quad VD = SD \cdot |\sin \xi|$$

NOTE:

◆ The factory setting for the refraction coefficient K is 0.142.

Refer to the “§3.8.1 Measure Condition Setting” to change the value.

Appendix III: Connect the TS680 series with PDA

1. Connect the TS 680 series and PDA(Here we will take Carlson Explorer as a example) with RS-232C cable



2. Refer to the chapter 3.8.3 Communication Port Setting to set the parameters on TS 680 series. And then set the instrument at basic measurement mode, as followings shown:

Meas	PC	0
	ppm	0
SD		
VA	302.5432gon	I
HA	85.8888gon	P1
DIST	SHV	OSET
CORD		

3. Run the survey program on the PDA, for example, SurvCE.exe of Carlson, then select the instrument mode in the SurvCE.

NOTE: “Sokkia Set” for TS 680 series is available.



4. Set the communication parameters on the PDA, they must be same with TS 680 series's. And select the "2-Way" in communication setting.
5. And then the PDA will sending data to TS 680 series to test the communication, if they can not communication, check the cable connection and parameters to try again.

NOTE:

These designs, figures and specifications are subject to change without notice. We shall not be held liable for damages resulting from errors in this instruction manual.



Suzhou FOIF Co.,Ltd.

Tel: +86-512-65224904

Fax: +86-512-65230619
+86-512-65234905

E-mail: internationalsales@foif.com.cn

Web: <http://www.foif.com.cn>

